

Recall Bulletin 190412REV



RECALL BULLETIN:
190412REV

YEAR(S) AFFECTED:
2019

PRODUCT(S) AFFECTED:

Fleetwood Flair Model 32 S only
Manufactured 6/20/2018 through 2/22/2019

Holiday Rambler Model 32 S only
Admiral
Manufactured 6/29/2018 through 3/22/2019

MODEL(S) AFFECTED:
32 S Only

SUBJECT:

Inspection / Correction of Generator Exhaust Pipe Routing

KEYWORDS:

Exhaust, Generator

ISSUE DATE:

May 2019

The purpose of this Recall Service Bulletin is to inform all REV Recreation Group dealers about the need to inspect the generator exhaust pipe routing on certain model year 2019 Fleetwood Flair Model 32 S, and certain model year 2019 Holiday Rambler Admiral Model 32 S, to ensure the exhaust pipe does not intrude into the departure angle of the coach. If the generator exhaust pipe is improperly routed, it will need to be replaced with a different exhaust pipe that exits at the rear of the vehicle.

The lists of affected motorhomes and required replacement parts appear at the end of this Bulletin.

CONDITION:

On motorhomes affected by this recall, the generator exhaust pipe may be routed in a manner that causes it to intrude into the departure angle of the coach. This improper mounting location could cause the generator exhaust pipe to become damaged or sheared off when the vehicle is driven on an incline, potentially allowing carbon monoxide from generator exhaust emissions to enter the vehicle, which could result in illness or death.

PROCEDURES:



Dealers are required to call REV Dealer Technical Support to obtain Prior Authorization before beginning any work and after the unit is in their bay. You will receive instructions and will be provided any necessary part ordering information.

Fleetwood Dealer Technical Support: (800) 816-9825
Holiday Rambler Dealer Technical Support: (877) 332-9239

- **READ THIS ENTIRE BULLETIN CAREFULLY BEFORE PROCEEDING AND FOLLOW ALL SAFETY PRECAUTIONS.**
- **Review the list of affected units at the end of this bulletin to ensure the motorhome you are inspecting is part of this campaign.**
- **Take a copy of this bulletin with you when servicing the unit.**
- **PHOTOS WILL BE REQUIRED FOR THE FOLLOWING PROCEDURES. READ PHOTO REQUIREMENTS CAREFULLY. INSUFFICIENT PHOTO DOCUMENTATION MAY RESULT IN CLAIM DENIAL**
- **If there are any questions after reviewing the entire procedure, contact REV Dealer Technical Support.**



This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

WARNING

- KEEP CLEAR OF ALL PINCH POINTS WHEN WORKING UNDER A MOTORHOME.
- THE LEVELING JACKS SHOULD NOT SUPPORT ANY WEIGHT OF THE MOTORHOME WHILE WORK IS PERFORMED. FAILURE TO FOLLOW THIS WARNING MAY RESULT IN PERSONAL INJURY.
- DO NOT WORK UNDER AN ELEVATED MOTORHOME UNLESS IT IS SUPPORTED BY A HOIST OR WITH JACK STANDS CAPABLE OF SUPPORTING ITS WEIGHT.
- HEED ALL PRECAUTIONS AND USE APPROPRIATE PERSONAL PROTECTIVE EQUIPMENT TO AVOID INJURY.

INSPECTION

NOTE: This document only applies to the Flair/Admiral 32 S; no other models are affected.

1. Park the motorhome on dry, level pavement. Place the transmission into PARK and set the parking brake. Turn off the ignition and remove the ignition key. Maintain control of keys while work is performed.
2. Turn off the ignition and remove the ignition key. Maintain control of the ignition key until all repairs are completed. Attach a notice, "Do Not Use", to the generator switch in order to prevent activation of the system.
3. Block wheels to prevent movement.
4. At the driver's side, rear of the coach, locate the generator exhaust pipe and determine whether it exits on the side of the motorhome or out the rear, under the bumper. See Figures 1 & 2 for both examples of exhaust pipe routing.
 - a) If the generator exhaust pipe exits the motorhome at the rear of the coach under the bumper, take several clear photos (see Photo Requirements on Page 3) and submit a claim using code 6080-11, "Inspected/Not Defective"; no more work is required.
 - b) If the generator exhaust pipe exits on the side of the motorhome, take several clear photos (see Photo Requirements on Page 3) and then proceed to the Repair Procedure beginning at Step 5.

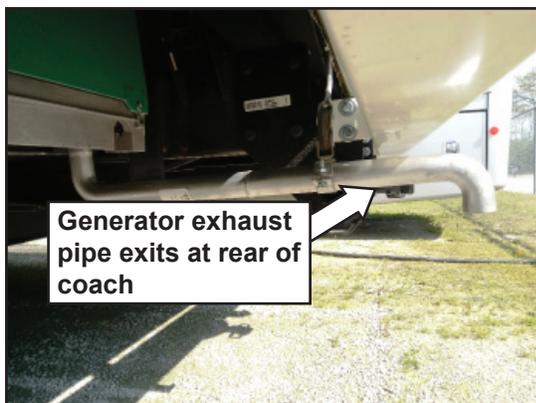


Figure 1 – Correct Installation

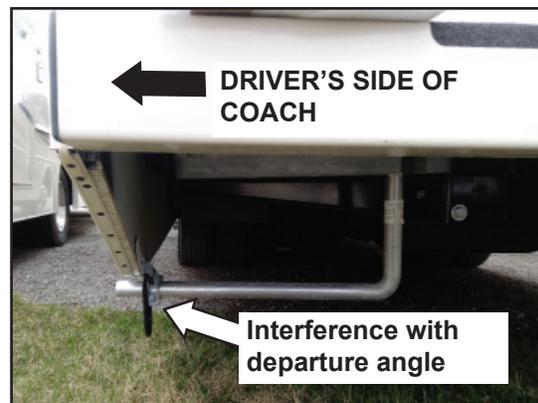


Figure 2 - Repair Needed

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Photo Requirements:



For Non-Defective Units: Take photos that clearly show that the generator exhaust pipe has been properly routed. Submit the photos with an authorization request for Inspected/Not Defective. See Figure 1 (Page 2) for an exemplar photo.



For Defective Units: “Before” and “after” photos will be required.

- Before beginning repairs, take several photos clearly showing the generator exhaust misrouted out the side of the motorhome. See Figure 2 (Page 2) for an exemplar photo.
- After completing repairs, take several photos that clearly display the corrected routing of the generator exhaust out the rear of the coach, under the bumper. See Figure 1 (Page 2) for an exemplar photo. Submit both sets of photos with an authorization request for Inspected/Defective/Repaired.

REPAIR PROCEDURE

NOTE: Prior to ordering parts and/or starting work, verify the size of the generator that is installed in the unit you are repairing. It will either be a 4.0 kW or 5.5 kW Onan generator; this will affect which part is needed for the repair.

5. Referencing Figure 3:

- Remove the hardware clamping the generator exhaust hanger to the generator exhaust pipe using a $\frac{1}{2}$ ” open end wrench and ratchet with a $\frac{1}{2}$ ” deep well socket.
- Once loose from the exhaust pipe, remove the generator exhaust hanger by removing the $\frac{1}{4}$ ” HWH screw holding it to the sidewall with a $\frac{3}{8}$ ” driver bit and drill. Set aside all of the generator exhaust hanger components and fasteners for later reinstallation.
- Using a $\frac{3}{8}$ ” driver bit and drill, remove both $\frac{1}{4}$ ” HWH screws holding the generator exhaust pipe guard to the sidewall. Discard the generator exhaust pipe guard and mounting screws as they will not be reinstalled.

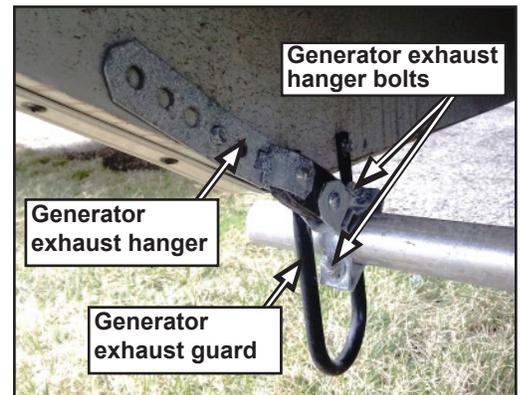


Figure 3

6. Referencing Figure 4, remove the generator exhaust pipe by loosening the U-bolt clamp securing the generator exhaust pipe to the generator with a ratchet and a $\frac{1}{2}$ ” deep well socket. Set aside the U-bolt exhaust clamp for later reinstallation. Discard the generator exhaust pipe as it will not be reinstalled.

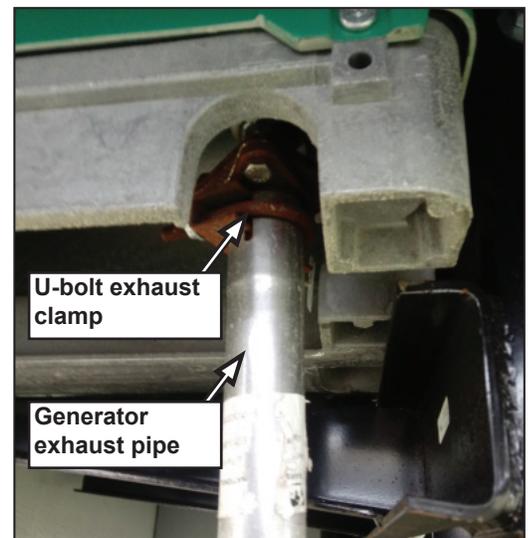


Figure 4

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

7. Begin reinstallation by sliding the new generator exhaust pipe onto the generator exhaust port until it is fully seated to the bottom of the flared end or is tight against the bottom of the generator. Be sure it is oriented so that it exits the rear of the vehicle under the bumper; reference Figures 5 and 6. Clamp in place with the U-bolt exhaust clamp previously removed in Step 6; carefully position the U-bolt so that the nuts can be easily tightened with a ratchet and a 1/2" deep well socket.

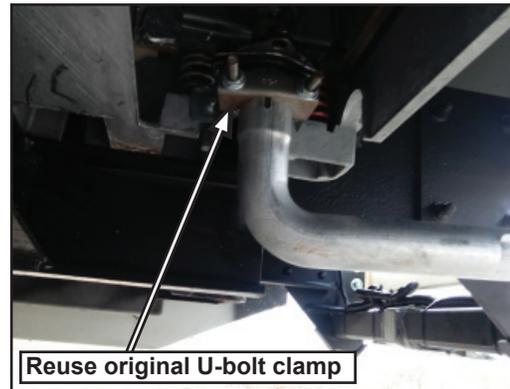


Figure 5

8. Reinstall the generator exhaust hanger onto the new generator exhaust pipe below the inner edge of the rear wall using a 1/2" open end wrench and a ratchet with a 1/2" deep well socket. Then, using a 3/8" driver bit and drill, install a 1/4" HWH self-tapping screw thru the third hole (from the top) of generator exhaust pipe hanger into the inside of the rear wall, 1" up from the bottom of the wall, reference Figures 7 and 8 for clarification. Install a second 1/4" HWH self-tapping screw into the top hole on the generator exhaust hanger, taking care to not over torque as the top screw is being secured into sheet steel only.



Figure 6

9. Use silicone sealant to seal the screw holes in the sidewall where the defective components were removed, in order to prevent water intrusion.

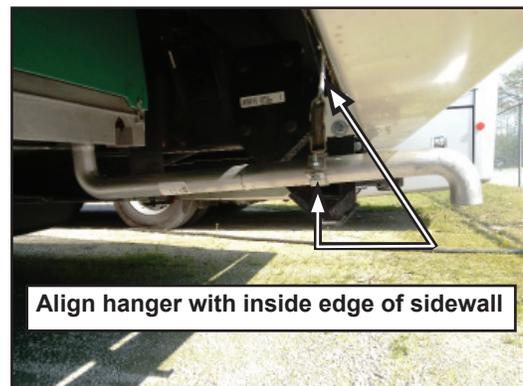


Figure 7

10.  **PHOTO REQUIREMENT:** When the repair has been completed, take photos to submit with the repair claim.



Figure 8

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

TOOLS

Wheel Chocks
Power Drill
3/8" Driver Bit
1/2" Open End Wrench
1/2" Deep Well Socket

Ratchet
Tape Measure
Caulking Gun
Flashlight

PARTS

Order only 1 of the 2 exhaust pipe part numbers listed below, depending on the model of generator installed on the vehicle with which you are working:

<u>Part Number</u>	<u>Description</u>
10774829 (ref. B65-0131)	Exhaust Pipe for Model 4.0 kW Onan Generator
10774830 (ref. B65-0132)	Exhaust Pipe for Model 5.5 kW Onan Generator

OBTAIN LOCALLY

Silicone
1/4" HWH Self-Tapping Screws

WARRANTY LABOR ALLOWANCE:

Recall 190412REV, Flair/Admiral Model 32 S Generator Exhaust Routing

Use flat rate codes:

6080-11	Inspected/Not Defective	0.1 hr.	Prior Authorization Required
6080-12	Inspected/Defective/Repaired	0.3 hr.	Prior Authorization Required

If you have any questions concerning this bulletin, contact REV Dealer Technical Support:

Fleetwood Dealer Technical Support: (800) 816-9825

Monaco/Holiday Rambler Dealer Technical Support: (877) 332-9239

Service Literature is available at: <http://www.revrdealers.com>

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Recall 190412REV Affected Unit Serial Numbers - Fleetwood

Model Year 2019 Fleetwood Flair (Model 32 S Only)

REV Unit Identification #	Chassis VIN #
755JK4432626	1F66F5DY3K0
755RK4432628	1F66F5DY0K0
755MK4432687	1F65F5DYXK0
755RK4432689	1F66F5DY6K0
755MK4432693	1F65F5DY5K0
755MK4432697	1F65F5DY4K0
755AK4432699	1F64F5DYXK0
755MK4432701	1F65F5DY5K0
755AK4432706	1F64F5DY5K0
755RK4432708	1F66F5DY6K0
755MK4432711	1F65F5DY7K0
755RK4432713	1F66F5DY7K0
755AK4432744	1F64F5DY4K0
755MK4432746	1F65F5DY8K0
755AK4432748	1F64F5DY2K0
755MK4432750	1F65F5DY9K0

REV Unit Identification #	Chassis VIN #
755JK4432754	1F66F5DY7K0
755MK4432758	1F65F5DY2K0
755MK4432760	1F65F5DY0K0
755SK4432768	1F66F5DY0K0
755AK4432811	1F64F5DY9K0
755JK4432813	1F66F5DY8K0
755AK4432815	1F64F5DYXK0
755MK4432817	1F65F5DY3K0
755RK4432819	1F66F5DY9K0
755AK4432821	1F64F5DY8K0
755MK4432823	1F65F5DY6K0
755JK4432825	1F66F5DY7K0
755AK4432855	1F64F5DY0K0
755MK4432857	1F65F5DY7K0
755MK4432865	1F65F5DY7K0

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."

Recall 190412REV Affected Unit Serial Numbers - Holiday Rambler

Model Year 2019 Holiday Rambler Admiral (Model 32 S Only)

REV Unit Identification #	Chassis VIN #
655JK4432630	1F66F5DY9K0
655RK4432632	1F66F5DY5K0
655RK4432634	1F66F5DY2K0
655JK4432636	1F66F5DY4K0
655SK4432640	1F66F5DY9K0
655MK4432703	1F65F5DY6K0
655SK4432752	1F66F5DY5K0
655AK4432756	1F64F5DY9K0
655AK4432762	1F64F5DY1K0
655JK4432764	1F66F5DY0K0
655MK4432766	1F65F5DY8K0

REV Unit Identification #	Chassis VIN #
655MK4432771	1F65F5DY2K0
655MK4432800	1F65F5DY1K0
655AK4432802	1F64F5DY4K0
655MK4432805	1F65F5DYXK0
655RK4432807	1F66F5DY0K0
655MK4432809	1F65F5DY4K0
655MK4432827	1F65F5DY1K0
655JK4432859	1F66F5DY6K0
655MK4432861	1F65F5DY9K0
655SK4432863	1F66F5DY5K0
655MK4432867	1F65F5DY4K0

This bulletin is supplied for technical information only and is not an authorization for repairs.

Federal law (section 154 of the national traffic and motor vehicle safety act of 1966) requires that: If you have received a notice of recall or failure to comply from REV Recreation Group or any component Manufacturer, you must repair or otherwise correct the defects on vehicles remaining in your inventory, according to the notification, before selling or leasing the vehicles. Any vehicle lessor receiving this recall notice must forward a copy of the notice to the lessee within ten days.

"It is impossible to know, evaluate and advise the service trade of all conceivable ways in which service might be done or of the possible hazardous consequences of each way. Accordingly, anyone who uses a service procedure or tool must first assure that neither personal safety nor vehicle safety will be jeopardized by the selected service methods."