



Mercedes-Benz

Campaign No. 2019090008 October 2019

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model E-Class Station Wagon vehicles (213 platform)**  
**Model Year 2017-2019**  
**Check threaded connection of roof spoiler, rework if necessary**

Daimler AG ("DAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain Model Year ("MY") 2017-2019 E-Class Station Wagon vehicles (213 platform), the spoiler on the tailgate may not have been fastened according to current production specification. At higher speeds, the spoiler might completely detach from the vehicle, increasing the risk of a crash for following traffic. An authorized Mercedes-Benz dealer will check the fastening of the tailgate spoiler, and rework, if necessary.

Prior to performing this Recall Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Recall Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

Approximately 4,765 vehicles are involved.

Order No. P-RC-2019090008

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

### Check/test procedure

1. Open liftgate.
2. Check that all four mounting nuts (**A, figure 1**) of roof spoiler threaded connection are present.
  - i** Check by hand that mounting nuts are firmly seated.

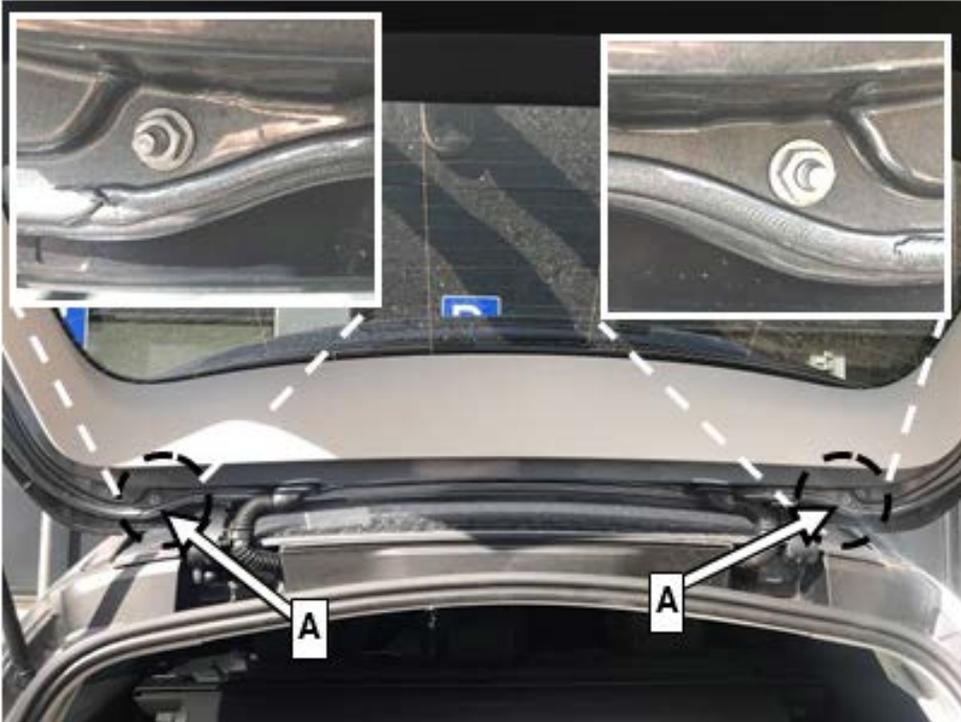


Figure 1

- a. If the mounting nuts are **not** present: Perform **work procedure**.
- b. If the mounting nuts are **present**: **End measure**.

**i** The findings from the check/test procedure must be recorded on the work order.

### Work procedure

1. Remove top liftgate trim.
  - i** For basic data, see **AR72.20-P-6631LWS**.
  - i** There are two mounting nuts located under the liftgate trim.
2. Retighten existing and/or loose mounting nuts of roof spoiler threaded connection to specified torque and retrofit missing mounting nuts.
  - i** Roof spoiler is installed with **four** mounting nuts!
  - i** For basic data, see **AR72.20-P-4000LW**.
  - Hm** Nut of rear spoiler at liftgate **8 Nm**

**Primary Parts Information**

<b>Qty.</b>	<b>Part Name</b>	<b>Part Number</b>	<b>Estimated Replacement Rate</b>
As required	Nut-and-washer assembly	A 002 990 36 50	5%

**Warranty Information****With check**

**Operation:** Check roof spoiler (02-1341)

<b>Damage Code</b>	<b>Operation Number</b>	<b>Labor Time (hrs.)</b>
77 920 01 8	02-1341	0.1

**With check and replace**

**Operation:** Check roof spoiler (02-1341)  
Rework roof spoiler (02-1342)

<b>Damage Code</b>	<b>Operation Number</b>	<b>Labor Time (hrs.)</b>
77 920 01 7	02-1341	0.1
	02-1342	0.5

** Note**

Operation labor times are subject to change.