

# Safety Recall Code: 69Q8

Subject	TAKATA Driver Frontal Airbag Inflator			
Document History	Date Summary			
Bocument mistory	April 30, 2024 Updated part return/disposal information			
Affected Vehicles	U.S.A. & CANADA: Certain 2006-2007 MY Volkswagen Passat Sedan & Passat Wago vehicles equipped with a Takata driver frontal airbag			
	Check Campaigns/Actions screen in Elsa on the day of repair to verify that a VIN qualifies for repair under this action. Elsa is the <u>only</u> valid campaign inquiry & verification source.			
	<ul> <li>✓ Campaign status must show "open."</li> <li>✓ If Elsa shows other open action(s), inform your customer so that the work can also be completed the same time the vehicle is in the workshop for this campaign.</li> </ul>			
Problem Description	The driver airbag may explode in a crash with airbag deployment. Sharp metal fragments can hit people and cause serious injury or death.			
Corrective Action	Replace the driver frontal airbag inflator with a newly manufactured version. This repair is the <u>final</u> remedy.			
Parts Information	Parts will be allocated weekly. Please email <u>VWoAPartsSpecialists@vw.com</u> with VIN if you do not have the proper part(s) in stock.			
Code Visibility	On or about April 19, 2018, affected vehicles were listed on the Inventory Vehicle Oper Campaign Action report under My Dealership Reports (found on <u>www.vwhub.com</u> & OMD Web) A list was not posted for dealers who did not have any affected vehicles.			
	On or about April 19, 2018, this campaign code showed open on affected vehicles in Elsa			
	On or about April 19, 2018, affected vehicles were identified with this campaign code in the V Lookup tool at <u>www.vw.com</u> and on the NHTSA VIN lookup tool at <u>www.safercar.gov</u> .			
Owner Notification	Owner notification took place in April 2018. Owner letter examples are included in this bulle for your reference.			
Additional Information	Please alert everyone in your dealership about this action, including Sales, Service, Part and Accounting personnel. Contact Warranty if you have any questions.			
	IMPORTANT REMINDER ON VEHICLES AFFECTED BY SAFETY & COMPLIANCE RECALLS			
	<u>New Vehicles in Dealer Inventory:</u> It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covere by this notification under a sale or lease until the defect or noncompliance is remedied. B law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comple with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.			
	<u>Pre-Owned Vehicles in Dealer Inventory:</u> Dealers should not deliver any pre-owned vehicle in their inventory which are involved in a safety or compliance recall until the defect has bee remedied.			
	Dealers must ensure that every affected inventory vehicle has this campaign completed <u>befor</u> <u>delivery to consumers</u> .			
	Fill out and affix Campaign Completion Label (CAMP 010 000) after work is complete. Labels can be ordered at no cost via the Compliance Label Ordering portal at www.vwhub.com			

#### **Claim Entry Instructions**

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the Elsa screen print showing action <u>open on the day of repair</u> to the repair order.

If customer refused campaign work:

- ✓ U.S. dealers: Submit request via WISE under the Campaigns/Update/Recall Closure option.
- ✓ <u>Canada dealers:</u> Fax repair order to Warranty at (905) 428-4811.

Service Number	69Q8				
Damage Code	0099	0099			
Parts Vendor Code	WWO				
Claim Type	Sold vehicle: 7	10			
	Unsold vehicle	: 7 90			
Causal Indicator	Mark airbag in	flator kit* as causal p	part		
Vehicle Wash/Loaner	USA: Do not c coverage clain		action. For rental/loaner claiming, see special		
	Canada: Do no	ot claim wash/loaner	under this action		
Criteria I.D.	N1				
		Install new airbag inflator kit. Labor operation: 6958 56 99 105 T.U.			
	Quantity Part Number Description				
	1.00	3C0898201F*	Airbag Inflator Kit Without Vibration Damper		
Criteria I.D.	T1				
	Install new airbag inflator kit.				
	Labor operatio	n: 6958 56 99	105 T.U.		
	Quantity	Part Number	Description		
	1.00	3C0898201G*	Airbag Inflator Kit With Vibration Damper		

Continue to next page

#### **USA ONLY** – Special Coverage Claiming

Rental Car/Loaner Claim	Rental Car/Loaner Claiming		
Criteria I.D.	All criteria		
	- MUST BE CLAIMED ON A SEPARATE LINE –		
	- DO NOT PUT ON CAMPAIGN CLAIM -		
	Claim Type: 1SP		
	Service Number: X176		
	Damage Code: 0055		
	Vendor Code: 444		
	Loaner or Rental		
	Labor Operation: X176US00		

#### **Customer Letter Example (USA)**

This notice applies to your vehicle: <VIN>

NHTSA: NEED

#### Subject: Safety Recall 69Q8 - Takata Driver Frontal Airbag Inflator

Certain 2006-2007 Model Year Volkswagen Passat Sedan & Passat Wagon Vehicles Equipped with a Takata Driver Frontal Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2006-2007 model year Volkswagen vehicles equipped with a Takata driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

#### **DANGER!** The driver airbag may explode in a crash with airbag deployment. Sharp metal fragments can hit people and cause serious injury or death. Schedule this recall repair immediately. What should you do? Volkswagen dealers are the only locations authorized to complete the recall work. Please contact your local Volkswagen dealer directly to schedule this recall repair without delay. For your convenience, you can also visit www.vw.com/find-a-dealer to locate a dealer near you and schedule this service online. What will we do? To correct this defect, your Volkswagen dealer will replace the driver airbag inflator in your vehicle. This work will take about two hours to complete and will be performed for you free of charge. Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule. Lease vehicles and If you are the lessor and registered owner of the vehicle identified in this action, the law address changes requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records. Can we assist you If your authorized Volkswagen dealer fails or is unable to complete this work free of charge further? within a reasonable time, or if you should have any questions about this communication, please don't hesitate to contact Customer CARE, Monday through Friday by phone at 800-893-5298. You are also welcome to chat through the "Contact Us" pade http://www.vw.com/contact. **Checking your vehicle** To check your vehicle's eligibility for repair under this or any other recall/service campaign, please click on the Look Up Recalls link at www.vw.com and enter your Vehicle Identification for open Recalls and Service Campaigns Number (VIN) into the Recall/Service Campaign Lookup tool.

If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to <a href="http://www.safercar.gov">http://www.safercar.gov</a>.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

This notice applies to your vehicle: <VIN>

#### Subject: Safety Recall 69Q8 - Takata Driver Frontal Airbag Inflator Certain 2006-2007 Model Year Volkswagen Passat Sedan & Passat Wagon Vehicles Equipped with a Takata Driver Frontal Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2006-2007 model year Volkswagen vehicles equipped with a Takata driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

	DANGER!				
The	The driver airbag may explode in a crash with airbag deployment.				
Sharp m	etal fragments can hit people and cause serious injury or death.				
What should you do?	Schedule this recall repair immediately.				
	Please contact your authorized Volkswagen dealer without delay to schedule this recall repair.				
What will we do?	To correct this defect, your authorized Volkswagen dealer will replace the driver airbag inflator in your vehicle. This work will take about two hours to complete and will be performed for you free of charge.				
	Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule.				
Lease vehicles and address changes	If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.				
Can we assist you further?	If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, please contact Customer Relations, Monday through Friday from 8AM to 8PM EST by phone at 1-800-822-8987 or via our "Contact Us" page at <u>www.vw.ca</u> .				

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

## **Campaign Work Procedure**

## A DANGER

- The driver frontal airbag inflator could potentially rupture (due to propellant degradation occurring after longterm exposure to absolute high humidity and temperature cycling). In the event of an inflator rupture, in very rare cases metal fragments could pass through the airbag cushion material, which may result in serious injury or death.
- This Recall should be performed before any other work is performed on the vehicle.

## 

Risk of injury. Refer to "Warning and Safety Precautions", found in Appendix A at the end of this document.

## U NOTE

- Damages resulting from improper repair or failure to follow these work instructions are the dealer's responsibility and are not eligible for reimbursement under this action.
- This procedure must be read in its entirety prior to performing the repair.
- Due to variations in vehicle equipment and options, the steps/illustrations in this work procedure may not identically match all affected vehicles.
- Diagnosis and repair of pre-existing conditions in the vehicle are not covered under this action.

#### **Required Parts**

<u>Criteria</u>	<u>Quantity</u>	Part Number	Part Description
N1	1	3C0898201F	Airbag Inflator Kit Without Vibration Damper
T1	1	3C0898201G	Airbag Inflator Kit With Vibration Damper

## **I**NOTE

All inflator kits include inflator, inflator nuts, horn ring bolts and one replacement horn ring spring.

## Required Safety Equipment






• Ear Protection (locally sourced)

• Face Shield (locally sourced)

## **Required Tools**

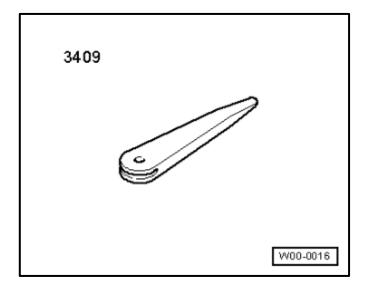



• Trim Removal Wedge - 3409 (or equivalent)

• ESD Work surface - VAS 6613







Bar Code Scanner – VAS6161/1

Airbag Support - T10568

• VAS6150D - Diagnostic Tester (or equivalent)



## **Required Work Environment**

## 

#### Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.

## **I**NOTE

The work area must be in the vicinity of the scan tool and the vehicle in order to properly complete this procedure.



- Workbench that will support a vice.
- Work surface free of unnecessary tools, equipment and debris.


VAG1410 - Torque Wrench (or equivalent)

## **Repair Instruction**

## **Section A - Check for Previous Repair**

## i TIP

If Campaign Completion label is present, no further work is required.

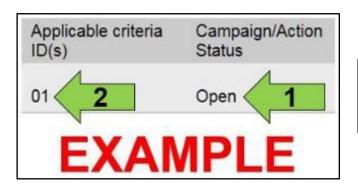

• Enter the VIN in Elsa and proceed to the "Campaign/Action" screen.

#### 

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>. If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

Proceed to Section B

#### Section B – Inflator Identification (all vehicles)

#### 

#### Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
  - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
  - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.




Prior to beginning repairs, verify the horn is operational.

## 

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.



https://vwcup.track360.com/?p=vwiqCertification&id=11288

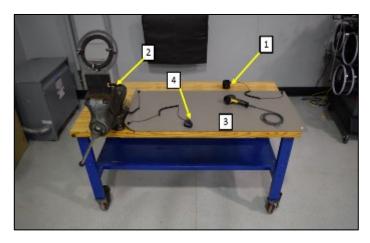

## **I**NOTE

•

repair.

• Prior to beginning work, all parts and tools are to be placed on the ESD table mat.

Use the QR code or the link to view a video


detailing the repair process prior to performing the

- The workstation must be in the vicinity of the vehicle.
- Assemble ESD workplace -VAS 6613- <1, 2, 3, and 4>.
- Plug ESD workplace into a wall socket using plug <1>.

#### 

The wall socket or extension cord must have a sufficient ground.

- Clamp Airbag Support T10568 <2> into the vice.
- Connect crocodile clip <1> to airbag support <2> and ESD workplace -VAS 6613-.

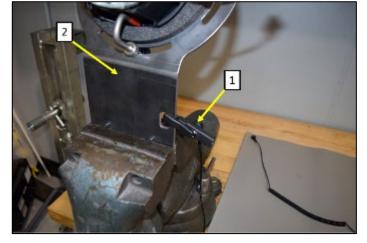



- Ensure ODIS is updated to the latest version.
- Connect vehicle diagnostic tester.
- Select Start Diagnosis function and identify vehicle.
- After identification of control units, Guided Fault Finding is started automatically.
- Follow the instructions on screen.

mporter: Dealer: RO:	444 03999 	VIN: Engine:	CCTA 2.0 L Motronic/147kW	🧀 🛃 🏷 0	
ontrol modu	les Orders DISS TSB Test plan Operation	on Special Functions			080
ests for the	entre vehicle				- Frank
Status	Tests				A Measurement
-	Showroom mode				😭 Info
	Special actions				
-	Adapt Mechatronics software				Admin
-	Adapt SW for pwr. supply sys. ctrl.	mod. (BCM)		E.)	100 3
-	Adapt airbag software				Log *
	and a state of the				Data
-	Adapt software steering wheel ele	ctronics		14	Extras
-	Adapt software, diesel, exhaust E/	A189 action 23Q3			Extras
-	Production status documentation p	part number on the replacement	airbag module/gas generator		Help 4
-	Reset the assembly sate test/DTC	memory			🕑 Onine Help
	Software version management				🍪 Support
1				1.	
Perform test	Display documents				<u>&gt;&gt; 21 6</u>
				Device drivers	e is ready to use 🐴 🕷


#### In operating mode <u>Special Functions</u>, Select "Production status documentation part number on the replacement airbag module/gas generator" <arrow>.

mporten: Xealer: 80:	444 03999	VIN: Engine:	CCTA 2.0 L Motroni	c/147kW	🛫 🔩 📎	alle a	
	DISS TSB	Operation Sciencial Functions				Operating modes	* *
Airbag ABD					Complete/Continue	😵 Glagnosis	
NOTE:					oundeeround de	()	
	ts you with the back documer	ntation of the part number of the new o	gas generator/airbag module for the			(Crush)	
airbag system.						A Measurement	
	inned value with the value	shows the bar code on				😝 Info	
the gas generato module. Should t	or or between the asterisks there be a discrepancy in t	(**) on the airbag				GrAinin'	
- configure the so	e manually in the input fiel canner after the completion code from the description	n of the program with				Log	*
						Data	*
						Current View	
						3 Print	4
						Diagnostic Session	6
				*		The Read	1 -
1.0		< > >					

- Scanning the data matrix code during this test plan step calibrates the scanner to avoid error messages.
- Scanning the calibrating data matrix code may not have to be done every time (only when the scanner requires calibration). You will know if the scanner needs calibrating if the scanner does not scan the inflator's data matrix code.
- If the inflator data matrix code cannot be scanned, then print out this matrix shown below and scan the printout.



After calibrating the scanner, select "Complete/Continue"

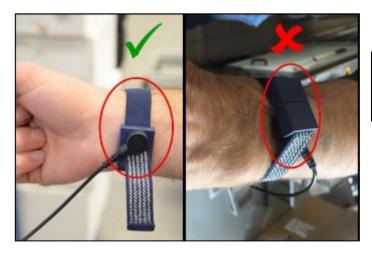

• Put the wrist strap from the ESD workplace on your wrist.

## 

The white dots on the wrist strap must be against the skin.

# TILGER


#### 

- There are two types of inflator. One version is "with vibration absorption" and one is "without vibration absorption".
- Airbags with vibration absorption may be identified by the word "TILGER" on the label found on the airbag.

## 

In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator versions WITH vibration absorption" instructions.

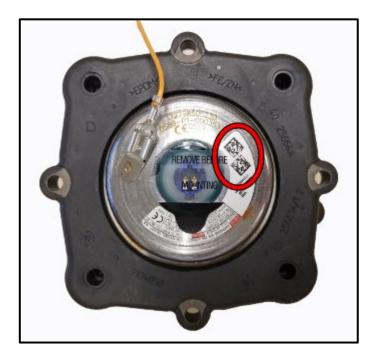

- Place the new inflator on the ESD mat.
- Scan the data matrix code of the new inflator at a distance of about 15 cm.

Ensure the correct inflator data matrix code is scanned at this time.						
<u>Criteria</u>	Part Number					
N1	3C0 898 201 F					
T1	3C0 898 201 G					

## **I**NOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.



## **I**NOTE


The data matrix code includes the values as shown.

mporter:	444	VIN:				0
ealer:	03999	Engine:	CCTA 2.0 I. Motronic/14	7kW		recommences 8 0 sustain
0:						
brittol/mod6less]0	DISS TSB	Operation Science Functions				Operating modes *
Airbag ABD				RX	la Arresta	2 Diagnosis
nput					Accept	(Micho
Scan the barcode				*		C Flash
						A Weasurement
Note that no nu active.	meric values are displayed v	hile Caps Lock is				😭 info
						Section 2
						Log ¥
						Data *
						Current View
						B Print
						Diagnostic Session
						Constanting of the second seco
a 💽	K	< > >	Help	st		> 2 0
6 e					- 5 8 8	
Once th	e new inflator has	been successfully sca	nned, press " <b>Accept"</b>			
D NOTE						
• Co	mpare the scanne	d value with the value	shown above the data	matr	ix code on the n	ew inflator.
● If th	nere is a discrepa	ncy, manually enter the	value from the new ir	nflator	in the input field	1.
	1				•	

Officiand Diagnostic In	formation System Service - 31.3		And the second se	The second s		
Importer:	444	VIN:				
Dealer: RO:	03999	Engine:	CCTA 2.0 L Motronic/147kW			-
and hoddles	DISS TSB	Operation			Operating modes	
				71	Diagnosis	
Airbag ABD				+1+	2000	
Driver/front passer	iger side			· 2 ·		é.
On which side was	s the gas generator replaced?		A 7	+3+	C Flash	
1. Driver side 2. Front passenge	ar oldo		2		A Measurement	
3. Back 4. Cancel	1 side			.4.	e Info	
4. Gancer					(Q Admin	
						ł
					Log ¥	
					Data A	e -
					Current View	
					D Print	
					Diagnostic Session	
					EB (ADA):	
					13 trait	*
	K	< > >	Help Cancel test		>	3
a a 1	<mark>~</mark> [11] [12]	and the second se	the second s		250.9	M
• Sel	ect option 1 indica	ating that the Driver sic	de inflator was replaced.			
	er selecting option ntification.	n 1, a valid GeKo ID	will need to be entered in a	order to upload	the new infl	ator
• Upl	load diagnostic loo	j online.				
			of Non-payment!			
<b>D</b> ' ' '					1	
Diagnosis i	ogs must be sent	on-line after the test p	lan is completed to be conside	ered for reimpur	sement.	

Continue to Section C.

## Section C – Battery Disconnect

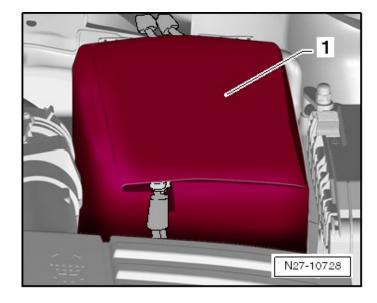

#### 

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched **ON**.

## 

Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.


- Turn **ON** the ignition.
- Move the driver seat to the most rearward position.
- Fully recline driver seat.

## 


Reclining the driver seat before disconnecting the battery allows for additional safety in the event Terminal 15 power is not restored when reconnecting the battery at the end of the repair.


- Open the battery protective covering <1>.
- Loosen the nut <1>.
- Remove and isolate the battery ground cable terminal from the battery terminal.

#### Continue to Section D.

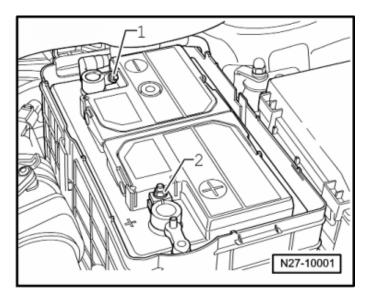

## Section D – Airbag Removal

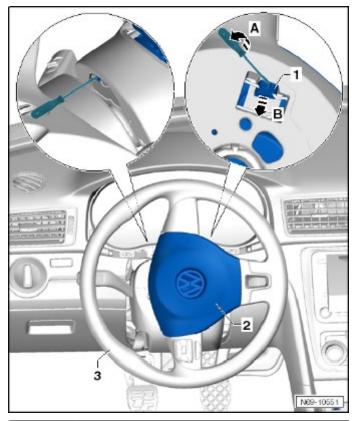

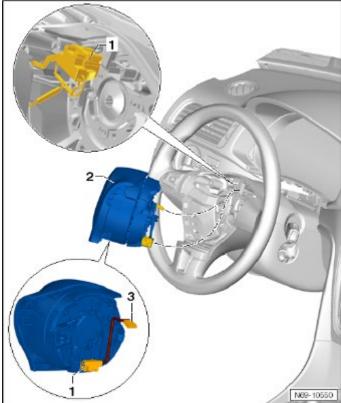

## 

Procedure illustrated is for a three spoke steering wheel. The procedure for a four spoke steering wheel is the same.

- Lower the steering wheel <3> as far as possible.
- Adjust steering wheel depth (reach) <3> so it is in the fully extended position.
- Turn the steering wheel <3> to the position illustrated.
- Insert a screwdriver all the way into the hole on the back of the steering wheel (approximately 8 mm).
- Turn the screwdriver toward the driver door <arrow A>. This will unlock the airbag unit <2> locking mechanism <1> in direction of <arrow>, on the right side of the steering wheel.
- Turn the steering wheel 180° and repeat the procedure on the opposite side.

## 

The screwdriver previously mentioned should be about 175 mm long and have a blade width of 7 mm.

#### 

Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.

- Turn the steering wheel back to its center position.
- Remove the airbag unit <2> from the steering wheel.
- Release the connector lock on the airbag connector <1> and remove it.
- Disconnect the connector <3> (if equipped).

#### 

Set the airbag down so the logo on the impact cushion faces upward.

#### Section E – Inflator Replacement

#### 

#### Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
  - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
  - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.

#### 


#### Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.



#### 


- Prior to beginning work, all parts and tools are to be placed on the ESD table mat.
- The workstation must be in the vicinity of the vehicle.

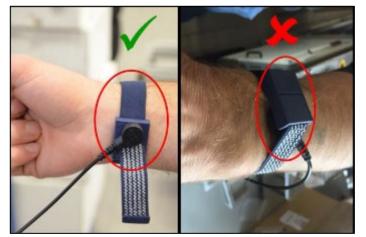

• Put the wrist strap from the ESD workplace on your wrist.

#### 


The white dots on the wrist strap must be against the skin.

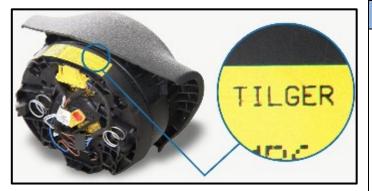

## **I**NOTE

- There are two types of inflator. One version is "with vibration absorption" and one is "without vibration absorption".
- If the version "<u>with vibration absorption</u>" is installed, this can be identified by "**TILGER**" (vibration damper) on the label of the airbag module.
- If the version "<u>without vibration absorption</u>" is installed, there is **NO** lettering on the label of the airbag module
- Identify inflator version by criteria and proceed to the proper subsection.
  - <u>Criteria N1</u>: Renewing inflator, four spoke steering wheel, without vibration absorption: **Proceed to Subsection 1.**
  - <u>Criteria T1</u>: Renewing inflator, four spoke steering wheel, with vibration absorption: **Proceed to Subsection 2.**


# Subsection 1 – Renewing inflator, four spoke steering wheel, without vibration absorption

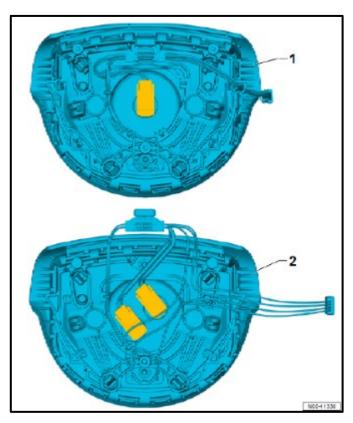


## **Removal Procedure:**

## 

The inflator comes as a single-stage <1> or two-stage <2> version. The work steps for inflator renewal are the same.

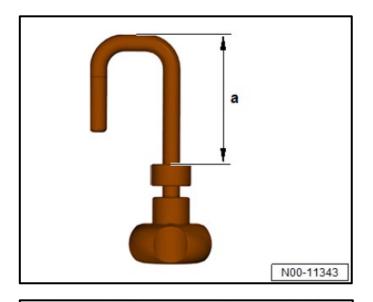

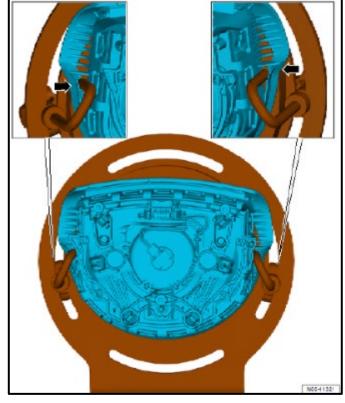


## 

- The four spoke steering wheel has two mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

 Clamp airbag centrally in airbag support. Securing points on the sides <arrows> and parallel opposite each other.

## 


The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

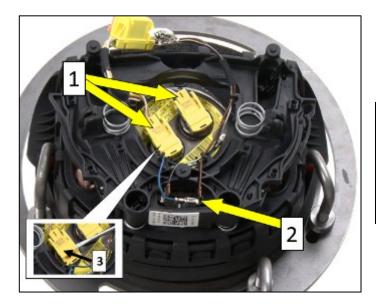

- Disengage connector locks <3> using a small flat bladed screwdriver.
- Remove connectors <1> using needle nose pliers.
- Remove ground cable <2>.


## 

- Do not use a screwdriver to pry off connectors <1> or damage to the connectors could occur.
- Damage to the airbag connectors will not be covered under this action.

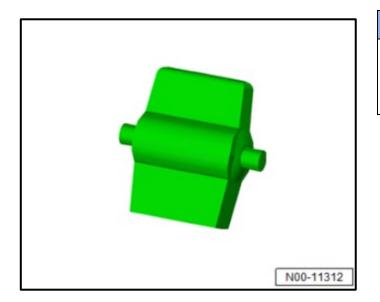


#### 

- The locking pins are to be reused.
- There may be instances in which short locking pins are fitted. These can be levered out with a small screwdriver.

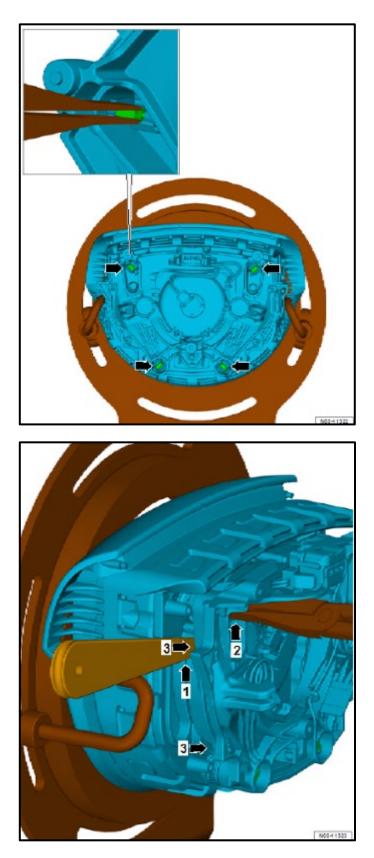

• Remove locking pins <arrows> for horn ring with aid of longnose pliers.

• Apply removal wedge -3409- between horn ring and inflator <1> and press together locking elements using longnose pliers <2>. Lever off horn ring at plastic lugs <3>.

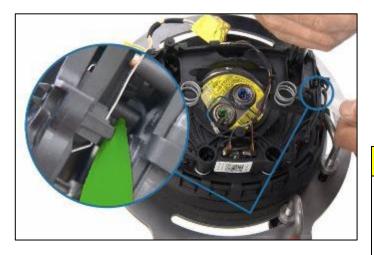

- Position the removal wedge -3409- on the plastic lugs to prevent damage to the conductor strip.
- Insert the removal wedge -3409- between the inflator and horn ring to prevent the horn ring from engaging again.
- Repeat work steps on other side.


## 

Use extreme care when removing the horn ring. If horn ring is damaged during removal, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

• Remove horn ring with springs <arrows>.

## 


- When removing the horn ring, take care that the springs are not lost as they are not available separately.
- **ONE** replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.

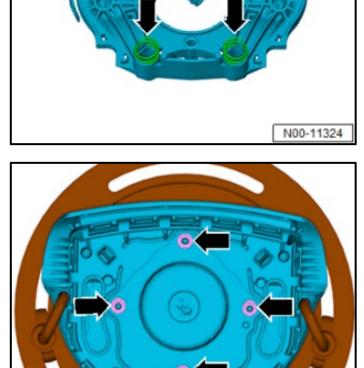


- Remove and discard nuts <arrows>.
- Remove the inflator and place in the original packaging.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2024 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

N00-11414

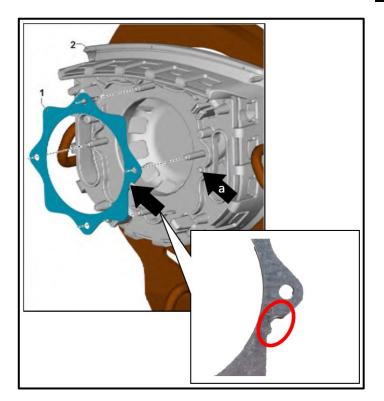

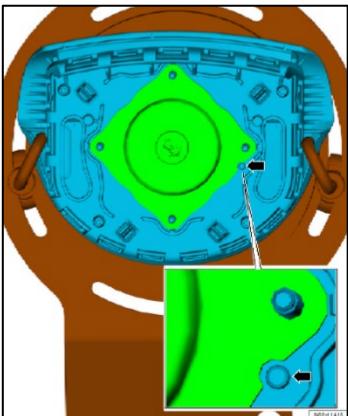

## Installation Procedure:

- Included in the replacement parts kit is a baffle plate. This must be used when installing the new inflator.
- Fit baffle plate <1> onto airbag <2> so that the notch <circle> lines up with the pin <arrow a> on the airbag.


• Insert new inflator and check to ensure it is seated correctly. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
N1	3C0 898 201 F

## 

In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption (part # 3C0898201G) MUST be installed:


- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator (part # 3C0898201G) from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator versions WITH vibration absorption (Criteria T1)" instructions.

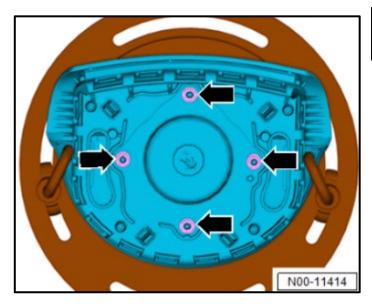

## 


The nuts are self-locking and must be replaced

Install new nuts <arrows> and torque to 5 Nm ± 0.4 Nm.

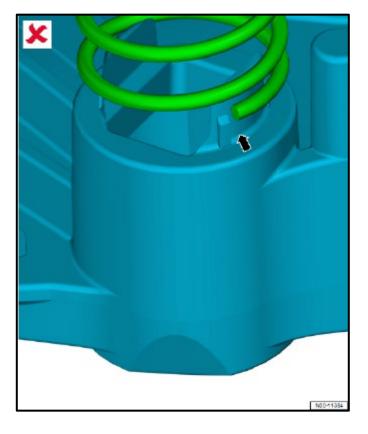

#### 

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

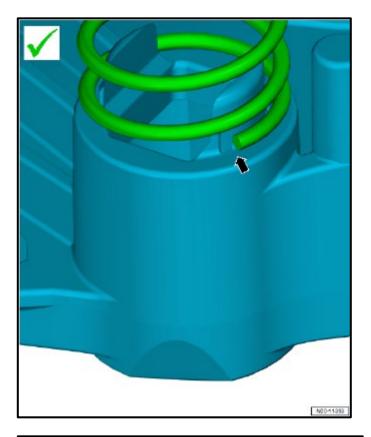

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

 ١٩٠٠


 ١٩٠٠

 ١٩٠٠

 ١٩٠٠

• Spring seated correctly <arrow>.

• Fit springs <arrows> for horn ring again if necessary.

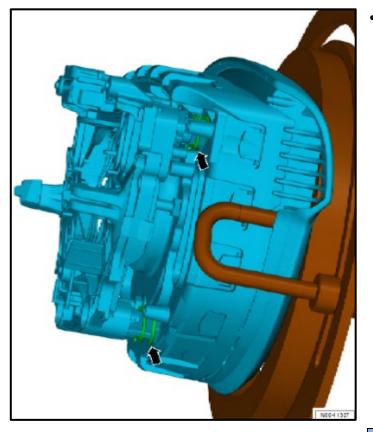


 Position horn ring with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides <arrows>.

## **I**NOTE

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.


• Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.

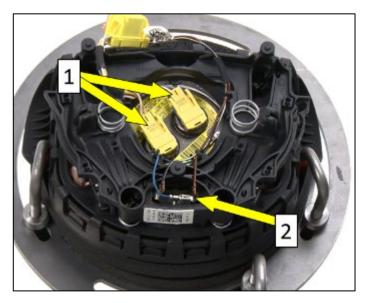

- Connect central connector(s) <1> on inflator.
- Press central connector lock(s) in until fully locked.
- Connect ground cable <2>.

Continue to Section F.


Subsection 2 – Renewing inflator, four spoke steering wheel, with vibration absorption

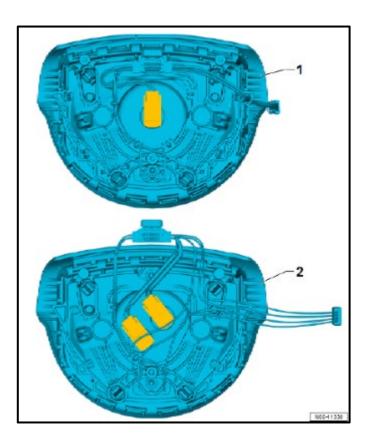


## Removal Procedure:

## 

- The inflator comes as a single-stage <1> or two-stage <2> version. The work steps for inflator renewal are the same.
- Tighten mounting by hand to prevent damage.

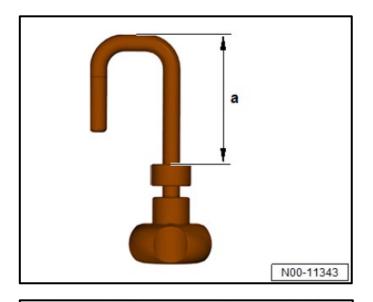

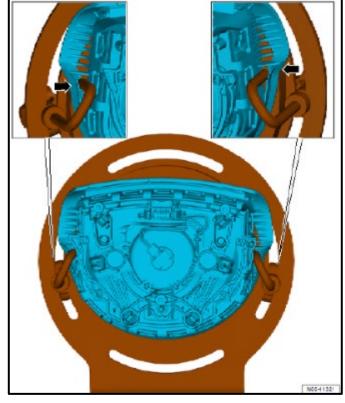


## 

- The four spoke steering wheel has two mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

 Clamp airbag centrally in airbag support. Securing points on the sides <arrows> and parallel opposite each other.

## 


The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

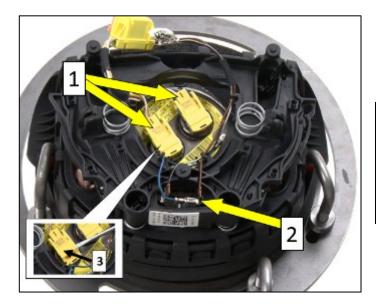

- Disengage connector locks <3> using a small flat bladed screwdriver.
- Remove connectors <1> using needle nose pliers.
- Remove ground cable <2>.


## **A** CAUTION

- Do not use a screwdriver to pry off connector <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.

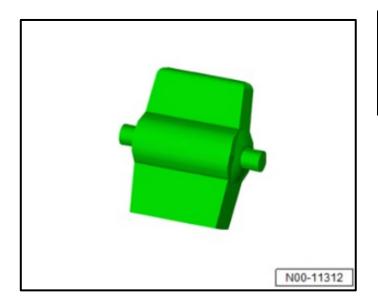


#### 

- The locking pins are to be reused.
- There may be instances in which short locking pins are fitted. These can be levered out with a small screwdriver.

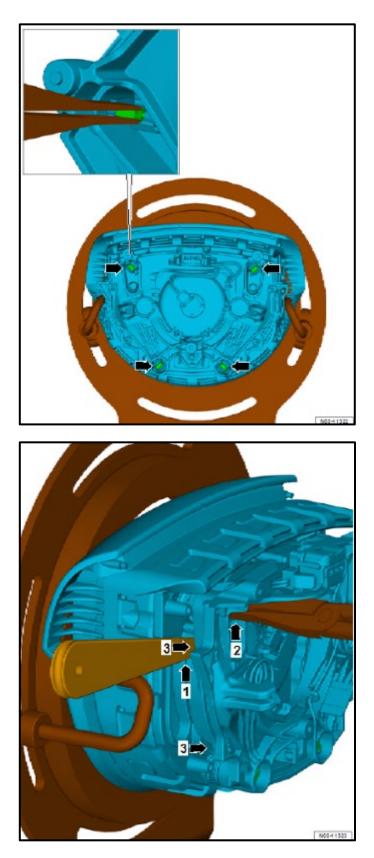

• Remove locking pins <arrows> for horn ring with aid of longnose pliers.

• Apply removal wedge -3409- between horn ring and inflator <1> and press together locking elements using longnose pliers <2>. Lever off horn ring at plastic lugs <3>.

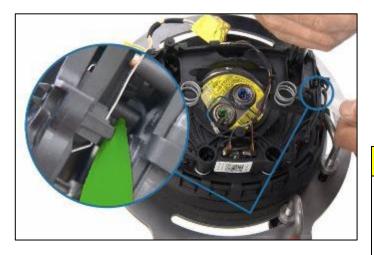

- Position the removal wedge -3409- on the plastic lugs to prevent damage to the conductor strip.
- Insert the removal wedge -3409- between the inflator and horn ring to prevent the horn ring from engaging again.
- Repeat work steps on other side.


## 

Use extreme care when removing the horn ring. If horn ring is damaged during removal, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

• Remove horn ring with springs <arrows>.

## 


- When removing the horn ring, take care that the springs are not lost as they are not available separately.
- **ONE** replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.

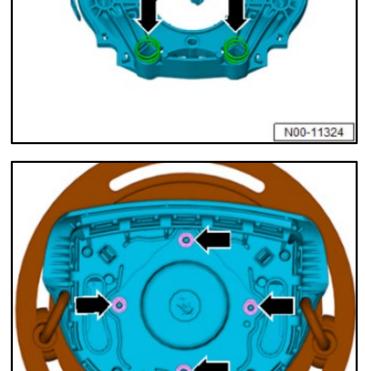


- Remove and discard nuts <arrows>.
- Remove the inflator and place in the original packaging.

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2024 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved.

N00-11414

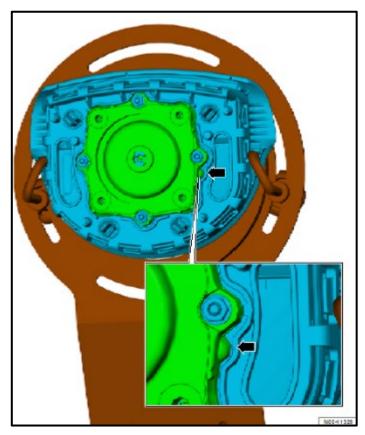

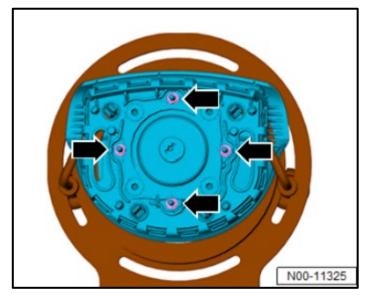

## **Installation Procedure:**


• Insert new inflator and check to ensure it is seated correctly. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
T1	3C0 898 201 G

## 

The nuts are self-locking and must be replaced.


Install new nuts <arrows> and torque to 5 Nm ± 0.4 Nm.

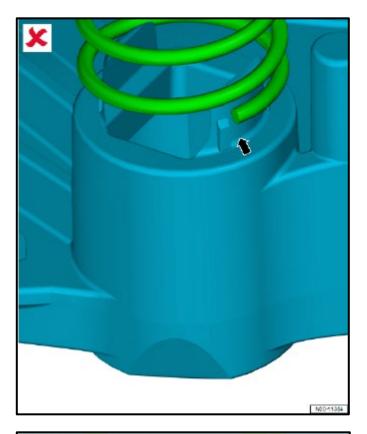



## **I**NOTE

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

• Spring seated correctly <arrow>.

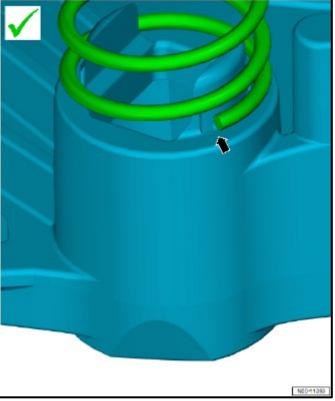


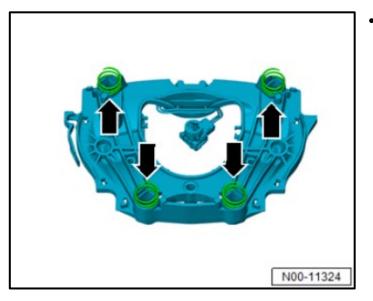

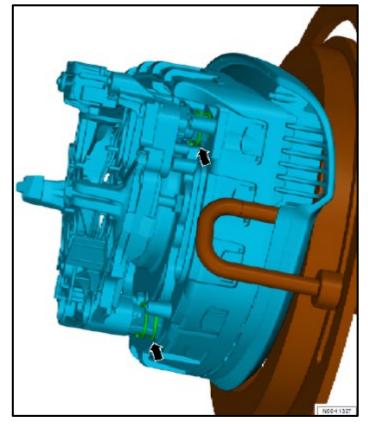

Fit springs <arrows> for horn ring again if necessary.

• Position horn ring with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides <arrows>.

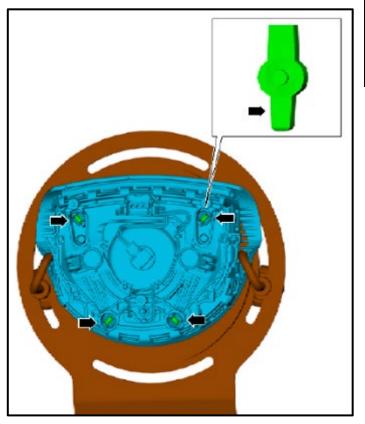

## **I**NOTE


If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

• Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.




- Press central connector lock(s) in until fully locked.
- Connect ground cable <2>.

#### Continue to Section F.

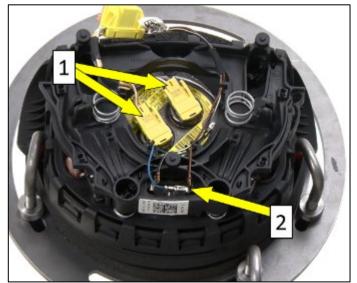

## Section F – Airbag Installation

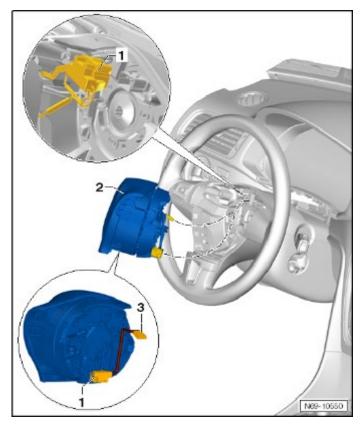

## 

- The battery must be disconnected before installing the airbag back into the vehicle.
- Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.
- Connect the connector <1>. The connector must click into place.
- Press the connector lock on the connector <1>.
- Connect the connector <3> (if equipped).
- Insert the airbag unit <2> into the steering wheel but do not press on it.

## **I**NOTE


Procedure illustrated is for a three spoke steering wheel. The procedure for a four spoke steering wheel is the same.



- Press on the edge of the airbag unit <1> with both hands until it locks into place.
- Gently pull on the airbag unit to make sure the airbag unit is secured correctly at all three attachment points in the steering wheel.

#### Continue to Section G.

## Section G – Battery Reconnect

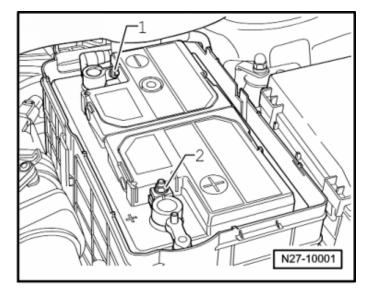



## 

The engine may not start after reconnecting battery. This condition should be resolved by following these steps:

- 1. Remove the key from the vehicle.
- 2. Open and close the driver's door.
- 3. Lock then unlock the vehicle using the remote.
- 4. Insert the key and the vehicle should now start.

## 

Ignition must be **ON** when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.

- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <1> to 6 Nm.

## 

After connecting the battery and switching on the ignition, the ASR/ESP Control Lamp -K155- and Electromechanical Power Steering Indicator Lamp light up continuously. The indicator lamps switch off automatically after driving straight ahead at 15 to 20 km/h. This activates Steering Angle Sensor -G85-.

- Close the cover <1>.
- Cycle the ignition off and back on.
- Bring driver seat to an upright position.
- Store previously recorded radio presets (if necessary).
- Set clock to local time.
- Activate the power window regulator one-touch up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.
- After completing repairs, verify the horn is operational.

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.

#### Proceed to Section H.

#### Section H – Campaign Completion Label

#### Install Campaign Completion Label

• Fill out and affix Campaign Completion Label, part number CAMP 010 000, next to the vehicle emission control information label.

## **i** TIP

Ensure Campaign Completion Label does not cover any existing label(s).

Proceed to Section I.

#### Section I – Parts Return/Disposal

#### U.S. Dealers Only:

Properly store (retain), destroy or dispose of removed parts in accordance with all state and local requirements, unless otherwise indicated and/or requested through the Warranty Parts Portal (WPP).

#### Canada Dealers Only:

Please Refer to Takata Part Return Process on Separate Tabs in ELSA and Service References in Elsa2Go.

## Appendix A – Warning and Safety Precautions

## 

#### General Safety Precautions when Working with Pyrotechnic Components:

- Pyrotechnic components always contain propellant that generates a gas during combustion. In some components, there is also a supply of pressurized gas to ensure this gas is generated
- This pressurized gas is stored under high pressure in a compressed gas container. Pyrotechnic components are triggered by electrical/mechanical igniters.
- Only trained personnel should perform testing, assembly and servicing work. Airbags do not have a replacement interval.
- Never check with test lamps, voltmeter or ohmmeters.
- Only check pyrotechnic components when they are installed in the vehicle using vehicle diagnosis, testing and information systems approved by the manufacturer.
- When working on pyrotechnic components and the airbag control module, disconnect the battery ground strap while the ignition is switched on. Then cover the negative terminal.
- Wait 10 seconds after disconnecting the battery.
- The ignition must be SWITCHED ON when connecting the battery. There should not be anyone inside the vehicle when doing this.
- Exception: vehicles with batteries in the passenger compartment. In this case, stay outside the range of the airbags and seat belts.
- Wash your hands after touching ignited pyrotechnic components from the restraint system.
- Do not open or repair pyrotechnic components. Use only new components to reduce the risk of injury.
- Do not install pyrotechnic components that have fallen onto a hard surface or show signs of damage.
- Discharge static electricity before handling pyrotechnic components, for example before disconnecting the electrical connector. This can be done by touching grounded metal objects such as the door striker pin.
- Install pyrotechnic components immediately after removing them from their transport packaging. If you must stop working, store the pyrotechnic component in its original transport packaging.
- Do not leave pyrotechnic components lying in the open unattended.
- Do not treat pyrotechnic components with grease, cleaning solutions or similar products.
- Do not expose pyrotechnic components to temperatures above 100 °C, even for brief periods of time.
- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
  - $\circ\,$  Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before handling.
  - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.

#### Appendix B – Rental Car/Loaner FAQ

#### TAKATA AIRBAG CLASS ACTION SETTLEMENT DEALERSHIP FAQS

#### Q: What is an eligible class member entitled to under the Enhanced Rental Car/Loaner Program?

A: Under the Enhanced Rental Car/Loaner Program, VWGoA or Audi of America will provide a rental or loaner vehicle to every owner or lessee who (i) brings one of the covered recalled vehicles to a Volkswagen or Audi dealer for completion of the remedy of the recall and (ii) requests a rental/loaner vehicle while awaiting the remedy for the recall, while the remedy for the recall is in progress, or if there is a delay in performing the remedy for the recall on the affected vehicle.

# Q: Is there any information a customer must provide to participate in the Enhanced Rental Car/Loaner Program?

A: The customer must provide adequate proof of insurance. If a rental car (as opposed to a loaner car) is provided, the customer must meet the applicable rental car company's guidelines, including age restrictions.

# Q: How long will a rental or loaner car be provided to an eligible class member under the Enhanced Rental Car/Loaner Program?

A: The rental/loaner car will be available until the remedy for the recall is performed on the affected vehicle, at which time the rental/loaner vehicle must be promptly returned to the provider of the rental/loaner vehicle in the same condition (excepting ordinary wear and tear) as received. Absent extenuating circumstances, the rental/loaner vehicle must be returned when the recall is completed. And in no event will VWGoA or Audi of America pay for a rental car or provide a loaner for more than 7 days after the remedy for the recall is completed on a vehicle.

# Q: How early can an eligible class member expect to be provided a rental/loaner car under the Enhanced Rental Car/Loaner Program?

A: The Enhanced Rental Car/Loaner Program will take effect no later than 30 calendar days following November 10, 2021, the date of the Court's issuance of an order preliminarily approving the Settlement.