Safety Recall **Code: 69Q9**





Subject	TAKATA SDI Driver Frontal Airbag Inflator		
Release Date	December 10, 2021		
Revision Summary	USA ONLY		
	Added Rental Car/Loaner program claiming instructions		
	Added Appendix for Rental Car/Loaner program FAQs		
Affected Vehicles	U.S.A. & CANADA: Certain 2007-2014 MY Volkswagen vehicles equipped with a Takata SDI driver frontal airbag		
	Check Campaigns/Actions screen in Elsa on the day of repair to verify that a VIN qualifies for repair under this action. Elsa is the <u>only</u> valid campaign inquiry & verification source.		
	✓ Campaign status must show "open."		
	 If Elsa shows other open action(s), inform your customer so that the work can also be completed at the same time the vehicle is in the workshop for this campaign. 		
Problem Description	The driver airbag may explode in a crash with airbag deployment. Sharp metal fragments can hit people and cause serious injury or death.		
Corrective Action	Replace the driver frontal airbag inflator with a newly manufactured version. This repair is the <u>final</u> remedy.		
Parts Information	Parts will be allocated weekly. Please email <u>VWoAPartsSpecialists@vw.com</u> with Vin if you do not have the proper part(s) in stock.		
Criteria T2 Code Visibility	On June 29, 2018, criteria T2 vehicles were listed on the Inventory Vehicle Open Campaign Action report under My Dealership Reports (found on <u>www.vwhub.com</u> & OMD Web). A list was not posted for dealers who did not have any affected vehicles.		
	On June 29, 2018, this campaign code showed open on criteria T2 vehicles in Elsa.		
Criteria T2 Owner Notification	Owner notification took place in July 2018. Owner letter examples are included in this bulletin for your reference.		
Criteria T3 Code Visibility	On August 31, 2018, criteria T3 vehicles will be listed on the Inventory Vehicle Open Campaign Action report under My Dealership Reports (found on <u>www.vwhub.com</u> & OMD Web). A list will not be posted for dealers who do not have any affected vehicles.		
	On August 31, 2018, this campaign code will show open on criteria T3 vehicles in Elsa.		
Criteria T3 Owner Notification	Owner notification will take place in September 2018. Owner letter examples are included in this bulletin for your reference.		
Additional Information	Please alert everyone in your dealership about this action, including Sales, Service, Parts and Accounting personnel. Contact Warranty if you have any questions.		
	IMPORTANT REMINDER ON VEHICLES AFFECTED BY SAFETY & COMPLIANCE RECALLS		
	<u>New Vehicles in Dealer Inventory:</u> It is a violation of Federal law for a dealer to deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by this notification under a sale or lease until the defect or noncompliance is remedied. By law, dealers must correct, prior to delivery for sale or lease, any vehicle that fails to comply		

with an applicable Federal Motor Vehicle Safety Standard or that contains a defect relating to motor vehicle safety.

<u>Pre-Owned Vehicles in Dealer Inventory:</u> Dealers should not deliver any pre-owned vehicles in their inventory which are involved in a safety or compliance recall until the defect has been remedied.

Dealers must ensure that every affected inventory vehicle has this campaign completed <u>before</u> <u>delivery to consumers</u>.

Fill out and affix Campaign Completion Label (CAMP 010 000) after work is complete.

Labels can be ordered at no cost via the Compliance Label Ordering portal at www.vwhub.com.

Claim Entry Instructions

After campaign has been completed, enter claim as soon as possible to help prevent work from being duplicated elsewhere. Attach the Elsa screen print showing action open on the day of repair to the repair order.

If customer refused campaign work:

- U.S. dealers: Submit request via WISE under the Campaigns/Update/Recall Closure option. √
- Canada dealers: Fax repair order to Warranty at (905) 428-4811. √

Service Number	69Q9				
Damage Code	0099	0099			
Parts Vendor Code	WWO				
Claim Type	Sold vehicle: 7	[′] 10			
	Unsold vehicle	: 7 90			
Causal Indicator	Mark airbag in	flator kit* as causal p	art		
Vehicle Wash/Loaner	USA: Do not c coverage clain		actio	on. For rental/loaner claiming, see special	
	Canada: Do no	ot claim wash/loaner	unde	er this action	
Criteria I.D.	T1 <u>2007-2010 Pa</u>	T1 2007-2010 Passat Sedan and Passat Wagon with a four spoke steering wheel			
		Install new airbag inflator kit. Labor operation: 6958 56 99 105 T.U.			
	Quantity	Part Number	De	scription	
	1.00	3C0898201J*	Air	bag Inflator Kit With Vibration Damper	
		1	•		
Criteria I.D.	T2	T2			
	2009-2014 CC	2009-2014 CC, GTI, Golf, Eos, Golf R			
	<u>2007-2010 Pa</u>	2007-2010 Passat Sedan and Passat Wagon with a three spoke steering wheel			
	Install new airl	Install new airbag inflator kit.			
	Labor operation	Labor operation: 6958 56 99 105 T.U.			
	Quantity	Part Number		scription	
	1.00	3C8898201C*	Air	bag Inflator Kit With Vibration Damper	
Criteria I.D.	Т3				
	<u>2012-2014 Pa</u>	<u>ssat</u>			
	Install new driv	/er airbag			
	Labor operation	on: 6958 55 99		65 T.U.	
	Quantity	Part Number		Description	
	1.00	561880201AA81U	J*	Driver Airbag	

Continue to next page

Criteria I.D.	N1 <u>2007-2010 Pa</u> s	N1 2007-2010 Passat Sedan and Passat Wagon				
	Install new airb Labor operatio	-	105 T.U.			
	Quantity	Part Number	Description			
	1.00	3C0898201H*	Airbag Inflator Kit Without Vibration Damper			
		1	· · · · · · · · · · · · · · · · · · ·			
Criteria I.D.	N2	N2				
	2009-2014 CC	2009-2014 CC, GTI, Golf, Eos, Golf R				
	Install new airt	Install new airbag inflator kit.				
	Labor operatio	Labor operation: 6958 56 99 105 T.U.				
	Quantity	Part Number	Description			
	1.00	3C8898201B*	Airbag Inflator Kit Without Vibration Damper			

Continue to next page

USA ONLY – Special Coverage Claiming

Rental Car/Loaner Claiming			
Criteria I.D.	All criteria		
	- MUST BE CLAIMED ON A SEPARATE LINE –		
	- DO NOT PUT ON CAMPAIGN CLAIM -		
	Claim Type: 1SP		
	Service Number: X176		
	Damage Code: 0055		
	Vendor Code: 444		
	Loaner or Rental		
	Labor Operation: X176US00		
Criteria I.D.	SP (Towing ONLY)		
Criteria I.D.	SP (Towing ONLY) <u>Certain 2007-2008 Passat</u>		
Criteria I.D.	Certain 2007-2008 Passat		
Criteria I.D.	Certain 2007-2008 Passat		
Criteria I.D.	<u>Certain 2007-2008 Passat</u> - MUST BE CLAIMED ON A SEPARATE LINE – - DO NOT PUT ON CAMPAIGN CLAIM -		
Criteria I.D.	Certain 2007-2008 Passat		
Criteria I.D.	<u>Certain 2007-2008 Passat</u> - MUST BE CLAIMED ON A SEPARATE LINE – - DO NOT PUT ON CAMPAIGN CLAIM - Claim Type: 1SP		
Criteria I.D.	<u>Certain 2007-2008 Passat</u> - MUST BE CLAIMED ON A SEPARATE LINE – - DO NOT PUT ON CAMPAIGN CLAIM - Claim Type: 1SP Service Number: 6958		
Criteria I.D.	<u>Certain 2007-2008 Passat</u> - MUST BE CLAIMED ON A SEPARATE LINE – - DO NOT PUT ON CAMPAIGN CLAIM - Claim Type: 1SP Service Number: 6958 Damage Code: 0055		
Criteria I.D.	<u>Certain 2007-2008 Passat</u> - MUST BE CLAIMED ON A SEPARATE LINE – - DO NOT PUT ON CAMPAIGN CLAIM - Claim Type: 1SP Service Number: 6958 Damage Code: 0055		
Criteria I.D.	Certain 2007-2008 Passat - MUST BE CLAIMED ON A SEPARATE LINE – - DO NOT PUT ON CAMPAIGN CLAIM - Claim Type: 1SP Service Number: 6958 Damage Code: 0055 Vendor Code: 444		

Customer Letter Example (USA)

This notice applies to your vehicle: <VIN>

NHTSA: 18V148

Subject: Safety Recall 69Q9 – Takata SDI Driver Frontal Airbag Inflator Certain 2007-2014 Model Year Volkswagen Vehicles equipped with a Takata SDI Driver Frontal Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the National Traffic and Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2007-2014 model year Volkswagen vehicles equipped with a Takata SDI driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

DANGER!					
The	The driver airbag may explode in a crash with airbag deployment.				
Sharp m	etal fragments can hit people and cause serious injury or death.				
What should you do?	Schedule this recall repair immediately, even if an interim repair was recently done.				
	Please contact your authorized Volkswagen dealer without delay to schedule this recall repair. For your convenience, you can also visit <u>www.vw.com/find-a-dealer</u> to locate a dealer near you and schedule this service online.				
What will we do?	To correct this defect, your authorized Volkswagen dealer will replace the driver airbag inflator in your vehicle. This work will take about two hours to complete and will be performed for you free of charge.				
	Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule.				
Lease vehicles and address changes	If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.				
Can we assist you further?	If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, or if you should have any questions about this communication, please don't hesitate to contact Customer CARE, Monday through Friday by phone at 800-893-5298. You are also welcome to e-mail or chat through the "Contact Us" page http://www.vw.com/contact/ .				
Checking your vehicle for open Recalls and Service Campaigns	To check your vehicle's eligibility for repair under this or any other recall/service campaign, please click on the <i>Look Up Recalls</i> link at <u>www.vw.com</u> and enter your Vehicle Identification Number (VIN) into the <i>Recall/Service Campaign Lookup</i> tool.				

If you still cannot obtain satisfaction, you may file a complaint with: The Administrator, National Highway Traffic Safety Administration, 1200 New Jersey Avenue, SE., Washington, DC 20590; or call the toll-free Vehicle Safety Hotline at 1-888-327-4236 (TTY: 1-800-424-9153); or go to http://www.safercar.gov.

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

Customer Letter Example (CANADA)

This notice applies to your vehicle: <VIN>

Subject: Safety Recall 69Q9 – Takata SDI Driver Frontal Airbag Inflator Certain 2007-2014 Model Year Volkswagen Vehicles equipped with a Takata SDI Driver Frontal Airbag

Dear Volkswagen Owner,

This notice is sent to you in accordance with the requirements of the Motor Vehicle Safety Act. Volkswagen has decided that a defect, which relates to motor vehicle safety, exists in certain 2007-2014 model year Volkswagen vehicles equipped with a Takata SDI driver frontal airbag. Our records show that you are the owner of a vehicle affected by this action.

DANGER!					
The	The driver airbag may explode in a crash with airbag deployment.				
Sharp m	netal fragments can hit people and cause serious injury or death.				
What should you do?	Schedule this recall repair immediately, even if an interim repair was recently done.				
	Please contact your authorized Volkswagen dealer without delay to schedule this recall repair.				
What will we do?	To correct this defect, your authorized Volkswagen dealer will replace the driver airbag inflator in your vehicle. This work will take about two hours to complete and will be performed for you free of charge.				
	Please keep in mind that your dealer may need additional time for the preparation of the repair, as well as to accommodate their daily workshop schedule.				
Lease vehicles and address changes	If you are the lessor and registered owner of the vehicle identified in this action, the law requires you to forward this letter immediately via first-class mail to the lessee within ten (10) days of receipt. If you have changed your address or sold the vehicle, please fill out the enclosed prepaid Owner Reply card and mail it to us so we can update our records.				
Can we assist you further?	If your authorized Volkswagen dealer fails or is unable to complete this work free of charge within a reasonable time, please contact Customer Relations, Monday through Friday from 8AM to 8PM EST by phone at 1-800-822-8987 or via our "Contact Us" page at <u>www.vw.ca</u> .				

We apologize for any inconvenience this matter may cause; however we are taking this action to help ensure your safety and continued satisfaction with your vehicle.

Sincerely,

Volkswagen Customer Protection

Campaign Work Procedure

A DANGER

- The driver frontal airbag inflator could potentially rupture (due to propellant degradation occurring after longterm exposure to absolute high humidity and temperature cycling). In the event of an inflator rupture, in very rare cases metal fragments could pass through the airbag cushion material, which may result in serious injury or death.
- This Recall should be performed before any other work is performed on the vehicle.

Risk of injury. Refer to "Warning and Safety Precautions", found in Appendix A at the end of this document.

- Damages resulting from improper repair or failure to follow these work instructions are the dealer's responsibility and are not eligible for reimbursement under this action.
- This procedure must be read in its entirety prior to performing the repair.
- Due to variations in vehicle equipment and options, the steps/illustrations in this work procedure may not identically match all affected vehicles.
- Diagnosis and repair of pre-existing conditions in the vehicle are not covered under this action.

Required Parts

<u>Criteria</u>	Qty.	<u>Model (model code)</u>	Part Number	Part Description
N1	1	Passat (3C) Passat Wagon (3C)	3C0898201H	Airbag Inflator Kit Without Vibration Damper
T1	1		3C0898201J	Airbag Inflator Kit With Vibration Damper
Vehicles with Criteria N1 or T1 will have a four spoke steering wheel.				

N2	1	Eos (1F) CC (35) Golf/GTI (1K, 5K)	3C8898201B	Airbag Inflator Kit Without Vibration Damper		
T2	1	Rabbit (1K) Passat (3C)	3C8898201C	Airbag Inflator Kit With Vibration Damper		
	Vehicles with Criteria N2 or T2 will have a three spoke steering wheel.					
	T	Γ	Γ	1		

T3 1	Passat (A3)	561880201AA 81U	Driver Airbag
------	-------------	--------------------	---------------

(\mathbf{D}) NOTE

All inflator kits include inflator, inflator nuts, horn ring bolts, one replacement horn ring spring and return instructions.


Required Safety Equipment



• Ear Protection (locally sourced)

• Face Shield (locally sourced)

Required Tools

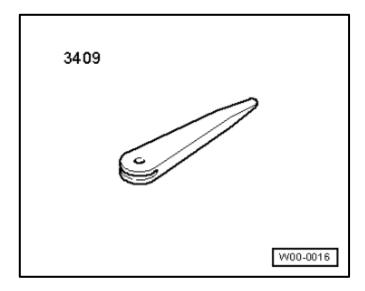



• Trim Removal Wedge - 3409 (or equivalent)

• ESD Worksurface - VAS 6613







Bar Code Scanner - VAS6161/1

Airbag Support - T10568 •

Lever - T10571



VAS6150D - Diagnostic Tester (or equivalent)



VAG1410 – Torque Wrench (or equivalent)

Required Work Environment

Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.

NOTE

The work area must be in the vicinity of the scan tool and the vehicle in order to properly complete this procedure.



- Workbench that will support a vice.
- Work surface free of unnecessary tools, equipment and debris.

Repair Instruction

Section A - Check for Previous Repair

i TIP

If Campaign Completion label is present, no further work is required.



• Enter the VIN in Elsa and proceed to the "Campaign/Action" screen.

On the date of repair, print this screen and keep a copy with the repair order.

- Confirm the Campaign/Action is open <arrow 1>. If the status is closed, no further work is required.
- Note the Applicable Criteria ID <arrow 2> for use in determining the correct work to be done and corresponding parts associated.

Proceed to Section B

Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before 0 handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at 0 least 10 minutes before handling.




Prior to beginning repairs, verify the horn is operational.

INOTE

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.



https://vwcup.track360.com/?p=vwiqCertification&id=11288

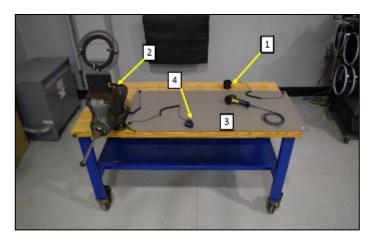

•

repair.

Prior to beginning work, all parts and tools are to be placed on the ESD table mat.

Use the QR code or the link to view a video


detailing the repair process prior to performing the

- The workstation must be in the vicinity of the vehicle.
- Assemble ESD workplace -VAS 6613- <1, 2, 3, • and 4>.
- Plug ESD workplace into a wall socket using plug • <1>.

NOTE

The wall socket or extension cord must have a sufficient ground.

- Clamp Airbag Support T10568 <2> into the vice. •
- Connect crocodile clip <1> to airbag support <2> • and ESD workplace -VAS 6613-.

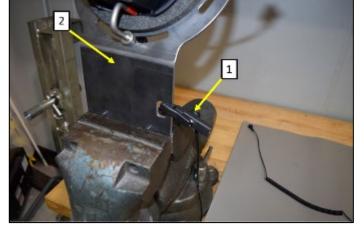

The repair information in this document is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain your vehicle. These procedures are not intended to be attempted by "do-it-yourselfers," and you should not assume this document applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Volkswagen dealer. ©2021 Volkswagen Group of America, Inc. and Volkswagen Canada. All Rights Reserved. December 2021



- Ensure ODIS is updated to the latest version. •
- Connect vehicle diagnostic tester to the diagnostic • head using the USB cable.
- Select Start Diagnosis function and identify • vehicle.
- After identification of control units, Guided Fault • Finding is started automatically.
- Follow the instructions on screen. •

aler: t	03999	Engine:	CCTA 2.0 L Motronic/147kW	0	
trol modules	Orders DISS TSB Test plan	Operation Special Functions			080
sts for the enti	ire vehicle				- Frank
Status T	ests				Measurement
-	Showroom mode				
s	pecial actions				e Info
- 1	Adapt Mechatronics soft	ware			Admin 😧
-	Adapt SW for pwr. suppl	y sys. ctrl. mod. (BCM)		E.	Log
-	Adapt airbag software				Data
	Adapt software steering	wheel electronics		1	
-	Adapt software, diesel, e	xhaust EA189 action 23Q3			Extras
-	Production status docum	entation part number on the replacement	t airbag module/gas generator 🛛 🚽 👘		Help
-	Reset the assembly sate	test/DTC memory			🕑 Online Help
s	oftware version management				🍪 Support
10				1 · 1	
nform test	Display documents				e is ready to use


• In operating mode <u>Special Functions</u>, Select "**Production status documentation part number on the replacement airbag module/gas generator**" arrow.

mporter: Dealer: RO:	mation System Service - \$1.3 444 03999 	VIN: Engine:	CCTA 2.0 L Motronic	147kW	<u></u>		Porear
onvolmodaies i Oid	DISS TSB	Operation Sciencial Functions				Operating modes	* *
Airbag ABD					Complete/Continue	😨 Glagnosis	
NOTE:						()) con	
	s you with the back documer	tation of the part number of the new	gas generator/airbag module for the	*		C That	
airbag system.						A Measurement	
	nned value with the value	above the bar code on				😫 Info	
the gas generator	r or between the asterisks here be a discrepancy in t	("") on the airbag				(@ Atom	
- configure the sc	e manually in the input fiel anner after the completion code from the description	n of the program with				Log	*
						Long	*
						Current View	1
						Diagnostic Session	
						Le Stop	
				-		The new	1 +
1.0	(and and)	< > >					

- Scanning the data matrix code during this test plan step calibrates the scanner to avoid error messages.
- Scanning the calibrating data matrix code may not have to be done every time (only when the scanner requires calibration). You will know if the scanner needs calibrating if the scanner does not scan the inflator's data matrix code.
- If the inflator data matrix code cannot be scanned, then print out this matrix shown below and scan the • printout.



After calibrating the scanner, select "Complete/Continue"

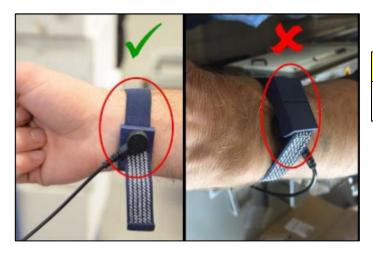

Put the wrist strap from the ESD workplace on your wrist.


The white dots on the wrist strap must be against the skin.

(\mathbf{D}) NOTE

- There are two types of inflator. One version is • "with vibration absorption" and one is "without vibration absorption".
- Airbags with vibration absorption may be identified by the word "TILGER" on the label found on the airbag.

In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator versions WITH vibration absorption" instructions.

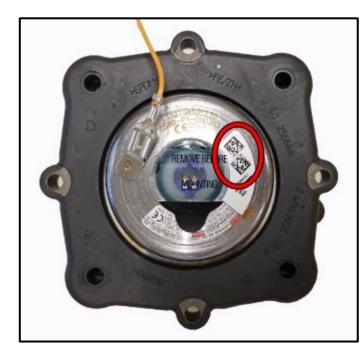

Vehicles with Criteria T1, T2, N1 or N2:

- Place the new inflator on the ESD mat. •
- Scan the data matrix code of the new inflator at a distance of about 15 cm.

ACAUTION

Ensure the correct inflator data matrix code is scanned at this time.

<u>Crit.</u>	Model (model code)	<u>Part Number</u>
N1	Passat (3C)	3C0898201H
T1	Passat Wagon (3C)	3C0898201J
N2	Eos (1F) CC (35) Golf/GTI (1K, 5K) Rabbit (1K) Passat (3C)	3C8898201B
T2		3C8898201C

INOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.



The data matrix code includes the values as shown.



Vehicles with Critiera T3:

- Place the new airbag on the ESD mat. .
- Scan the data matrix code <circle> of the new • airbag at a distance of about 15 cm.



I NOTE


Scanning the bar code on the new airbag will result in an "implausible barcode" message.

Continued for all vehicles:

mporter:	444	VIN:		1		
ealer:	03999	Engine:	CCTA 2.0 L Motronic/147	кw		nomence 2 A susten
10:						
	Olders DISS TSB Textpan	Operation Special Functions				Operating modes *
Airbag ABD				RXL		2 Diagnosis
Input					Accept	(III OIID
Scan the barcod	le			*		< Past
()						A Measurement
Note that no n active.	umeric values are displayed w	hile Caps Lock is				info
acuve.						@ Annie
						Log ¥
						Data *
						Current View
						Diagnostic Session
						(B Stor
				-		C. Next
	K	< > >	Help Cancel test			> 🖾 🛛
e e	o 🐺 😭 😣		COLUMN TWO IS NOT		- 5 8 8	10 11 8 -44 (C 250 PM
Once t	ha now inflator or a	rhad haa haan ayaaa	ssfully scanned, press "	Accept!	,	
2		-	· · · · · , · · · · · · · · · · · · · · · · · · ·			
D NOTE	E (Vehicles with Cr	iteria T3)				
● A	After scanning the o	lata matrix code. the	airbag control module	will be	recoded and	reparameterize
	utomatically.	·····, ····	g			
Vith the o	current ODIS Servi	ce version: Applicat	tion V4.4.10 – Diagnos	tic Cont	tent 2.36.3:	
			_			an anotic a model
			r the test plan complete ess will only take a cou			
fa	aults generated dur	ing the parameterizat	ion test plan, ODIS ma			
C	GFF or sending the	diagnostic protocol.				
• 5	Some of the ODIS of	perations (i.e. exiting	GFF or sending the di	agnostic	protocol) ma	iy also appear t
"	stall" even if faults a	re cleared. Be patient	t while the operation(s)	complete	es.	
• (Once the Productic	n status documenta	ation part number on	the repl	acement airl	baq module/qa
g	jenerator test plan	completes with a gree	en check mark, there wo			
iı	n the event ODIS w	ere to lock up.				
• (DDIS versions after	the above mentioned	version should not expe	erience t	hese issues.	
			•			
	(All vehicles)					
	ompore the second	d volue with the volue	about poor the data	otriv oc	lo on the new	inflator
			shown near the data m			
• If	there is a discrepar	cy, manually enter the	e value from the new int	flator in t	he input field	

If no value appears, recalibrate the scanner. ٠

Co Officiand Diagnostic Inf	formation System Service - 31.3		ALC: NOT THE OWNER OF THE OWNER OWNER OF THE OWNER OWNER OF THE OWNER OWNE OWNER OWNE	and the second second	00	× *
Importer:	444	VIN:				
Dealer:	03999	Engine:	CCTA 2.0 L Motronic/147kW	at us		-
RO:						1
Currino(modules: O	DISS TSB Test class	Operation Science Functions			Operating modes	<u>_</u>
Airbag ABD				-1-	Diagnosis	
Driver/front passer	nger side			-2-	3000	
On which side was	the gas generator replaced?		· ·	.3.	C Tush	
1. Driver side 2. Front passenger	r el de				A Measurement	
3. Back 4. Cancel	side			. 4 .	😭 Info	
4. Galiber					(Anno	È.
					Log ¥	
					Data A	
					Current View	
					Print	
					Diagnostic Session	
					CE state	
L					B. trees	*
	K	< > >	Help Cancel test		>	Э
a e 🔽	👡 (m) (***) (*)				2507	M
• Sele	ect option 1 indica	ating that the Driver sid	de inflator was replaced.			
	(Vehicles with C	riteria T3)				
This step w	ill not be populate	d for vehicles requirin	ng an airbag assembly.			
	er selecting option ntification.	n 1, a valid GeKo ID) will need to be entered in a	order to upload	d the new infl	ator
Continue to	Section C					

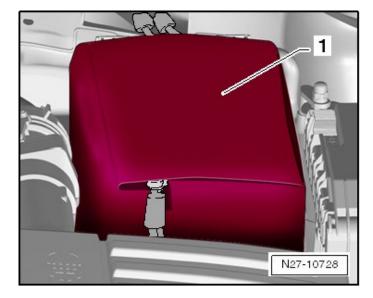

Battery in Engine Compartment:

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched ON.

INOTE

Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.


- Turn **ON** the ignition.
- Move the driver seat to the most rearward position.
- Fully recline driver seat.


ACAUTION

Reclining the driver seat before disconnecting the battery allows for additional safety in the event Terminal 15 power is not restored when reconnecting the battery at the end of the repair.

- Open the battery protective covering <1>.
- Loosen the nut <1>.
- Remove and isolate the battery ground cable terminal from the battery terminal.

Continue to Section D

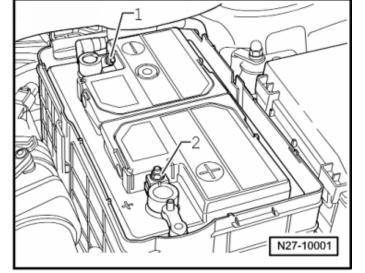

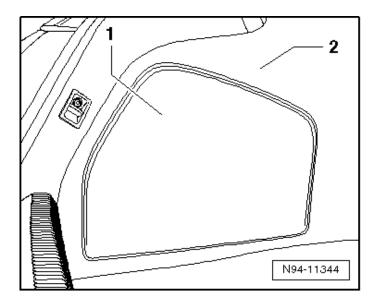

Battery in Luggage Compartment:

Accident risk. When working on pyrotechnic components (such as airbags and belt tensioners), the battery must be disconnected with the ignition switched **ON**.

INOTE

Before disconnecting the battery, it is recommended to record the customer's radio presets so they can be restored before returning vehicle to the customer.

 
- Turn **ON** the ignition.
- Move the driver seat to the most rearward position. •
- Fully recline driver seat. •


Reclining the driver seat before disconnecting the battery allows for additional safety in the event Terminal 15 power is not restored when reconnecting the battery at the end of the repair.

Unclip the service cover <1> off the side trim panel <2>.


The battery is installed in the left side of the luggage compartment in vehicles with the 3.6L V6 gasoline engine.


- Loosen the nut <1>.
- Remove and isolate the battery ground cable • terminal from the battery terminal.



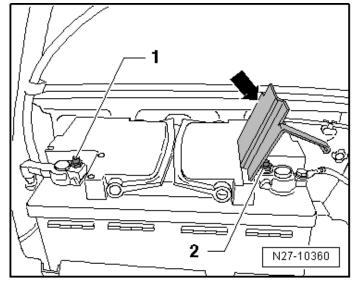

Section D – Airbag Removal

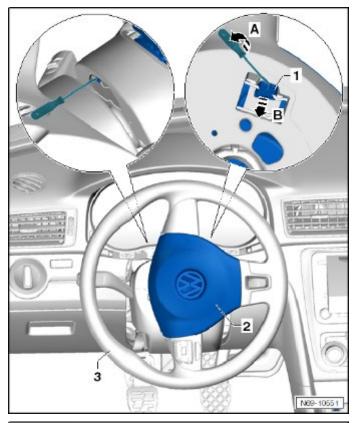

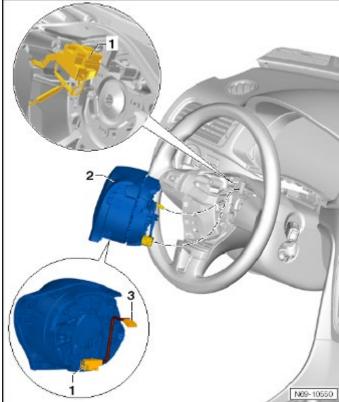

Procedure illustrated is for a three spoke steering wheel. The procedure for a four spoke steering wheel is the same.

- Lower the steering wheel <3> as far as possible.
- Adjust steering wheel depth (reach) <3> so it is in the fully extended position.
- Turn the steering wheel <3> to the position illustrated.
- Insert a screwdriver all the way into the hole on the back of the steering wheel (approximately 8 mm).
- Turn the screwdriver toward the driver door <arrow A>. This will unlock the airbag unit <2> locking mechanism <1> in direction of <arrow>, on the right side of the steering wheel.
- Turn the steering wheel 180° and repeat the procedure on the opposite side.

INOTE

The screwdriver previously mentioned should be about 175 mm long and have a blade width of 7 mm.

Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.

- Turn the steering wheel back to its center position.
- Remove the airbag unit <2> from the steering wheel.
- Release the connector lock on the airbag connector <1> and remove it.
- Disconnect the connector <3> (if equipped).

Set the airbag down so the logo on the impact cushion faces upward.

Vehicles with Criteria T1, T2, N1 or N2: Continue to Section E.

Vehicles with Criteria T3: Continue to Section F.

Section E – Inflator Replacement

Risk of injury.

- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before 0 handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at 0 least 10 minutes before handling.

WARNING


Risk of injury.

It is critical that a clean, uncongested work environment is utilized during the inflator replacement procedure. Extra tools, debris, etc... in the blast area of an airbag impose a danger in the event an airbag were to deploy. Ensure there are no loose components in the blast area of the airbag.




\bigcirc NOTE

- Prior to beginning work, all parts and tools are to be placed on the ESD table mat.
- The workstation must be in the vicinity of the vehicle.

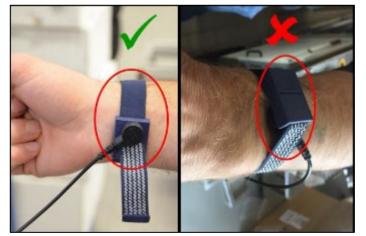

Put the wrist strap from the ESD workplace on your wrist.


The white dots on the wrist strap must be against the skin.

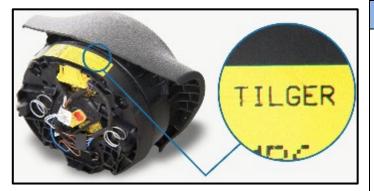


NOTE

- There are two types of inflator. One version is • "with vibration absorption" and one is "without vibration absorption".
- If the version "with vibration absorption" is • installed, this can be identified by "TILGER" (vibration damper) on the label of the airbag module.
- If the version "without vibration absorption" is • installed, there is **NO** lettering on the label of the airbag module
- Identify inflator version by criteria and proceed to • the proper subsection.
 - 0 Criteria N2: Inflator, three spoke steering wheel, without vibration absorption: Proceed to Subsection 1.
 - Criteria T2: Inflator, three spoke 0 steering wheel, with vibration absorption: Proceed to Subsection 2.
 - Criteria N1: Renewing inflator, four spoke steering wheel, without vibration absorption: Proceed to Subsection 3.
 - o Criteria T1: Renewing inflator, four spoke steering wheel, with vibration absorption: Proceed to Subsection 4.

Subsection 1 – Inflator, three spoke steering wheel, without vibration absorption

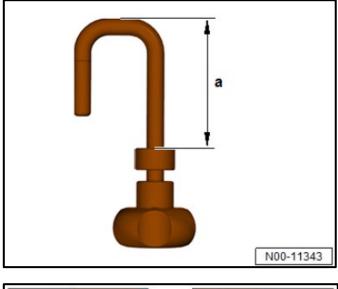

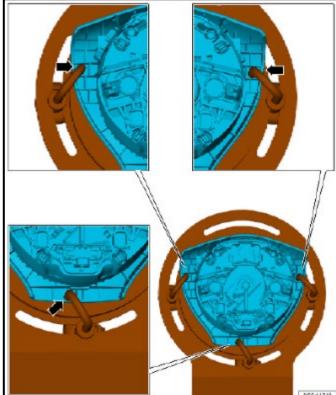



Removal Procedure:

- The three spoke steering wheel has three mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

• Clamp airbag centrally in airbag support. There are securing points on the sides <arrows>, parallel, opposite each other, and below.

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

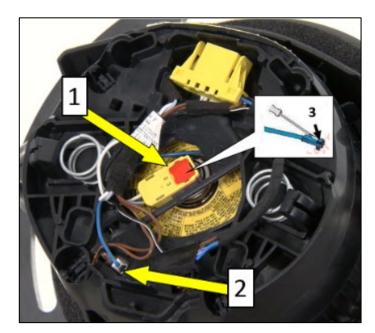

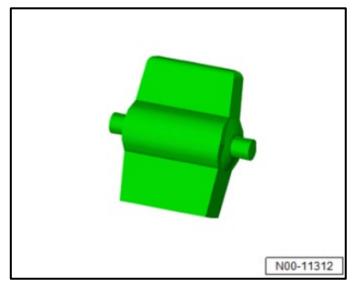


- Disengage connector lock <3> using a small flat bladed screwdriver.
- Remove connector <1> using needle nose pliers. •


- Do not use a screwdriver to pry off connector • <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>.

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

INOTE

- The locking pins are to be reused. •
- There may be instances in which short locking • pins are fitted. These can be levered out with a small screwdriver.

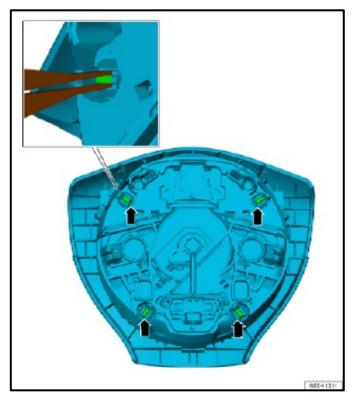

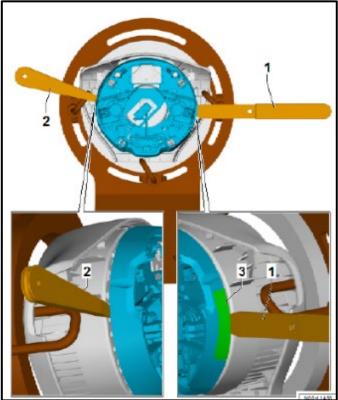



Remove locking pins <arrows> for horn ring with aid of longnose pliers.


- Apply lever -T10571- <1> in shaded area <3>. At • the same time, apply removal wedge -3409- on the other side <2> and lever off horn ring.
- Repeat work steps on other side.

ACAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

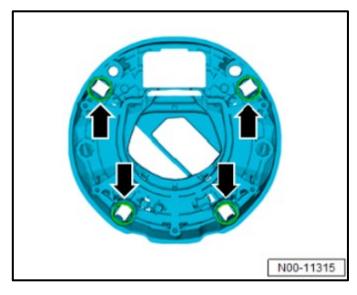

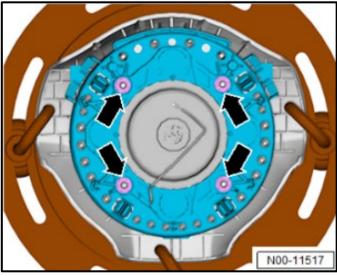

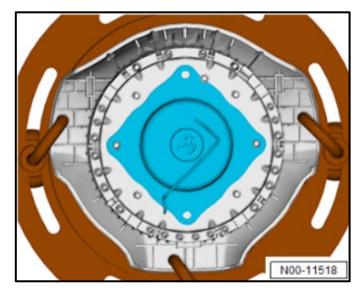

Remove horn ring with springs <arrows>.

A CAUTION

- When removing the horn ring, take care that the springs are not lost as they are not available sepereately.
- ONE replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.
- Remove and discard nuts <arrows>.
- Remove cover for inflator.

Remove the inflator and place in the original packaging.

INOTE

Inflator return instructions are included with the new inflator.



Installation Procedure:

Insert the new inflator as shown. Note the recess <arrow>.

Criteria	Inflator Kit Part Number	
N2	3C8898201B	

INOTE


In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption MUST be installed:


- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the "Inflator, three spoke steering wheel, with vibration absorption" instructions.

Original Inflator Part #	Updated Inflator Part #
3C8898201B	3C8898201C

INOTE

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

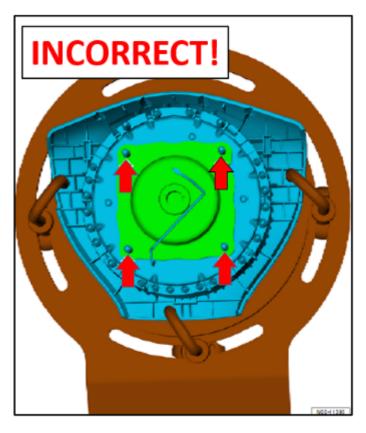


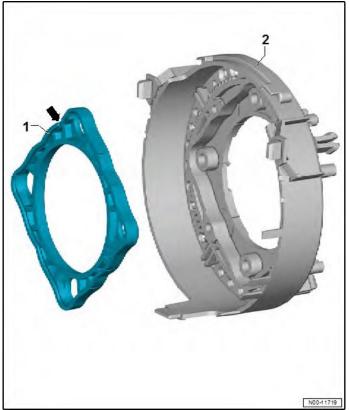

Note installation position:

The inflator must NOT be placed on the studs <arrows>.


Included in the replacement parts kit is an insert ٠ ring <1>. This must be used when installing a new inflator and placed in the horn ring <2>.

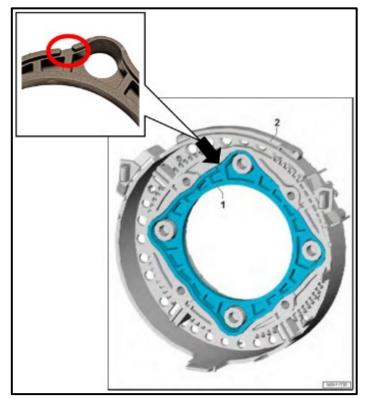

Fit insert ring <1> into horn ring <2>. The notch • (circle) in the insert ring must be at top <arrow> when doing this.


NOTE

- It should be possible to fit the insert ring from the • replacement parts kit with ease.
- It is essential to adhere to the installation position.
- The notch must be at the top <arrow>.

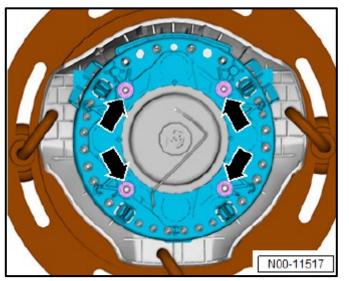

The nuts are self-locking and must be replaced


Fit cover for inflator and tighten 4 nuts <arrows> • to 5 Nm ± 0.4 Nm.

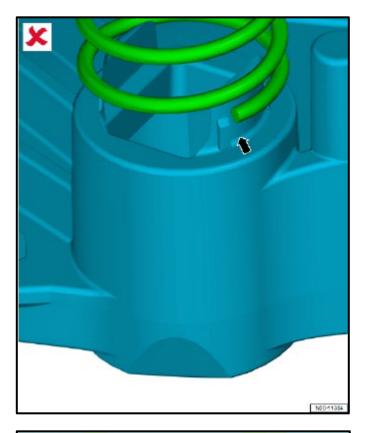



INOTE

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

• Spring seated correctly <arrow>.

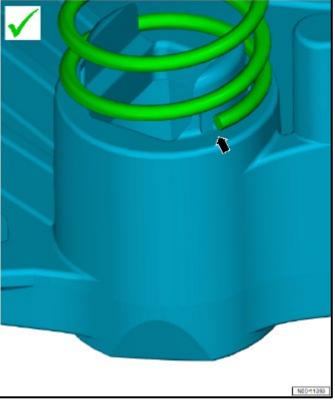


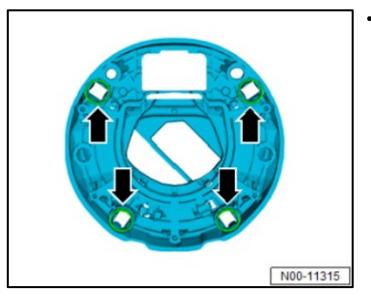

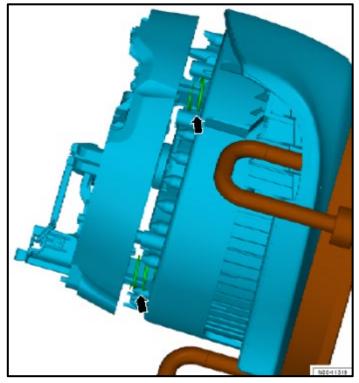


• Fit springs <arrows> for horn ring again and allow to engage audibly.

• Position horn ring <arrows> with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides.

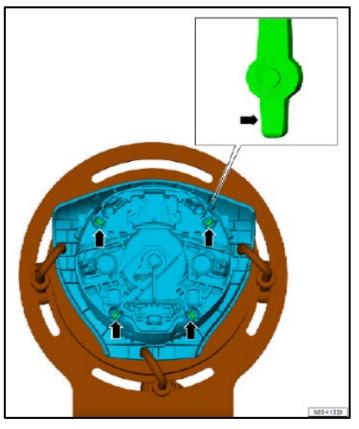

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.

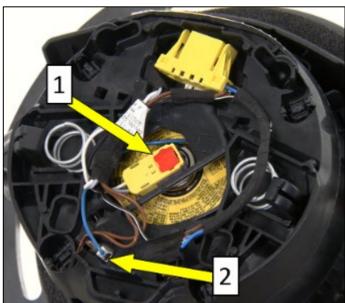

Connect central connector <1> on inflator.


INOTE

Ensure the connector locks are fully open when installing the connectors.

- Press central connector lock in until fully locked.
- Connect ground cable <2>.

Continue to Section F.

Subsection 2 - Inflator, three spoke steering wheel, with vibration absorption

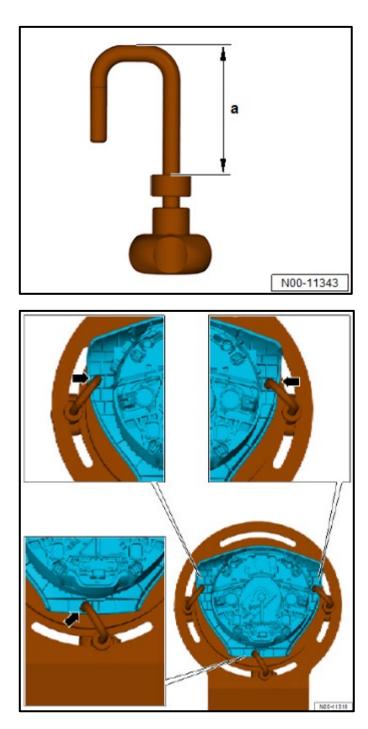


Removal Procedure:


INOTE

- The three spoke steering wheel has three mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

• Clamp airbag centrally in airbag support. There are securing points on the sides <arrows>, parallel, opposite each other, and below.

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.

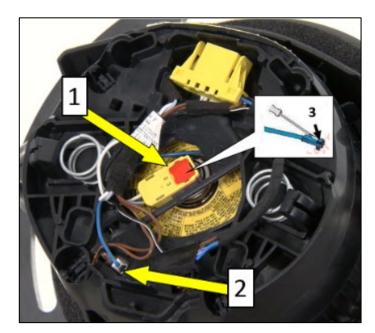

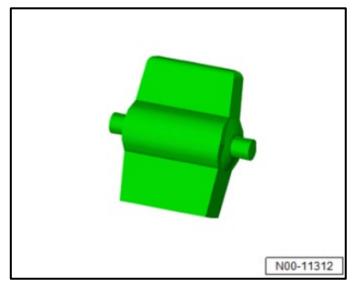


- Disengage connector lock <3> using a small flat bladed screwdriver.
- Remove connector <1> using needle nose pliers. •


- Do not use a screwdriver to pry off connector • <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>.

The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

INOTE

- The locking pins are to be reused. •
- There may be instances in which short locking • pins are fitted. These can be levered out with a small screwdriver.

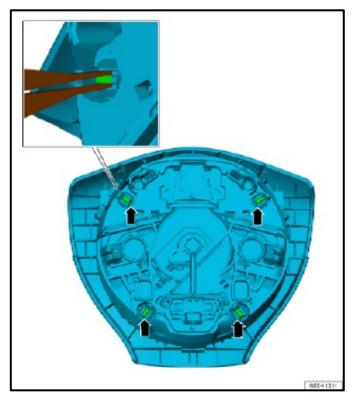

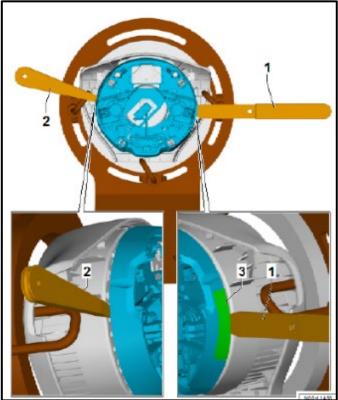



Remove locking pins <arrows> for horn ring with aid of longnose pliers.


- Apply lever -T10571- <1> in shaded area <3>. At • the same time, apply removal wedge -3409- on the other side <2> and lever off horn ring.
- Repeat work steps on other side.

ACAUTION

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

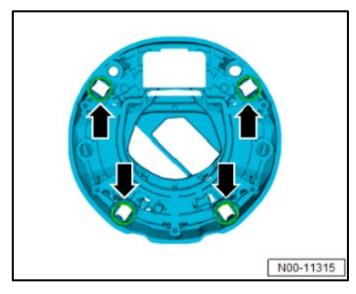

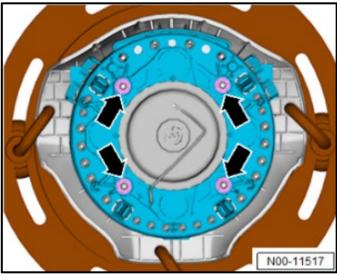

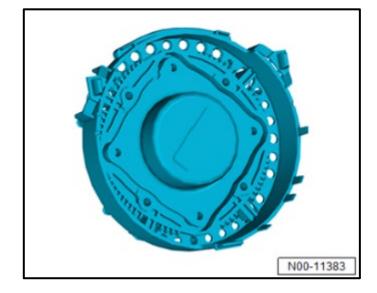


Remove horn ring with springs <arrows>.


- When removing the horn ring, take care that the springs are not lost as they are not available sepereately.
- ONE replacement spring is included in the inflator kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.
- Remove and discard nuts <arrows>.

Remove the inflator and place in the original packaging.

INOTE

Inflator return instructions are included with the new inflator.

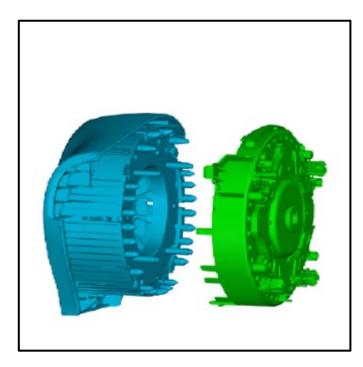

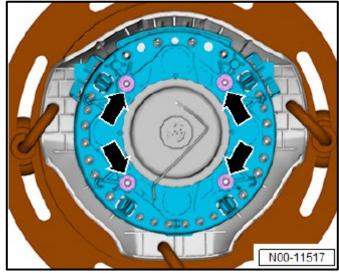


Installation Procedure:

Set new inflator in installation position.

Criteria	Inflator Kit Part Number
T2	3C8898201C

The nuts are self-locking and must be replaced


Install new nuts <arrows> and torque to 5 Nm ± • 0.4 Nm.

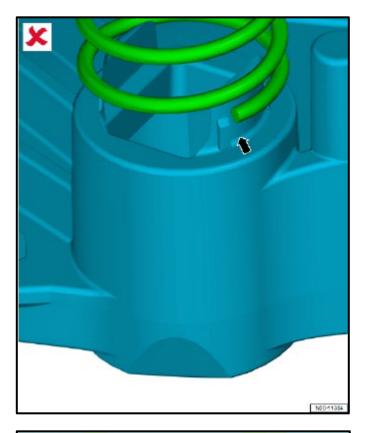



INOTE

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

• Spring seated correctly <arrow>.

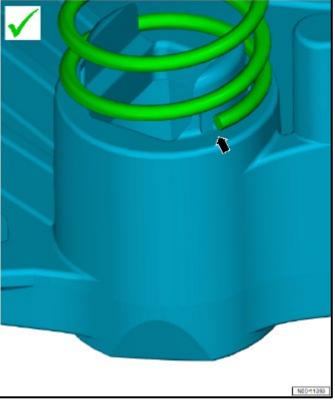


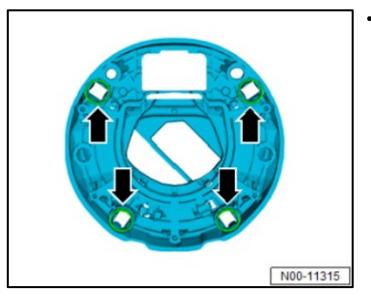

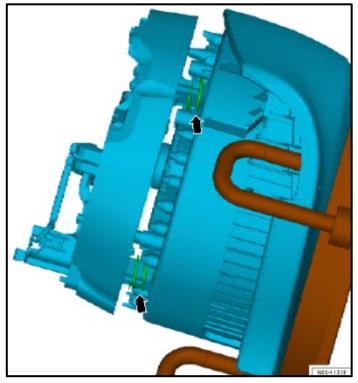


Fit springs <arrows> for horn ring again and allow to engage audibly.

Position horn ring <arrows> with springs on • securing clips and press firmly in place. Ensure that springs are seated correctly on both sides.

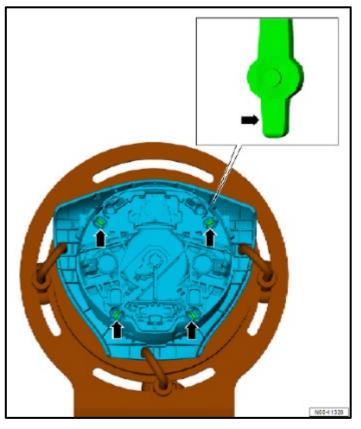

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.

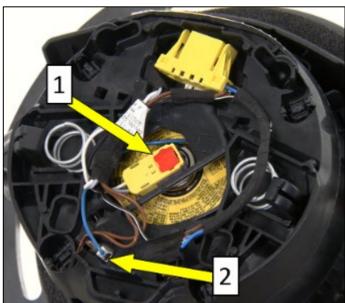

Connect central connector <1> on inflator.


INOTE


Ensure the connector locks are fully open when installing the connectors.

- Press central connector lock in until fully locked.
- Connect ground cable <2>.

Continue to Section F.

Subsection 3 - Renewing inflator, four spoke steering wheel, without vibration absorption

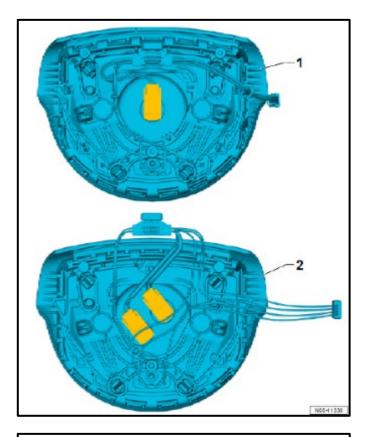


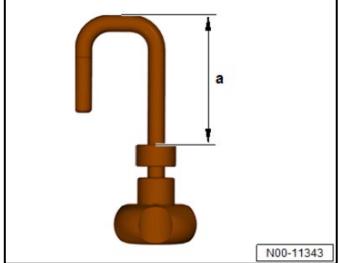


Removal Procedure:

The inflator comes as a single-stage <1> or two-stage <2> version. The work steps for inflator renewal are the same.

- The four spoke steering wheel has two mounting • points.
- Tighten mounting by hand to prevent damage. •
- Adjust three knurled nuts of securing hooks to <dimension a> 50mm.

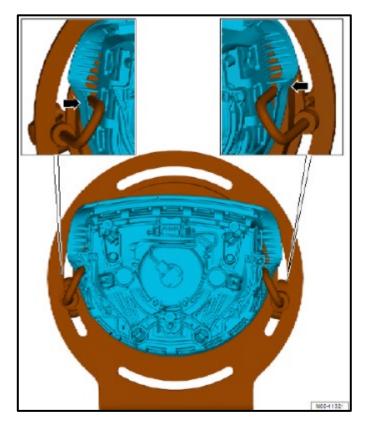

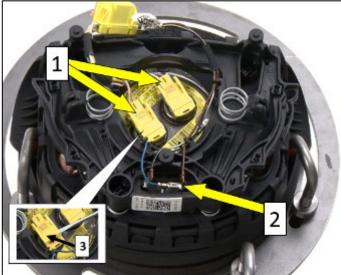

Clamp airbag centrally in airbag support. Securing points on the sides <arrows> and parallel, opposite each other.


The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.


- Disengage connector lock(s) <3> using a small flat • bladed screwdriver.
- Remove connector(s) <1> using needle nose • pliers.

- Do not use a screwdriver to pry off connector(s) <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>. •

INOTE


The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

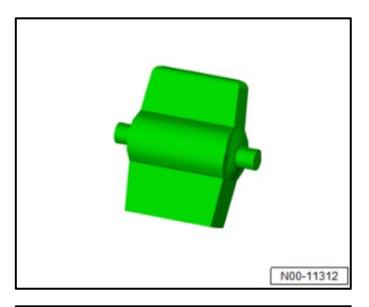


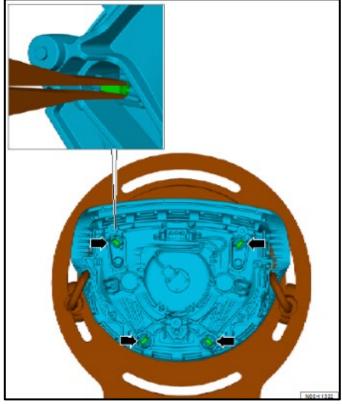

- The locking pins are to be reused. •
- There may be instances in which short locking • pins are fitted. These can be levered out with a small screwdriver.

Remove locking pins <arrows> for horn ring with • aid of longnose pliers.

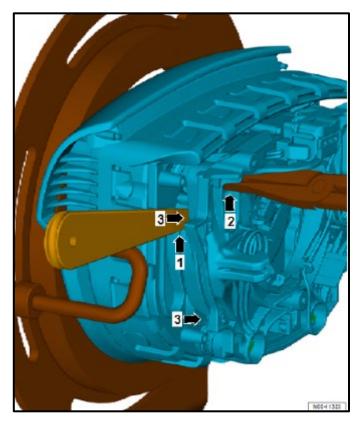


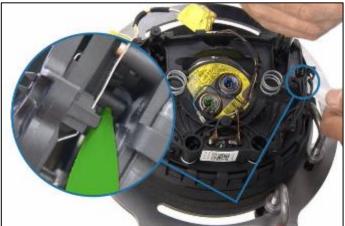

Apply removal wedge -3409- between horn ring and inflator <1> and press together locking elements using longnose pliers <2>. Lever off horn ring at plastic lugs <3>.

- Position the removal wedge -3409- on the plastic lugs to prevent damage to the conductor strip.
- Insert the removal wedge -3409- between the inflator and horn ring to prevent the horn ring from engaging again.
- Repeat work steps on other side. •

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

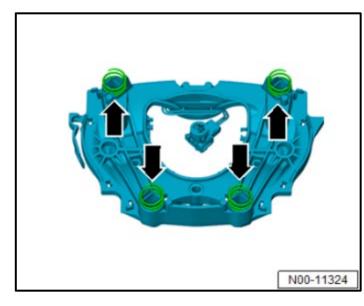



Remove horn ring with springs <arrows>.

A CAUTION

- When removing the horn ring, take care that the • springs are not lost as they are not available sepereately.
- ONE replacement spring is included in the inflator • kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the • airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.
- Remove and discard nuts <arrows>. •
- Remove the inflator and place in the original packaging.

Inflator return instructions are included with the new inflator.

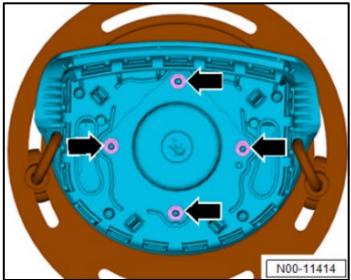

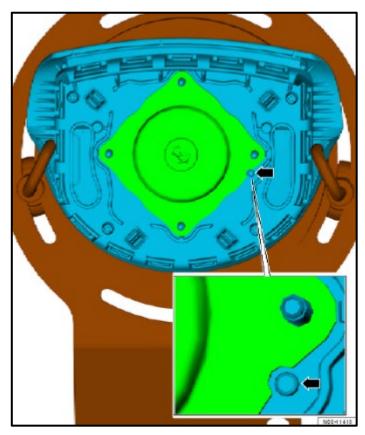


Installation Procedure:

Insert new inflator and check to ensure it is • seated correctly. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
N1	3C0898201H


In the event an airbag had previously been replaced, the replacement airbag may have an inflator WITH the vibration absorber. If this situation is encountered, the inflator WITH vibration absorption (part # 3C0898201J) MUST be installed:

- Repackage the previously scanned inflator and return to the parts department.
- Acquire the correct inflator (part # 3C0898201J) from the parts department.
- Scan the new inflator using the GFF test plan.
- Install the new inflator, following the inflator, four "Renewing spoke steering wheel, with vibration absorption (Criteria T1)" instructions.

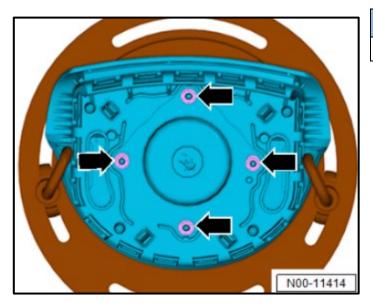

The nuts are self-locking and must be replaced


Install new nuts <arrows> and torgue to 5 Nm ± 0.4 Nm.

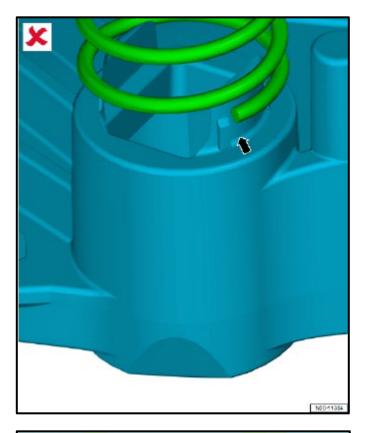



I NOTE

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

• Spring seated correctly <arrow>.

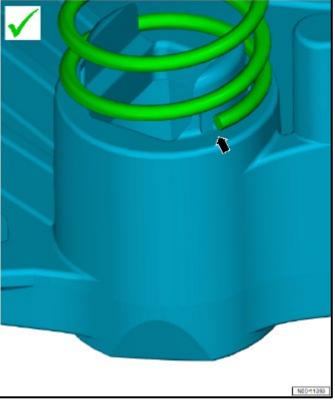


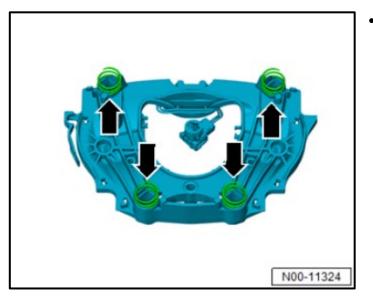

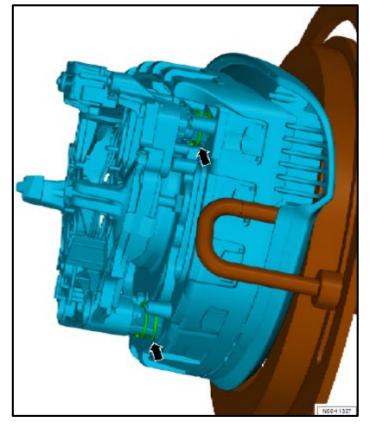

Fit springs <arrows> for horn ring again if necessary.

• Position horn ring with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides <arrows>.

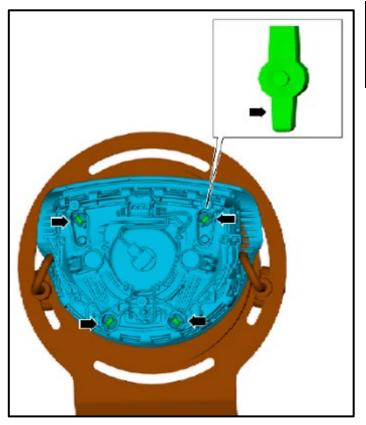


INOTE

If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.


Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.


- Connect central connector(s) <1> on inflator.
- Press central connector lock(s) in until fully locked. •
- Connect ground cable <2>. •

Continue to Section F.

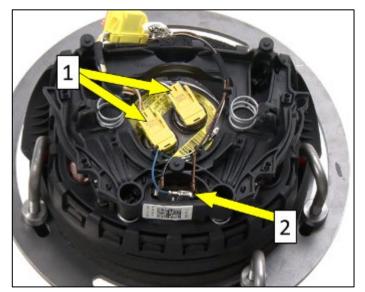

Subsection 4 – Renewing inflator, four spoke steering wheel, with vibration absorption

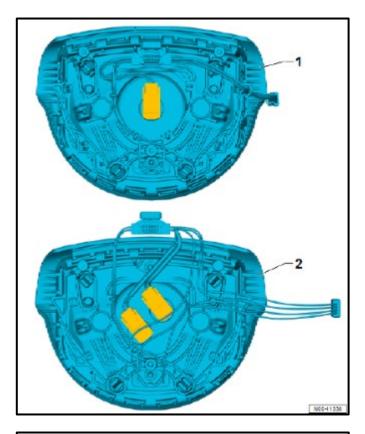


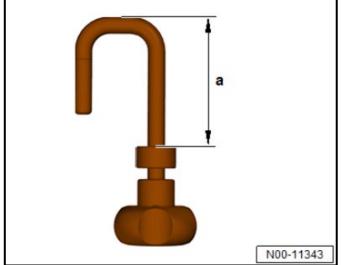


Removal Procedure:

- The inflator comes as a single-stage <1> or • two-stage <2> version. The work steps for inflator renewal are the same.
- Tighten mounting by hand to prevent • damage.

- The four spoke steering wheel has two mounting points.
- Tighten mounting by hand to prevent damage.
- Adjust three knurled nuts of securing hooks to • <dimension a> 50mm.

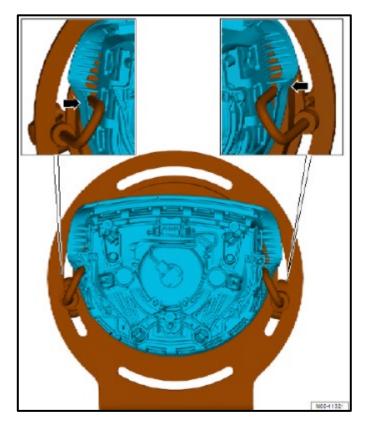

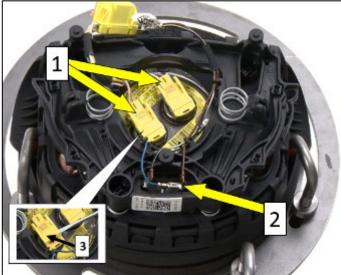

Clamp airbag centrally in airbag support. Securing points on the sides <arrows> and parallel, opposite each other.

The clamps must be placed in the positions shown <arrows> to prevent damage to the airbag. Damage to the airbag is not covered under this action.


- Disengage connector lock(s) <3> using a small flat • bladed screwdriver.
- Remove connector(s) <1> using needle nose • pliers.


A CAUTION

- Do not use a screwdriver to pry off connector(s) <1> or damage to the connector could occur.
- Damage to the airbag connectors will not be covered under this action.
- Remove ground cable <2>. •

INOTE


The photo is for reference only. The inflator that is installed may be either a single stage or dual stage inflator.

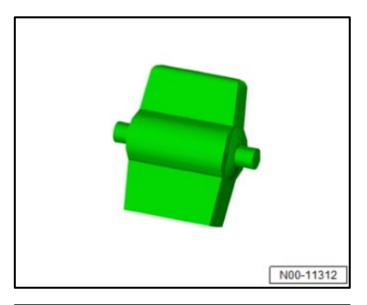


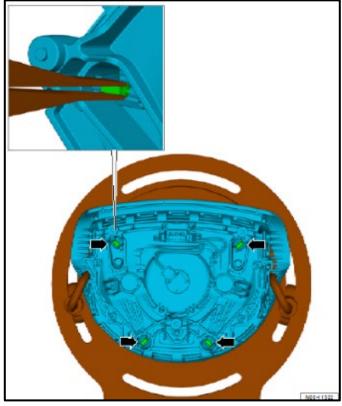

- The locking pins are to be reused. •
- There may be instances in which short locking • pins are fitted. These can be levered out with a small screwdriver.

Remove locking pins <arrows> for horn ring with • aid of longnose pliers.

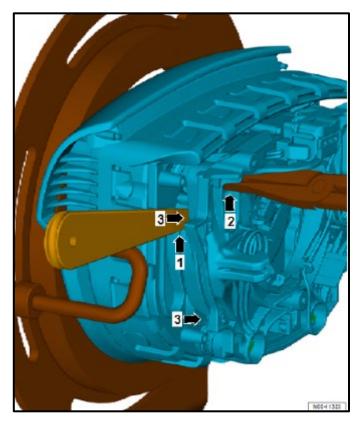


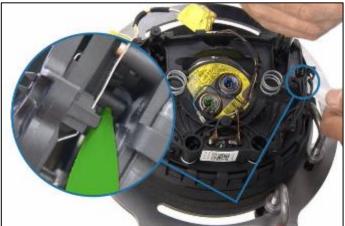

Apply removal wedge -3409- between horn ring and inflator <1> and press together locking elements using longnose pliers <2>. Lever off horn ring at plastic lugs <3>.

- Position the removal wedge -3409- on the plastic lugs to prevent damage to the conductor strip.
- Insert the removal wedge -3409- between the inflator and horn ring to prevent the horn ring from engaging again.
- Repeat work steps on other side. •

Use extreme care when removing the horn ring. If horn ring is damaged during remove, airbag replacement will be necessary. Replacement of the airbag due to damage during horn ring removal will not be covered under this action.

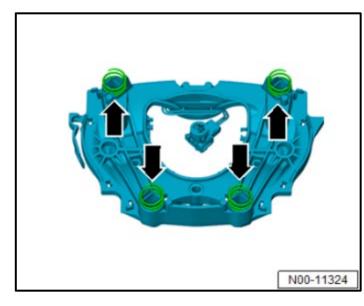



Remove horn ring with springs <arrows>.


A CAUTION

- When removing the horn ring, take care that the • springs are not lost as they are not available sepereately.
- ONE replacement spring is included in the inflator • kit in the event a spring is lost or damaged.
- If more than one spring is lost, replacement of the airbag is required. Replacement of the airbag is required if a spring is lost and is not covered under this action.
- Remove and discard nuts <arrows>. •
- Remove the inflator and place in the original packaging.

Inflator return instructions are included with the new inflator.

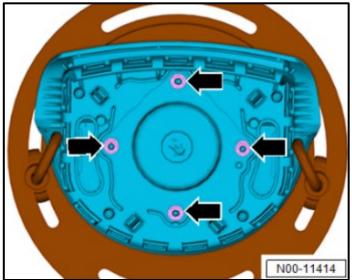

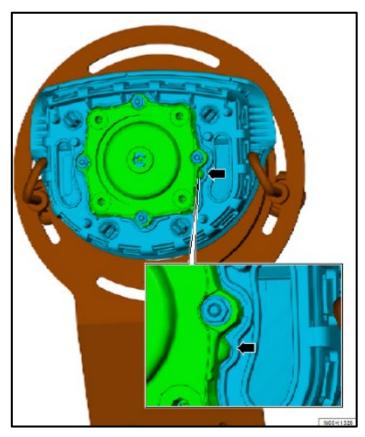

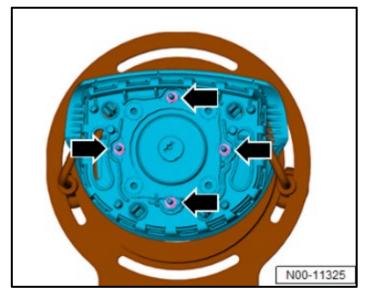


Installation Procedure:

Insert new inflator and check to ensure it is • seated correctly. Note the recess <arrow>.

Criteria	Inflator Kit Part Number
T1	3C0898201J

The nuts are self-locking and must be replaced


Install new nuts <arrows> and torque to 5 Nm ± • 0.4 Nm.

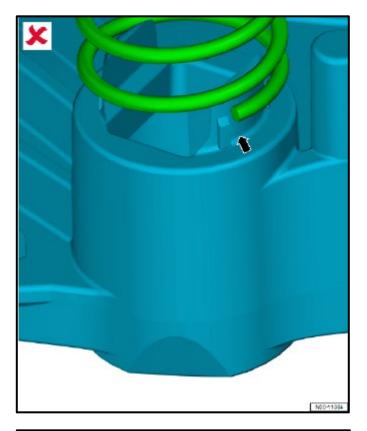



I NOTE

- If one of the springs is damaged or has been lost, it can be replaced with a spring from the bag of spares included.
- Note the examples shown for reference of proper spring seating.
- Spring seated incorrectly <arrow>.

• Spring seated correctly <arrow>.

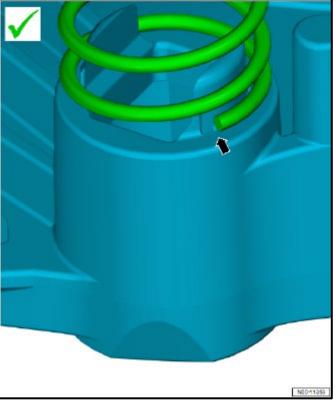


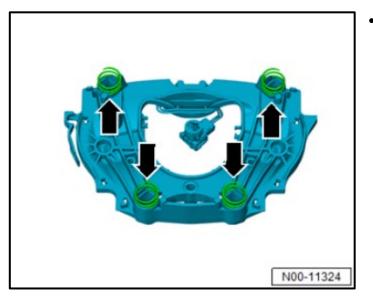

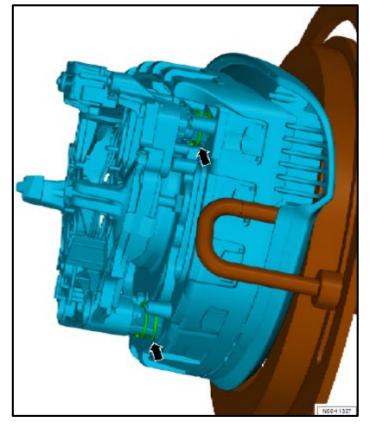

Fit springs <arrows> for horn ring again if necessary.


• Position horn ring with springs on securing clips and press firmly in place. Ensure that springs are seated correctly on both sides <arrows>.

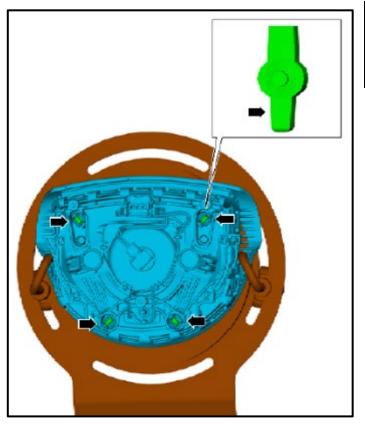

INOTE


If a pin is damaged or has been lost, it can be replaced with a locking pin from the bag of spares included.

 Using long-nose pliers, insert four locking pins in retaining lugs with narrow side facing downwards <arrow in magnification>. Pins must engage audibly.



- Press central connector lock(s) in until fully locked. •
- Connect ground cable <2>. •


Continue to Section F.

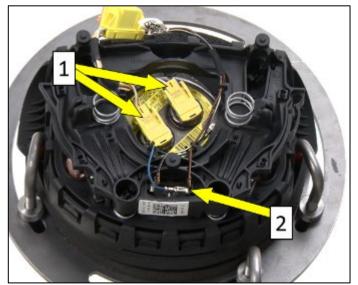

Section F – Airbag Installation

Vehicles with Critiera T3: Install a new driver airbag.


Criteria	Driver Airbag Part Number
Т3	561880201AA 81U

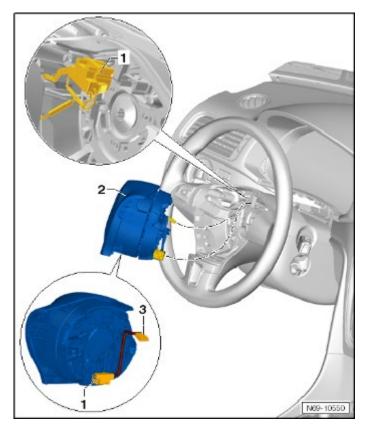

- The battery must be disconnected before • installing the airbag back into the vehicle.
- Before handling pyrotechnic components (for example, disconnecting the connector), the person handling it must "discharge static electricity". This can be done by touching the door striker, for example.
- Connect the connector <1>. The connector must click into place during this.
- Press the connector lock on the connector <1>. •
- Connect the connector <3> (if equipped).
- Insert the airbag unit <2> into the steering wheel but do not press on it.

INOTE


Procedure illustrated is for a three spoke steering wheel. The procedure for a four spoke steering wheel is the same.

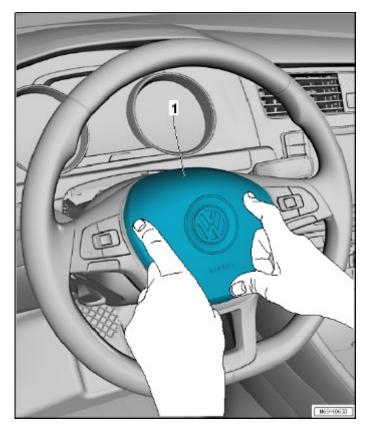

- Press on the edge of the airbag unit <1> with both • hands until it locks into place.
- Gently pull on the airbag unit to make sure the airbag unit is secured correctly at all three • attachment points in the steering wheel.

Continue to Section G.

Section G – Battery Reconnect

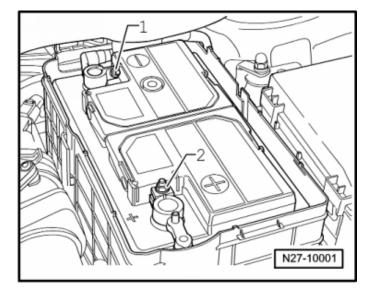

For 2006-2010 MY Passat vehicles, the engine may not start after reconnecting battery. This condition should be resolved by following these steps:

- 1. Remove the key from the vehicle.
- 2. Open and close the driver's door.
- 3. Lock then unlock the vehicle using the remote.
- 4. Insert the key and the vehicle should now start.

Battery In Engine Compartment:

Ignition must be **ON** when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.

- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <1> to 6 Nm.

INOTE

After connecting the battery and switching on the ignition, the ASR/ESP Control Lamp -K155- and Electromechanical Power Steering Indicator Lamp light up continuously. The indicator lamps switch off automatically after driving straight ahead at 10 to 15 mph. This activates Steering Angle Sensor -G85-.



- Close the cover <1>.
- Cycle the ignition off and back on.
- Bring driver seat to an upright position.
- Store previously recorded radio presets (if necessary).
- Set clock to local time.
- Activate the power window regulator one-touch up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.
 - (!) **NOTE (Vehicles with Criteria T3)**


With the current ODIS Service version: Application V4.4.10 – Diagnostic Content 2.36.3:


- Before exiting ODIS, switch to the OBD operating mode and clear all faults using OBD. This process will only take a couple of minutes. Due to the amount of faults generated during the parameterization test plan, ODIS may lock up when saving the log, exiting GFF or sending the diagnostic protocol.
- ODIS versions after the above mentioned version should not experience these issues.
- After completing repairs, verify the horn is operational.

INOTE

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.

Proceed to Section H.

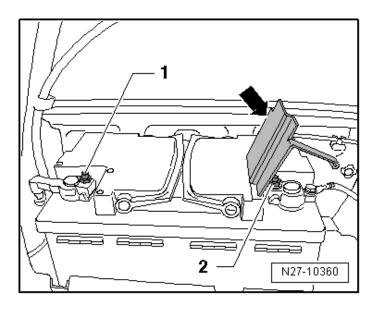

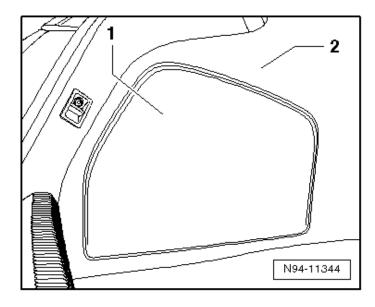

Battery In Luggage Compartment:

Ignition must be ON when connecting battery. If pyrotechnic components (e.g. airbag, belt tensioner) are not repaired correctly, they may deploy unintentionally after connecting battery. There must not be anyone inside the vehicle when connecting the battery.

- Connect the battery ground cable terminal by hand to the battery negative terminal.
- Torque the nut <1> to 6 Nm.

INOTE

After connecting the battery and switching on the ignition, the ASR/ESP Control Lamp -K155- and Electromechanical Power Steering Indicator Lamp light up continuously. The indicator lamps switch off automatically after driving straight ahead at 10 to 15 mph. This activates Steering Angle Sensor -G85-.

- Install the service cover <1> on the side trim panel <2>.
- Cycle the ignition off and back on. •
- Bring driver seat to an upright position. •
- Store previously recorded radio presets (if necessary).
- Set clock to local time. •
- Activate the power window regulator one-touch • up/down function.
- Check the DTC memories of all the control units and erase under-voltage faults if necessary.
- After completing repairs, verify the horn is operational.

INOTE

Diagnosis and repair of an inoperable horn, before or after inflator replacement, will not be covered under this campaign.

Proceed to Section H.

Install Campaign Completion Label

Fill out and affix Campaign Completion • Label, part number CAMP 010 000, next to the vehicle emission control information label.

Ensure Campaign Completion Label does not cover any existing label(s).

Repair is Complete, Proceed to Appendix C (Mandatory Takata Part Return Process).

Appendix A – Warning and Safety Precautions

WARNING

General Safety Precautions when Working with Pyrotechnic Components:

- Pyrotechnic components always contain propellant that generates a gas during combustion. In some components, there is also a supply of pressurized gas to ensure this gas is generated
- This pressurized gas is stored under high pressure in a compressed gas container. Pyrotechnic components are triggered by electrical/mechanical igniters.
- Only trained personnel should perform testing, assembly and servicing work. Airbags do not have a • replacement interval.
- Never check with test lamps, voltmeter or ohmmeters.
- Only check pyrotechnic components when they are installed in the vehicle using vehicle diagnosis, testing and information systems approved by the manufacturer.
- When working on pyrotechnic components and the airbag control module, disconnect the battery ground • strap while the ignition is switched on. Then cover the negative terminal.
- Wait 10 seconds after disconnecting the battery.
- The ignition must be SWITCHED ON when connecting the battery. There should not be anyone inside the vehicle when doing this.
- Exception: vehicles with batteries in the passenger compartment. In this case, stay outside the range of the • airbags and seat belts.
- Wash your hands after touching ignited pyrotechnic components from the restraint system. •
- Do not open or repair pyrotechnic components. Use only new components to reduce the risk of injury.
- Do not install pyrotechnic components that have fallen onto a hard surface or show signs of damage.
- Discharge static electricity before handling pyrotechnic components, for example before disconnecting the • electrical connector. This can be done by touching grounded metal objects such as the door striker pin.
- Install pyrotechnic components immediately after removing them from their transport packaging. If you must stop working, store the pyrotechnic component in its original transport packaging.
- Do not leave pyrotechnic components lying in the open unattended.
- Do not treat pyrotechnic components with grease, cleaning solutions or similar products.
- Do not expose pyrotechnic components to temperatures above 100 °C, even for brief periods of time.
- People in the immediate vicinity of the workplace must be protected from possible noise and projectiles.
- Pyrotechnic components can trigger unintentionally.
- In the event of unintentional deployment:
 - Single-stage inflators: allow airbag to cool down completely. Wait at least 10 minutes before 0 handling.
 - Two-stage inflators: wait for second airbag ignition. Allow airbag to cool down completely. Wait at least 10 minutes before handling.

Appendix B – Rental Car/Loaner FAQ

TAKATA AIRBAG CLASS ACTION SETTLEMENT DEALERSHIP FAQS

Q: What is an eligible class member entitled to under the Enhanced Rental Car/Loaner Program?

A: Under the Enhanced Rental Car/Loaner Program, VWGoA or Audi of America will provide a rental or loaner vehicle to every owner or lessee who (i) brings one of the covered recalled vehicles to a Volkswagen or Audi dealer for completion of the remedy of the recall and (ii) requests a rental/loaner vehicle while awaiting the remedy for the recall, while the remedy for the recall is in progress, or if there is a delay in performing the remedy for the recall on the affected vehicle.

Q: Is there any information a customer must provide to participate in the Enhanced Rental Car/Loaner **Program?**

A: The customer must provide adequate proof of insurance. If a rental car (as opposed to a loaner car) is provided, the customer must meet the applicable rental car company's guidelines, including age restrictions.

Q: How long will a rental or loaner car be provided to an eligible class member under the Enhanced Rental Car/Loaner Program?

A: The rental/loaner car will be available until the remedy for the recall is performed on the affected vehicle, at which time the rental/loaner vehicle must be promptly returned to the provider of the rental/loaner vehicle in the same condition (excepting ordinary wear and tear) as received. Absent extenuating circumstances, the rental/loaner vehicle must be returned when the recall is completed. And in no event will VWGoA or Audi of America pay for a rental car or provide a loaner for more than 7 days after the remedy for the recall is completed on a vehicle.

Q: How early can an eligible class member expect to be provided a rental/loaner car under the Enhanced **Rental Car/Loaner Program?**

A: The Enhanced Rental Car/Loaner Program will take effect no later than 30 calendar days following November 10, 2021, the date of the Court's issuance of an order preliminarily approving the Settlement.

Appendix C – Mandatory Takata Part Return Process

NOTE

NOTE: International (including Mexico and Canada), Hawaii, Alaska, Puerto Rico, and US Virgin Islands dealers *CANNOT* follow below shipping instructions. Instead, dealerships in these locations *MUST* contact the following Takata/Menlo USA representative directly for shipping instructions: Miguel Prigadaa – Tel #: 210-250-5078 or Email: MLGTakataRestraints_International@menloworldwide.com. Or they can email the attached form to Menlo/XPO, (email is in the form) & they will make arrangements with Crane Worldwide to arrange pick up. As info, both emails go to the same international people that arrange the freight. <u>MLGTakataRestraints_International@menloworldwide.com</u>; <u>SCTakataRestraints_International@XPO.com</u>

NOTE: For Continental US 48 State dealerships, please follow steps 1-8 below.

