		RECALL							
TOPIC	TYPE	CODE	QUESTION	ANS	ANSWER				
					Beginning	_			
				Country	Model	Model	Vehicle		
				110.0	Year	Year	05571.5		
				USA	2012	2019	BEETLE		
				USA	2012 2015	2019	BEETLE CONVERTIBLE GOLF		
				USA	2013	2019	GOLF SPORTWAGEN		
				USA	2017	2019	GTI		
			What vehicles are	USA	2011	2018	JETTA		
Compliance			included in Safety						
Recall		37M2	Recall 37M2?						
				Over time, a build-up of silicate on the shift lever micro switch					
				contacts can result in an isolation-like layer that may be interpreted as an open micro switch. This open switch					
				normally indicates that the shift lever is in "P" park position. If the build-up happens, it may be possible to remove the key from the ignition switch without the shift lever being in the "P" park position because the system isn't able to recognize that the vehicle is not in "P" park. This makes the vehicle noncompliant with FMVSS 114; Theft protection and rollaway prevention.					
				If the ignition key is removed without the shift lever being in "P" Park position, there is a risk that the vehicle may roll away, resulting in a crash that could injure people and damage					
			What is the safety				h that could		
			concern for Safety						
			Recall 37M2?		property.				
							fect, dealers		
							tional switch		
			What is the repair for	and c	ircuit l	ooard.	The recall		
			Safety Recall 37M2?	repai	r is FR	EE.			
							e now and		
			repairs have begun. Please						
			contact your local Volkswage						
				Dealership to schedule an appointment. If you are not familiar with one, please click					
			When will the repair						
				here to locate a Volkswagen					
							onagon		
			for Safety Recall 37M2 be available?		to loca er neal		olkswagen		

	Are there any precautions I should take because my vehicle is part of Safety Recall 37M2?	Yes. If this condition is present in the vehicle, an audible warning sound and failure message may appear in instrument cluster while the vehicle is in motion, due to the micro switch failure (a non-existent "P" Park shift lever position is incorrectly detected). If this happens, owners are advised to contact an authorized Volkswagen dealer immediately and make arrangements to have the vehicle inspected. Owners are advised to always set the parking brake and follow the parking instructions as described in the vehicle owner's manual before removing the ignition key.	