 


Alternative to Special Tool 23 53 303 for recall 19V-692 (K 1600 GT/GTL, Bagger)

As we wait for inventory of special tool 23 53 303 we would like to share with you a recommendation from several dealers and our own national workshop who have completed repairs already. Please see the attached information sheet for further information on using a modified 1-1/4" socket.



Feb 27, 2020 at 12:14 PM

RECALL 19V-692 SOCKET FOR INPUT SHAFT

1/2" Drive 6-Point SAE 1-1/4" Flank Drive® Shallow Impact Socket

Snap-on


1. Locally source a 1 ¼ six point socket
2. Sand or grind facing surface flat to insure maximum contact.



Item
IM400



3. Skip removal of input shaft banjo bolt in step #46 and remove banjo bolt once gearshift cover is removed after step #55

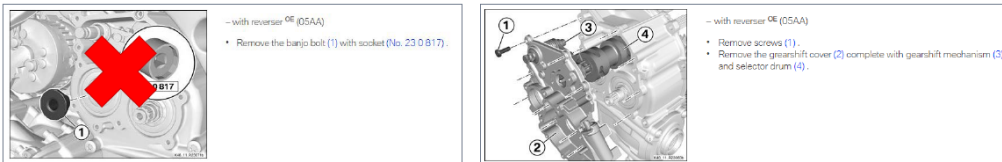

4. Install and torque new bolt (while securing opposite end of the shaft) before reinstalling the gearshift cover.