

# Part 573 Safety Recall Report

# 20V-066

**Manufacturer Name :** Honda (American Honda Motor Co.)**Submission Date :** FEB 06, 2020**NHTSA Recall No. :** 20V-066**Manufacturer Recall No. :** T6U**Manufacturer Information :****Population :**

Manufacturer Name : Honda (American Honda Motor Co.)

Number of potentially involved : 241,339

Address : 1919 Torrance Blvd.

Estimated percentage with defect : 100 %

Torrance CA 90501

Company phone : 1-888-234-2138

**Vehicle Information :**

Vehicle 1 : 2018-2018 Honda Odyssey

Vehicle Type :

Body Style :

Power Train : NR

**Descriptive Information :** The recall population was determined based on manufacturing records. The manufacturing range reflects all possible vehicles that could potentially experience the problem. Similar vehicles not included in the recall either were not equipped with a third row seat accessory power outlet, or if equipped, were built after January 29, 2020. On January 29, 2020 the routing for the third row seat accessory power outlet wire harness was modified to prevent the wire harness from pinching between the unibody and the rear trim panel. The number of affected units is 95,639.

Production Dates : JAN 19, 2017 - APR 17, 2018

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 2 : 2019-2019 Honda Odyssey

Vehicle Type :

Body Style :

Power Train : NR

**Descriptive Information :** The recall population was determined based on manufacturing records. The manufacturing range reflects all possible vehicles that could potentially experience the problem. Similar vehicles not included in the recall either were not equipped with a third row seat accessory power outlet, or if equipped, were built after January 29, 2020. On January 29, 2020 the routing for the third row seat accessory power outlet wire harness was modified to prevent the wire harness from pinching between the unibody and the rear trim panel. The number of affected units is 107,523.

Production Dates : APR 12, 2018 - AUG 13, 2019

VIN Range 1 : Begin :

NR

End : NR

 Not sequential

Vehicle 3 : 2020-2020 Honda Odyssey

Vehicle Type :

Body Style :

Power Train : NR

**Descriptive Information :** The recall population was determined based on manufacturing records. The manufacturing range reflects all possible vehicles that could potentially experience the problem. Similar vehicles not included in the recall either were not equipped with a third row seat accessory power outlet, or if equipped, were built after January 29, 2020. On January 29, 2020 the routing for the third row seat accessory power outlet wire harness was modified to prevent the wire harness from pinching between the unibody and the rear trim panel. The number of affected units is 38,177.

Production Dates : SEP 11, 2018 - JAN 29, 2020

VIN Range 1 : Begin :

NR

End : NR

Not sequential

## Description of Defect :

**Description of the Defect :** The routing for the third row seat accessory power outlet wire harness may cause the wire harness to get pinched between the unibody and the rear trim panel. If the pinching damages and exposes the wiring to the unibody, an electrical short could occur.

FMVSS 1 : NR

FMVSS 2 : NR

**Description of the Safety Risk :** An intermittent electrical short could overheat the wire harness, increasing the risk of a fire.

**Description of the Cause :** NR

**Identification of Any Warning that can Occur :** NR

## Supplier Identification :

### Component Manufacturer

Name : Sumitomo Electric Wiring Systems US

Address : 14800 Industrial Parkway  
Marysville FOREIGN STATES 43040

Country : Philippines

## Chronology :

See attached chronology dated February 6, 2020.

## Description of Remedy :

Description of Remedy Program : Registered owners of all affected vehicles will be contacted by mail and asked to take their vehicle to a Honda automobile dealer. The dealer will inspect the third row seat accessory power outlet wire harness for damage and, if any copper wiring is exposed, replace the floor wire harness for free. If no copper wiring is exposed, the dealer will apply protective tape and re-route the wire harness for free. Because the new vehicle limited warranty on all affected vehicles would have provided a free repair for the problem addressed by this recall, without any payment by the owner, reimbursement for pre-notification repairs will not be offered.

How Remedy Component Differs from Recalled Component : Floor wire harness, floor wire harness, part numbers: 32107-THR-A21, 32107-THR-A31, 32107-THR-A42, 32107-THR-A52, 32107-THR-AC0, 32107-THR-AD0, 32107-THR-AE0, 32107-THR-AF0, 32107-THR-AM0, 32107-THR-AN0, 32107-THR-AP0, 32107-THR-AR0.

Identify How/When Recall Condition was Corrected in Production : NR

## Recall Schedule :

Description of Recall Schedule : Dealer notification is expected to begin on or about February 7, 2020.  
Owner notification is expected to begin on or about March 16, 2020.

Planned Dealer Notification Date : FEB 07, 2020 - NR

Planned Owner Notification Date : MAR 16, 2020 - NR

\* NR - Not Reported