

Part 573 Safety Recall Report

20V-081

Manufacturer Name : Jaguar Land Rover North America, LLC

Submission Date : FEB 28, 2020

NHTSA Recall No. : 20V-081

Manufacturer Recall No. : H283



Manufacturer Information :

Population :

Manufacturer Name : Jaguar Land Rover North America, LLC

Address : 100 Jaguar Land Rover Way

Mahwah NJ 07495

Company phone : 8188500

Number of potentially involved : 2,907

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2010-2010 JAGUAR XF

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : 2907 2010 Model Year Jaguar XF 4.2L engine vehicles in the United States and Federalized Territories.

The basis of the recall population was derived from Jaguar Land Rover data where the VIN range and engine type with this design of fuel tank outlet flange is found on 2010 Model Year Jaguar XF 4.2L engine vehicles. 4.2L engine vehicles ceased production in December 2009.

Production Dates : JAN 16, 2009 - DEC 22, 2009

VIN Range 1 : Begin : SAJWA0FA1AHR46314 **End :** SAJWA0FA9AHR73079 Not sequential

Description of Defect :

Description of the Defect : Customers have reported fuel odor, the amber Malfunction Indicator Lamp on the Instrument Cluster illuminating and occasionally liquid fuel on the ground. On investigation, dealer technicians are finding that the fuel outlet flange mounted in the fuel tank is cracked.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : The driver may also experience fuel odor and in some circumstances, with the vehicle static, there could be liquid fuel underneath the rear of the vehicle, which in the presence of an ignition source could lead to a fire.

Description of the Cause : NR

Identification of Any Warning NR
that can Occur :

Supplier Identification :

Component Manufacturer

Name : Continental Teves Czech Republic, s.r.o.
Address : Prumyslova 2299
Brandys Nad Labem FOREIGN STATES 250 01
Country : Czech Republic

Chronology :

See File "Recall H283 Chronology".

Description of Remedy :

Description of Remedy Program : Owners will be notified and instructed to take their vehicle to a Jaguar authorized repairer to have the fuel outlet flange replaced with a component of revised design.

Owners who have paid for a repair of this defect will be covered by the Jaguar Land Rover reimbursement plan, subject to the usual terms and conditions.

How Remedy Component Differs from Recalled Component : Part name: Fuel Outlet Flange
Part Description: Fuel outlet flange is mounted in the fuel tank.
Part Number: C2Z10550

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Distribution of owner notification letters will occur on or before April 9, 2020. Notifications to dealers will occur on February 27, 2020.

Planned Dealer Notification Date : FEB 27, 2020 - FEB 27, 2020

Planned Owner Notification Date : APR 09, 2020 - APR 09, 2020

* NR - Not Reported