

Part 573 Safety Recall Report

20V-101

Manufacturer Name : Kia Motors America**Submission Date :** FEB 21, 2020**NHTSA Recall No. :** 20V-101**Manufacturer Recall No. :** SC188**Manufacturer Information :**

Manufacturer Name : Kia Motors America

Address : 111 Peters Canyon Road
Irvine CA 92606

Company phone : 800-333-4542

Population :

Number of potentially involved : 51,465

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2011-2012 Kia Sedona

Vehicle Type : LIGHT VEHICLES

Body Style : ALL

Power Train : GAS

Descriptive Information : All 2011-2012 model year Kia Sedona vehicles manufactured from March 3, 2010 through August 14, 2012.

The recall population was determined by a review of vehicle production records. The fuel rail may develop a crack. The vehicles subject to this recall were not produced in VIN order. Customers seeking information about their specific vehicle will be referred to Kia's Consumer Assistance Center or their Kia dealer.

Production Dates : MAR 03, 2010 - AUG 14, 2012

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The fuel rail may develop a small heat induced crack from what is believed to be a result of exposure to heat generated within the engine compartment under certain circumstances.
If the fuel rail develops a crack, fuel smell and eventually a fuel leak can occur.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Leaking fuel increases the risk of fire.

Description of the Cause : Exposure to heat generated within the engine compartment under certain circumstances.

Identification of Any Warning that can Occur : Fuel smell and/or fuel leaking

Supplier Identification :

Component Manufacturer

Name : Delphi Powertrain Systems Korea
Address : 851-2, Oe-dong, Changwon-si, Gyeongsangn
Changwon FOREIGN STATES 51535
Country : Korea, Republic of

Chronology :

See attached document titled "2011-2012MY Sedona Fuel Rail Chronology"

Description of Remedy :

Description of Remedy Program : All owners of the subject vehicles will be notified by first class mail with instructions to bring their vehicles to a Kia dealer. Dealers will be instructed to replace the fuel rail with a new one. Kia will reimburse owners for repair expenses already incurred pursuant to Kia's General Reimbursement Plan filed April 10, 2018.

How Remedy Component Differs from Recalled Component : The remedy component has a different shape (cross section from D type to O type fuel rail).

Identify How/When Recall Condition was Corrected in Production : The condition was corrected in production on August 15, 2012.

Recall Schedule :

Description of Recall Schedule : Dealer Notification is scheduled to begin on April 10, 2020 and the Owner Notification is scheduled to begin on April 16, 2020 and end on April 17, 2020.

Planned Dealer Notification Date : APR 10, 2020 - APR 10, 2020
Planned Owner Notification Date : APR 16, 2020 - APR 17, 2020

* NR - Not Reported