

Part 573 Safety Recall Report

20V-248

Manufacturer Name : Hyundai Motor America**Submission Date :** MAY 01, 2020**NHTSA Recall No. :** 20V-248**Manufacturer Recall No. :** 192**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 1,295

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2016-2016 Hyundai Genesis Coupe

Vehicle Type : LIGHT VEHICLES

Body Style : 2-DOOR

Power Train : GAS

Descriptive Information : The subject vehicles include certain model year 2016 Hyundai Genesis Coupe vehicles produced between March 7, 2016 and June 10, 2016 by Hyundai Motor Company ("HMC") for sale in the U.S. market.

Production Dates : MAR 07, 2016 - JUN 10, 2016

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : The mounting bolts securing the driver-side air bag ("DAB") to the horn sub-assembly in the subject vehicles may have been installed with insufficient torque during assembly increasing the risk of air bag detachment from the steering wheel.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A detached frontal air bag could increase the risk of injury during a crash.

Description of the Cause : The DAB sub-assembly is assembled by the Tier II supplier. The assembly process was relocated to a manual assembly line in early 2016. The pneumatic tool used to install the bolts during the manual process did not have sufficient compressed air to apply the correct amount of torque.

Identification of Any Warning that can Occur : Noise from vibration of the DAB.

Involved Components :

Component Name 1 : Module Assembly, Steering Wheel Air Bag

Component Description : Driver-side frontal air bag module

Component Part Number : 56900-*****

Supplier Identification :

Component Manufacturer

Name : Autoliv

Address : NR

NR

Country : United States

Chronology :

Due to the character limitations of this web form, the requested chronology is being provided as Attachment A.

Description of Remedy :

Description of Remedy Program : Hyundai plans to notify owners to return their vehicles to a Hyundai dealer to have the torque for the DAB sub-assembly mounting bolts verified and, if necessary, retightened. The remedy procedure will be performed at no charge. Hyundai will provide reimbursement to owners for repairs according to the plan submitted on May 16, 2018.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Dealers and owners will be notified in late June 2020.

Planned Dealer Notification Date : JUN 26, 2020 - JUN 26, 2020

Planned Owner Notification Date : JUN 26, 2020 - JUN 26, 2020

* NR - Not Reported