

Part 573 Safety Recall Report

20V-405

Manufacturer Name : Jayco, Inc.

Submission Date : AUG 06, 2020

NHTSA Recall No. : 20V-405

Manufacturer Recall No. : 9903515



Manufacturer Information :

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 3,629

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2016-2018 Jayco Class C motorhome Greyhawk, Redhawk, Envoy 100 and 200

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style :

Power Train : NR

Descriptive Information : Scope noted for the TSBs previously released - production records noting motorhomes with hydraulic leveling system

2016-2018 Greyhawk

2016-2018 Redhawk

2018 Envoy 100 Series

2018 Envoy 200 Series

Production Dates : MAR 13, 2015 - JUN 30, 2017

VIN Range 1 : Begin :

NR

End : NR

☐ Not sequential

Description of Defect :

Description of the Defect : The mounting bracket for the leveling system hydraulic pump requires reinforcement.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Bracket failure may allow the pump and reservoir to come in contact with the ground with potential of either complete separation or the possibility of hydraulic fluid loss increasing the risk of a crash.

Description of the Cause : Change to new leveling system did not consider increase in height and weight.

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

Chronology :

Jayco released Technical Service Bulletin(TSB) 17-011 and 19-022 to address - Looking at current history, additional units affected by the TSBs reported that the pump and reservoir came in contact with the ground. Based on current facts, an increase of concern for safety warrants elevation the TSBs to a Recall status. Jayco and NHTSA met 7-9-20 via turbo meeting to discuss the previous TSBs with Jayco committing to proceed with filing a new recall replacing TSB 17-011 and 19-022

Description of Remedy :

Description of Remedy Program : Jayco dealer will add a support bracket to the existing support bracket - Same remedy as performed under TSB 17-011 and 19-022

How Remedy Component Differs NR
from Recalled Component :

Identify How/When Recall Condition NR
was Corrected in Production :

Recall Schedule :

Description of Recall Schedule : Jayco will release notification to current owner of affected units that were not repaired under the TSBs previously published.

Planned Dealer Notification Date : SEP 11, 2020 - SEP 11, 2020

Planned Owner Notification Date : SEP 11, 2020 - SEP 11, 2020

* NR - Not Reported