

Part 573 Safety Recall Report

20V-454

Manufacturer Name : Indian Motorcycle Company

Submission Date : AUG 04, 2020

NHTSA Recall No. : 20V-454

Manufacturer Recall No. : I-18-07



Manufacturer Information :

Manufacturer Name : Indian Motorcycle Company

Address : 2100 Highway 55
Medina MN 55340

Company phone : 999

Population :

Number of potentially involved : 2,742

Estimated percentage with defect : 4 %

Vehicle Information :

Vehicle 1 : 2019-2019 Indian Scout and Scout Bobber

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

Identification of Any Warning : The force required to activate the brake lever may decrease resulting in a lever that can Occur : that feels soft to the user.

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :**Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

Chronology :

On or about late February, 2019, Polaris issued a voluntary recall for certain MY19 Indian Scout and Scout Bobbers due to entrained air and supplier-left debris in the brake system. At that point, bulletin I-18-07 was amended to extend recall coverage to these remaining units. After receiving additional warranty claims on the remaining MY19 Scout and Scout Bobber units equipped with ABS, Polaris has decided to voluntarily recall the remaining MY19 units.

Description of Remedy :

Description of Remedy Program : Dealers will update the affected population by conducting a fluid bleed of the front and rear ABS brake system resulting in the evacuation of air. If you have had this procedure performed before you received this letter, you may be eligible to receive reimbursement for the cost of obtaining a pre-notification remedy of the problem associated with this recall. For more information regarding obtaining reimbursement please contact the Polaris Consumer Service Department using the contact information above.

How Remedy Component Differs : The brake system components meet all quality standards and will not be

from Recalled Component : replaced. The brake fluid within the brake system will be replaced through a standard bleed process to evacuate any remaining air from the system.

Identify How/When Recall Condition was Corrected in Production : All motorcycles within inventory control were placed on hold and manually bled to evacuate any air from the brake system. The brake system assembly process was corrected in order to ensure all air has been evacuated. In addition, Polaris has made hardware improvements to address assembly process effectiveness.

Recall Schedule :

Description of Recall Schedule : Indian will contact dealers and known consumers within 60 days of approval.

Planned Dealer Notification Date : AUG 06, 2020 - AUG 06, 2020

Planned Owner Notification Date : NR - NR

* NR - Not Reported