

# Part 573 Safety Recall Report

# 20V-520

**Manufacturer Name :** Hyundai Motor America**Submission Date :** AUG 27, 2020**NHTSA Recall No. :** 20V-520**Manufacturer Recall No. :** 194**Manufacturer Information :**

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

**Population :**

Number of potentially involved : 151,205

Estimated percentage with defect : 1 %

**Vehicle Information :**

Vehicle 1 : 2013-2015 Hyundai Santa Fe Sport

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

**Descriptive Information :** The subject vehicles include certain model year 2013-2015 Hyundai Santa Fe Sport vehicles produced between June 17, 2013 and May 13, 2015 by Kia Motor Manufacturing Georgia ("KMMG") for sale in the U.S. market.

Production Dates : JUN 17, 2013 - MAY 13, 2015

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

**Description of the Defect :** The subject vehicles are equipped with Anti-lock Brake System ("ABS") modules that could leak brake fluid internally and cause an electrical short over time.

FMVSS 1 : NR

FMVSS 2 : NR

**Description of the Safety Risk :** An electrical short in the ABS module could increase the risk of an engine compartment fire.

**Description of the Cause :** Due to possible quality control deviation with the supplier's manufacturing process, the piston seals in the ABS module's hydraulic valve unit could leak brake fluid into the electronic control unit ("ECU").

**Identification of Any Warning that can Occur :**

1. Smoke from the engine compartment.
2. Burning/melting odor.
3. Illumination of the MIL and/or ABS light.

**Involved Components :**

Component Name 1 : ABS Assembly

Component Description : NR

Component Part Number : 58920-\*\*\*\*\*

**Supplier Identification :****Component Manufacturer**

Name : Mando America Corp

Address : 4201 Northpark Dr

Opelika ALABAMA 36801

Country : United States

**Chronology :**

Please see Attachment A for the requested chronology.

**Description of Remedy :**

Description of Remedy Program : All owners of the subject vehicles will be notified by first class mail with instructions to bring their vehicles to a Hyundai dealer for inspection of the ABS module and, if necessary, replacement with a new one. The remedy procedure will be performed at no charge. Hyundai will provide reimbursement to owners for repairs according to the plan submitted on May 16, 2018.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : The ABS module was changed beginning with production of model year 2017 vehicles.

**Recall Schedule :**

Description of Recall Schedule : Notifications for dealers and owners will begin in October 2020.

Planned Dealer Notification Date : OCT 23, 2020 - OCT 23, 2020

Planned Owner Notification Date : OCT 23, 2020 - OCT 23, 2020

\* NR - Not Reported