

Part 573 Safety Recall Report

20V-531

Manufacturer Name : Gulf Stream Coach, Inc.

Submission Date : SEP 02, 2020

NHTSA Recall No. : 20V-531

Manufacturer Recall No. : 08282020



Manufacturer Information :

Manufacturer Name : Gulf Stream Coach, Inc.

Address : P. O. Box 1005
503 S. Oakland Avenue Nappanee IN
46550

Company phone : 999-999-9999

Population :

Number of potentially involved : 32

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2020-2020 ENLIGHTEN 25BH, 248BH

Vehicle Type :

Body Style :

Power Train : NR

Descriptive Information : On certain model 25BH and 248BH Enlighten Travel Trailers manufactured by Gulf Stream Coach, Inc. ("GulfStream") the "lower front trim strip" (Front Strip) may be missing from the refrigerator. The (Front Strip) is required to be installed to make the refrigerator cabinet seal complete, and provides complete isolation of the combustion system from the travel trailer interior.

Production Dates : JUL 02, 2020 - JUL 16, 2020

VIN Range 1 : Begin : 1NL1G2729M3043429 **End :** 1NL1G2727M3043445 ☐ Not sequential

Description of Defect :

Description of the Defect : On certain model 25BH and 248BH Enlighten Travel Trailers manufactured by Gulf Stream Coach, Inc. ("GulfStream") the "lower front trim strip" (Front Strip) may be missing from the refrigerator. The (Front Strip) is required to be installed to make the refrigerator cabinet seal complete, and provides complete isolation of the combustion system from the travel trailer interior.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : An Increased risk of carbon monoxide or flammable unburned Liquid Petroleum (LP) gases may migrate into the living quarters of the travel trailer if the refrigerator compartment is not properly sealed. Failure to provide adequate seals to the refrigerator compartment thus isolating the refrigerator compartment from the living area of the travel trailer may increase the risk of fire, or carbon monoxide poisoning causing injury or death to occupants and/

or damage to property.

Description of the Cause : NR

Identification of Any Warning NONE
that can Occur :

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

Gulf Stream Coach became aware of this missing (Front Strip) during a dealer pre delivery inspection. Through our internal problem solving protocol, the determination was made that a personnel change on the assembly line, responsible for installing the refrigerator was not properly trained and had failed to complete the refrigerator installation as prescribed in the installation manual provided with the refrigerator. Upon further review of available units still in our possession, the (Front Strip) had not been removed from the back of the refrigerator where it is temporarily secured as a loose part and part of the original refrigerator packaging from our supplier.

Description of Remedy :

Description of Remedy Program : All identified travel trailers subject to this Recall will be required to be inspected and verified for proper seal at the bottom of the refrigerator cabinet by installing the (Front Strip) in accordance to the work instructions which will be provided to the selling dealer or repair facility of the owner's preference for completing this Recall.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Gulf Stream Coach, Inc. has the utmost urgency in our recalls. The defect notification, to be sent to the vehicles listed dealer and/or the current owner as soon as NHTSA provides any correction(s) and an Acknowledgement Letter.

Planned Dealer Notification Date : SEP 14, 2020 - SEP 16, 2020

Planned Owner Notification Date : SEP 16, 2020 - SEP 18, 2020

* NR - Not Reported