

# Part 573 Safety Recall Report

# 20V-639

**Manufacturer Name :** General Motors LLC**Submission Date :** OCT 15, 2020**NHTSA Recall No. :** 20V-639**Manufacturer Recall No. :** N202314760**Manufacturer Information :****Population :**

Manufacturer Name : General Motors LLC

Number of potentially involved : 2,781

Address : 29427 Louis Chevrolet Road  
MAIL CODE 480-210-2V WARREN MI  
48093

Estimated percentage with defect : 5 %

Company phone : 586-596-1733

**Vehicle Information :**

Vehicle 1 : 2020-2020 Buick Enclave

Vehicle Type :

Body Style :

Power Train : NR

**Descriptive Information :** Trace data and manufacturing records were used to identify vehicles that may have received a fuel tank with a suspect fuel pump module. Vehicles that received parts produced outside of the supplier's suspect window are not included in this recall.

246 Buick Enclave vehicles are affected by this recall.

Production Dates : NOV 19, 2019 - DEC 05, 2019

VIN Range 1 : Begin : NR End : NR

 Not sequential

Vehicle 2 : 2020-2020 Cadillac XT5

Vehicle Type :

Body Style :

Power Train : NR

**Descriptive Information :** Trace data and manufacturing records were used to identify vehicles that may have received a fuel tank with a suspect fuel pump module. Vehicles that received parts produced outside of the supplier's suspect window are not included in this recall.

543 Cadillac XT5 vehicles are affected by this recall.

Production Dates : NOV 20, 2019 - JAN 03, 2020

VIN Range 1 : Begin : NR End : NR

 Not sequential

Vehicle 3 : 2020-2020 Cadillac XT6

Vehicle Type :

Body Style :

Power Train : NR

**Descriptive Information :** Trace data and manufacturing records were used to identify vehicles that may have received a fuel tank with a suspect fuel pump module. Vehicles that received parts produced outside of the supplier's suspect window are not included in this recall. 243 Cadillac XT6 vehicles are affected by this recall.

**Production Dates :** NOV 20, 2019 - JAN 03, 2020

**VIN Range 1 : Begin :** NR **End :** NR  Not sequential

Vehicle 4 : 2020-2020 Chevrolet Traverse

Vehicle Type :

Body Style :

Power Train : NR

**Descriptive Information :** Trace data and manufacturing records were used to identify vehicles that may have received a fuel tank with a suspect fuel pump module. Vehicles that received parts produced outside of the supplier's suspect window are not included in this recall. 1,024 Chevrolet Traverse vehicles are affected by this recall.

**Production Dates :** NOV 19, 2019 - DEC 05, 2019

**VIN Range 1 : Begin :** NR **End :** NR  Not sequential

Vehicle 5 : 2020-2020 GMC Acadia

Vehicle Type :

Body Style :

Power Train : NR

**Descriptive Information :** Trace data and manufacturing records were used to identify vehicles that may have received a fuel tank with a suspect fuel pump module. Vehicles that received parts produced outside of the supplier's suspect window are not included in this recall. 725 GMC Acadia vehicles are affected by this recall.

**Production Dates :** NOV 20, 2019 - JAN 09, 2020

**VIN Range 1 : Begin :** NR **End :** NR  Not sequential

**Description of Defect :**

Description of the Defect : General Motors has decided that a defect which relates to motor vehicle safety exists in certain 2020 model year Buick Enclave, Cadillac XT5, Cadillac XT6, Chevrolet Traverse, and GMC Acadia vehicles. The fuel pump assemblies in these vehicles may have been produced with burrs inside the mixing tube that could prevent the transfer of fuel from the secondary side of the fuel tank to the primary side, which could obstruct fuel flow to the engine. At low fuel levels, the engine may not receive adequate fuel and the vehicle may unexpectedly stall.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : A vehicle stall without warning could increase the risk of a crash, especially at high speeds.

Description of the Cause : The fuel pump was produced with burrs inside the mixing tube.

Identification of Any Warning that can Occur : NR

**Involved Components :**

Component Name 1 : MODULE - F/TNK F/PMP

Component Description : Fuel-Tank Fuel-Pump Module

Component Part Number : 84702674

**Supplier Identification :****Component Manufacturer**

Name : Vitesco Technologies

Address : Hornos No. 5024

Parque Industrial Juarez Juarez, Chihuahua FOREIGN STATES 32360

Country : Mexico

**Chronology :**

See supplemental document

## Description of Remedy :

Description of Remedy Program : Dealers will replace the fuel pump module. Pursuant to 49 C.F.R. § 573.13(d)(1), all covered vehicles are under warranty, so reimbursement is not offered.

How Remedy Component Differs from Recalled Component : Replacement parts were produced outside of the supplier's suspect window.

Identify How/When Recall Condition was Corrected in Production : Fuel-tank trace data was used to identify specific builds that received fuel tanks with suspect fuel-pump modules.

## Recall Schedule :

Description of Recall Schedule : Dealers will be notified on October 15, 2020. Customer notification is estimated to begin on November 30, 2020.

Planned Dealer Notification Date : OCT 15, 2020 - OCT 15, 2020

Planned Owner Notification Date : NOV 30, 2020 - NOV 30, 2020

\* NR - Not Reported