

Part 573 Safety Recall Report**20V-667****Manufacturer Name :** Jayco, Inc.**Submission Date :** DEC 29, 2020**NHTSA Recall No. :** 20V-667**Manufacturer Recall No. :** 9903527**Manufacturer Information :**

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 1,058

Estimated percentage with defect : 100 %

Vehicle Information :Vehicle 1 : 2020-2021 Class A Motorhome Alante,Emblem,Vision, Vision XL,Precept, Precept
Prestige

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style :

Power Train : NR

Descriptive Information : Production records noting first units scheduled with the added insulation material to units that received on line

2020 Alante L1AF0088-0108 AS0120-0137 AU0130-0144

2021 Alante M1AF4051-4096 AS4051-4103 AU4051-4118, 9000 AV4051-4084
AX4051-4079

2020 Precept L1UG0241-0260 UL0205-0231

2021 Precept M1UA4051-4086,9000-9001 UB9000-9011 UG4051-7172,9025,
UL4051-4140,9000-9021 UV4051-4070,90002021 Precept Prestige M1DH4051-4072, 9000-9002 DT4051-4060
DU4051-4060,9002-9003

2020 Vision L1AF8088-8097 AS8098-8113 AU8087-8099

2021 Vision M1AF8051-8105 AS8051-8117, 9000 AU8051-8092,9001
AV8051-8064

2021 Emblem M1DH8051-8078, 9003 DT8051-8060 DU8051-8065, 9000,9001

2021 Vision XLM1UA8051-8088 UB8051-8078,9012 UG8051-8127, 9000-9024

Production Dates : MAR 03, 2020 - AUG 04, 2020

VIN Range 1 : Begin :

NR

End : NR

 Not sequential**Description of Defect :**

Description of the Defect : Engine covers installed on some F-53 chassis did not contain appropriate insulation.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Under certain operation conditions, and wo the insulation material the interior surface temperatures could exceed desirable levels, exposing occupants to unreasonable risk of injury

Description of the Cause : Engineering change notice filed on 7-1-20 changed the engine cover configuration to add insulation material for the 2021 MY. A delay in tooling needed for the formed insulation materials caused some of the first 2021 units to have no insulation material.

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

8-24-20 Incident filed to report engine cover hot to the touch - Elevated to CPAC for research

9-2 CPAC continued research with Engineering and Operations

9-10 Request for testing by R&D submitted -

11-24 Edit - adding number of affected units with serial numbers

9-24- SSC reviewed situation and asked that additional testing / research be conducted prior to their decision how to proceed - testing continued through 10-2

10-22 SSC reviewed all details again and testing then agreed that a safety recall is required

Description of Remedy :

Description of Remedy Program : Jayco Dealer will remove and disable the engine cover to allow the addition of the insulation insert - reassemble engine cover and install foam seal on the outer edge.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : All units produced after 8-4-20 contain the insulation insert.

Recall Schedule :

Description of Recall Schedule : Jayco will release upon receipt of parts

Planned Dealer Notification Date : DEC 18, 2020 - DEC 18, 2020

Planned Owner Notification Date : DEC 18, 2020 - DEC 18, 2020

* NR - Not Reported