



David J. Johnson  
 Director  
 Service Engineering Operations  
 Ford Customer Service Division

Ford Motor Company  
 P. O. Box 1904  
 Dearborn, Michigan 48121

December 17, 2020

**TO:** All U.S. Ford and Lincoln Dealers

**SUBJECT:** **Safety Recall 20S31 – Supplement #1**  
 Certain 2014-2017 Model Year F-150 Vehicles Equipped with 3.5L Ecoboost Engines  
 Brake Master Cylinder Replacement

**REF:** **Safety Recall 20S31**  
 Dated: October 6, 2020

**New! REASON FOR THIS SUPPLEMENT**

- **Parts List Update:**
  - *A new brake booster part number has been added for 2015-2016 model year.*
  - *The 2017 brake booster part number has been separated out.*
  - *The brake master cylinder part number for 2014 model year has been superseded.*

**AFFECTED VEHICLES**

Vehicle	Model Year	Assembly Plant	Build Dates
F-150	2015-2017	Dearborn	October 1, 2014 through August 1, 2016
	2014-2017	Kansas City	September 1, 2014 through August 1, 2016

Affected vehicles are identified in OASIS and FSA VIN Lists.

**REASON FOR THIS SAFETY RECALL**

In some of the affected vehicles, a seal in the rear of the brake master cylinder may become compromised, allowing brake fluid to leak into the brake booster. If the brake fluid reservoir is depleted below a predetermined level, the driver will be alerted in multiple ways that brake system service is required.

If the brake fluid reservoir continues to be depleted, the driver may experience a change in brake pedal travel and feel, and reduced brake function in the front wheels without affecting brake function in the rear wheels. Reduced brake function in the front wheels can extend stopping distance, increasing the risk of a crash.

**SERVICE ACTION**

Dealers are to replace the brake master cylinder. If indications of a leak are present between the brake master cylinder and brake booster, dealers are also to replace the brake booster. This service must be performed on all affected vehicles at no charge to the vehicle owner.

**OWNER NOTIFICATION MAILING SCHEDULE**

Owner letters were mailed the week of June 29, 2020 informing customers that parts were not available in sufficient quantities to repair all vehicles.

Follow-up letters informing owners that parts are now available for their vehicles began mailing the week of October 26, 2020. Dealers should repair any affected vehicles that arrive at their dealerships, whether or not the customer has received a letter.

**PLEASE NOTE:**

Federal law requires dealers to complete this recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to \$21,000 per vehicle. Correct all vehicles in your new vehicle inventory before delivery.

**New! ATTACHMENTS**

Attachment I: Administrative Information

*Attachment II: Labor Allowances and Parts Ordering Information*

Attachment III: Technical Information

 
Owner Notification Letters

Recall Reimbursement Plan

**QUESTIONS & ASSISTANCE**

For questions and assistance, contact the Special Service Support Center (SSSC) via the SSSC Web Contact Site. The SSSC Web Contact Site can be accessed through the Professional Technician Society (PTS) website using the SSSC link listed at the bottom of the OASIS VIN report screen or listed under the SSSC tab.

Sincerely,



David J. Johnson

**Safety Recall 20S31 – Supplement #1**  
Certain 2014-2017 Model Year F-150 Vehicles Equipped with 3.5L EcoBoost Engines  
Brake Master Cylinder Replacement

**OASIS ACTIVATION**

OASIS was activated on June 9, 2020.

**FSA VIN LISTS ACTIVATION**

FSA VIN Lists were available through <https://web.fsavinlists.dealerconnection.com> on June 9, 2020. Owner names and addresses were available on November 10, 2020.

**NOTE:** Your FSA VIN Lists may contain owner names and addresses obtained from motor vehicle registration records. The use of such motor vehicle registration data for any purpose other than in connection with this recall is a violation of law in several states, provinces, and countries. Accordingly, you must limit the use of this listing to the follow-up necessary to complete this recall.

**SOLD VEHICLES**

- Ford has not issued instructions to stop selling/delivering or driving used vehicles under this safety recall. Owners should contact their dealer for an appointment to have their vehicles remedied as soon as practicable. Owners can continue to safely drive their vehicles.
- Immediately contact any of your affected customers whose vehicles are not on your VIN list but are identified in OASIS. Give the customer a copy of the Owner Notification Letter (when available) and schedule a service date.
- Correct other affected vehicles identified in OASIS which are brought to your dealership.
- Dealers are to prioritize repairs of customer vehicles over repairs of new and used vehicle inventory.

**STOCK VEHICLES**

Use OASIS to identify any affected vehicles in your used vehicle inventory.

**DEALER-OPERATED RENTAL VEHICLES**

The Fixing America's Surface Transportation (FAST) Act law effective June 2016 prohibits a rental company from selling, renting or leasing vehicles subject to a safety or compliance recall. Please consult your legal counsel for legal advice.

**TITLE BRANDED / SALVAGED VEHICLES**

Affected title branded and salvaged vehicles are eligible for this recall.

**OWNER REFUNDS**

- **This safety recall must still be performed, even if the owner has paid for a previous repair. Claiming a refund will not close the recall on the vehicle.**
- Ford Motor Company is offering a refund for owner-paid repairs covered by this recall if the repair was performed prior to the date indicated in the reimbursement plan, which is posted with this bulletin. Owners are directed to seek reimbursement through authorized dealers or, at their option, directly through Ford Motor Company at P.O. Box 6251, Dearborn, MI 48121-6251.
- Dealers are also pre-approved to refund owner-paid emergency repairs that were performed away from an authorized servicing dealer after the end date specified in the reimbursement plan. Non-covered repairs, or those judged by Ford to be excessive, will not be reimbursed.
- Refunds will only be provided for the cost associated with brake master cylinder and brake booster replacement.

**Safety Recall 20S31 – Supplement #1**  
Certain 2014-2017 Model Year F-150 Vehicles Equipped with 3.5L EcoBoost Engines  
Brake Master Cylinder Replacement

**RENTAL VEHICLES**

Rental vehicles are not approved for this program.

**ADDITIONAL REPAIR (LABOR TIME AND/OR PARTS)**

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For related damage and access time requirements, refer to the Warranty and Policy Manual / Section 6 – Ford & Lincoln Program Policies / General Information & Special Circumstances for FSA's / Related Damage.
- For vehicles within new vehicle bumper-to-bumper warranty coverage, no SSSC approval is required, although related damage must be on a separate repair line with the "Related Damage" radio button checked.
  - Ford vehicles – 3 years or 36,000 miles
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, submit an Approval Request to the SSSC Web Contact Site prior to completing the repair.

**CLAIMS PREPARATION AND SUBMISSION**

- **Claim Entry:** Enter claims using Dealer Management System (DMS) or One Warranty Solution (OWS) online.
  - When entering claims, select claim type 31: Field Service Action. The FSA number 20S31 is the sub code.
  - For additional claims preparation and submission information, refer to the Recall and Customer Satisfaction Program (CSP) Repairs in the OWS User Guide.
- **Related Damage/Additional labor and/or parts:** Must be claimed as Related Damage on a separate repair line from the FSA with same claim type and sub code as described in Claim Entry above.

**IMPORTANT:** Click the Related Damage Indicator radio button.

- **Refunds:** Submit refunds on a separate repair line.
  - Program Code: 20S31
  - Misc. Expense: ADMIN
  - Misc. Expense: REFUND
  - Misc. Expense: 0.2 Hrs.
  - Multiple refunds should be submitted on one repair line and the invoice details for each repair should be detailed in the comments section of the claim.

**Safety Recall 20S31 – Supplement #1**

Certain 2014-2017 Model Year F-150 Vehicles Equipped with 3.5L EcoBoost Engines  
Brake Master Cylinder Replacement

**LABOR ALLOWANCES**

Description	Labor Operation	Labor Time
Replace master cylinder (includes bench bleed)	20S31B	0.9 Hours
Replace master cylinder and booster (includes bench bleed)	20S31C	1.4 Hours

**New! PARTS REQUIREMENTS / ORDERING INFORMATION****Brake master cylinder parts table -**

Find correct year and model and order only one (1) brake master cylinder. Follow table for ordering additional parts required for repair.

Year	Model	Part Number	Description	Order Quantity	Claim Quantity
2014 Only	ALL	<i>EL3Z-2140-E</i>	Brake Master Cylinder (includes O-ring)	1	1
2015-2017		JL3Z-2140-A	Brake Master Cylinder (includes O-ring)		
ALL		PM-20	Dot 4 Brake Fluid (3 required / 4 per sell pack)	1	3
NOTE: For 2014 MY, Ecat incorrectly shows the O-ring is not included with the master cylinder.			Master cylinder to booster O-ring	Included with new master cylinder	

**Brake booster parts table – Replace booster ONLY if the master cylinder is leaking at or into the booster. Refer to Attachment III before ordering a booster.**

Find correct year and model and order only one (1) brake booster *if the master cylinder is leaking*.

Year	Model	Part Number	Description	Order Quantity	Claim Quantity
2014 Only	ALL	DL3Z-2005-E	Brake Booster	1	1
<i>2015-2016</i>	<i>ALL</i>	<i>GL3Z-2005-H</i>			
<i>2017</i>	<i>All Less Raptor</i>	HL3Z-2005-G			
ALL	ALL	3M5Z-2L523-AA	Clevis Pin	1	1

Order the above parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

**SSSC Web Contact Site:**

To place an order for HL3Z-2005-F submit a VIN-specific Part Order contact via the SSSC Web Contact Site.

Year	Model	Part Number	Description	Order Quantity	Claim Quantity
2017	Raptor <b>ONLY</b>	HL3Z-2005-F	Brake Booster	1	1

**Safety Recall 20S31 – Supplement #1**

Certain 2014-2017 Model Year F-150 Vehicles Equipped with 3.5L Ecoboost Engines  
Brake Master Cylinder Replacement

**DEALER PRICE**

For latest prices, refer to DOES II.

**PARTS RETENTION AND RETURN**

Follow the provisions of the Warranty and Policy Manual, Section 1 - WARRANTY PARTS RETENTION AND RETURN POLICIES. If a replaced part receives a scrap disposition, the part must be scrapped in accordance with all applicable local, state and federal environmental protection and hazardous material regulations. Federal law prohibits selling motor vehicle parts or components that are under safety, compliance, or emissions recall.

**EXCESS STOCK RETURN**

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

## CERTAIN 2014-2017 MODEL YEAR F-150 VEHICLES — BRAKE MASTER CYLINDER REPLACEMENT

### SERVICE PROCEDURE

1. Position the vehicle on a hoist. Please follow the Workshop Manual (WSM) procedures in Section 100-02.
2. Remove the master cylinder. Please follow the WSM procedures in Section 206-06.
3. Inspect the rear of the master cylinder and the mounting surface of the brake booster.  
Are there signs of leaking brake fluid? Signs of leaking brake fluid may include fluid on the back of the master cylinder or on the mounting surface of the brake booster, and/or peeling paint on the brake booster. See Figure 1.

Yes - Replace the brake booster. Please follow the WSM procedures in Section 206-07, then proceed to Step 4.

No - Proceed to Step 4.

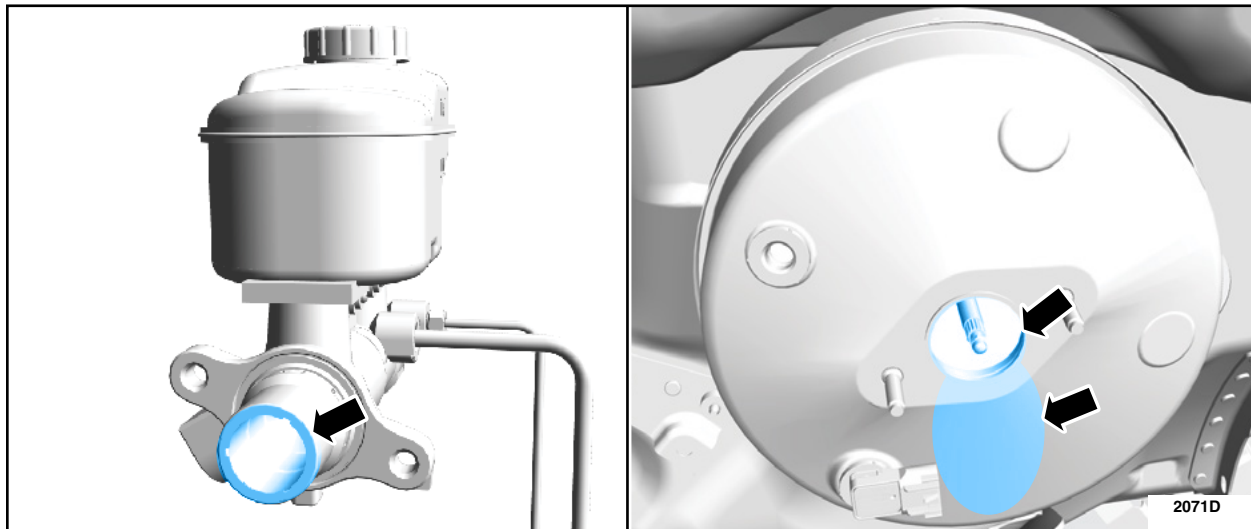


FIGURE 1

4. Install a *new* master cylinder. Please follow the WSM procedures in Section 206-06.

**IMPORTANT NOTE:** Federal law prohibits selling motor vehicle parts or components that are under safety, compliance, or emissions recall. Unless a part is requested to be returned to Ford, all parts replaced under this FSA must be scrapped in accordance with all applicable local, state and federal environmental protection and hazardous material regulations. Refer to the Parts Retention, Return, & Scrapping section of the FSA dealer bulletin for further information.



**Ford Motor Company**  
**Recall Reimbursement Plan for 20S31**

*Ford and Lincoln dealers are in the best position to quickly and efficiently process reimbursement requests. However, federal legislation requires all motor vehicle manufacturers to establish processes through which customers may seek recall reimbursement directly from the manufacturer or from the dealers.*

*Regarding the specific reimbursement plan for Recall # 20S31, owners who have paid for service to remedy the defect or noncompliance must have had that service performed prior to July 17, 2020. After this date, if repairs related to this recall are performed by a non-Ford repair facility in an emergency situation, customers must submit any refund requests through their dealership. As required by this federal regulation, Ford Motor Company submitted the details of its latest General Recall Reimbursement Plan in a letter to the National Highway Traffic Safety Administration (NHTSA) in February 2019. The following is the text of that letter and the Plan:*

**General Recall Reimbursement Plan**  
(As submitted to the NHTSA)

Pursuant to the requirements set forth in 49 CFR Part 573 and Part 577 of the Code of Federal Regulations, Ford Motor Company (Ford) is submitting required information pertaining to our general reimbursement plan for the cost of remedies paid for by vehicle owners before they are notified of a related safety recall.

Set forth below is Ford's general plan to reimburse owners and purchasers for costs incurred for remedies in advance of notification of potential safety-related defects or noncompliances pursuant to Part 573.6 (c)(8)(i). This plan has not changed since our February 20, 2019 submission.

**Reimbursement Notification**

Ford's notice to a vehicle owner in accordance with 49 CFR Part 577 will indicate that Ford is offering a refund if the owner paid to have service to remedy the defect or noncompliance prior to a specified ending date. In accordance with Part 573.13 (c)(2), this ending date will be defined as a minimum of ten calendar days after the date on which Ford mailed the last of its Part 577 notifications to owners, and will be indicated in the specific reimbursement plan available to owners for an individual recall. This notice will direct owners to seek eligible reimbursement through authorized dealers or, at their option, directly through Ford at the following address:

Ford Motor Company  
P.O. Box 6251  
Dearborn, MI 48121-6251

Ford notes that this rule allows for the identification of a beginning date for reimbursement eligibility. Under the rule, an owner who paid to remedy the defect or noncompliance prior to the identified beginning date would not be eligible for reimbursement. Ford generally has not established such a beginning date for reimbursement eligibility and does not presently anticipate changing this general policy. However, in any case where Ford determines a beginning date is appropriate, Ford will indicate that date in the owner notice. As permitted by 577.11(e), Ford may not include a reimbursement notification when all vehicles are well within the warranty period, subject to approval by the agency.



## **Costs to be Reimbursed**

For vehicles, reimbursement will not be less than the lesser of:

- The amount paid by the owner for the remedy that specifically addressed and was reasonably necessary to correct the defect or noncompliance that is the subject of the recall, or
- The cost of parts for the remedy (to be no more than the manufacturer's list retail price for authorized part(s), plus associated labor at local labor rates, miscellaneous fees (such as disposal of waste) and taxes.

For replacement equipment, reimbursement will be the amount paid by the owner for the replacement item (limited by the amount of the retail list price of the defective or noncompliant item that was replaced, plus taxes, where the brand or model purchased by the owner was different than the brand or model that was the subject of the recall). If the item of motor vehicle equipment was repaired, the reimbursement provisions identified above for vehicles will apply.

Ford notes that costs incurred by the owner within the period during which Ford's original or extended warranty would have provided for a free repair of the problem will not be eligible for reimbursement, as provided by Part 573.13 (d)(1).

### Entities Authorized to Provide Reimbursement

Ford will continue to use authorized dealers to reimburse owners under the specific reimbursement plans for a particular recall, and will encourage owners to pursue requests for reimbursement directly through dealers to expedite reimbursement. Ford will also provide a mailing address to which customers can, at their option, send requests for reimbursement directly to Ford, as previously noted. Requests for reimbursement sent directly to Ford may take up to 60 days to process. Whether the owner chooses to pursue reimbursement requests through a dealer or directly through Ford, the owner will be directed to submit the required documentation, upon which reimbursement eligibility will be determined.

## **Required Documentation**

The reimbursement determination will depend upon the information provided by the customer. Consistent with Part 573.13 (d)(4) the following information must be submitted:

- Claimant name and address
- Vehicle make, model, and model year
- Vehicle identification number (VIN) and, for replacement equipment, a description of such equipment or, for tires, the model, size and TIN (DOT code)
- Identification of the recall number (either the Ford recall number or the NHTSA recall number)
- Identification of the owner of the recalled vehicle at the time that the pre-notification remedy was obtained
- An original receipt for the pre-notification remedy that includes a breakdown of the amount for parts, labor, other costs and taxes, including costs for the replacement item. Where the receipt covers work other than to address the recall or noncompliance, Ford may require the claimant to separately identify costs that are eligible for reimbursement.
- If the remedy was obtained during the warranty period, documentation indicating that the warranty was not honored or the warranty repair did not correct the problem related to the recall.

Failure to submit all of the above information may result in denial of the reimbursement request.

## **Additional Information**

The Part 577 required owner notice will provide a toll-free telephone number through which specific information about the reimbursement plan can be requested from Ford. This general reimbursement plan will be incorporated into notifications pursuant to Part 573.6 by reference. Information specific to an individual recall also may be incorporated into the Part 573.6 notification.