



David J. Johnson
Director
Service Engineering Operations
Ford Customer Service Division

Ford Motor Company
P. O. Box 1904
Dearborn, Michigan 48121

August 24, 2020

TO: All U.S. Ford and Lincoln Dealers

**SUBJECT: NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Safety Recall 20S48**
Certain 2020 Model Year Aviator and Explorer
1st Row Seatback Subassembly Fastener Torque

AFFECTED VEHICLES

Vehicle	Model Year	Assembly Plant	Build Dates
Aviator	2020	Chicago Assembly	April 11, 2019 through July 30, 2020
Explorer	2020	Chicago Assembly	April 11, 2019 through June 4, 2020

Affected vehicles are identified in OASIS and FSA VIN Lists.

REASON FOR THIS SAFETY RECALL

In the affected vehicles, it may be possible that one or more of the front row seatback subassembly fasteners were not tightened to the proper torque during vehicle assembly. An improperly torqued seatback subassembly may affect the trajectory of the side air bag deployment and could prevent or delay the air bag cushion from positioning correctly, increasing the risk of injury during a crash.

SERVICE ACTION

Before demonstrating or delivering any new in-stock vehicles involved in this recall, dealers are to torque the fasteners on either the driver, front passenger or both seatback subassemblies.

The Service Manager is responsible to ensure that the repair procedure has been performed completely and properly and is required to sign off on the repair order. This service must be performed on all affected vehicles at no charge to the vehicle owner.

OWNER NOTIFICATION MAILING SCHEDULE

Owner letters are expected to be mailed the week of September 7, 2020. Dealers should repair any affected vehicles that arrive at their dealerships, whether or not the customer has received a letter.

PLEASE NOTE:

Federal law requires dealers to complete this recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to \$21,000 per vehicle. Correct all vehicles in your new vehicle inventory before delivery.

ATTACHMENTS

- Attachment I: Administrative Information
- Attachment II: Labor Allowances and Parts Ordering Information
- Attachment III: Technical Information
- Attachment IV: VIN List
- Owner Notification Letters

QUESTIONS & ASSISTANCE

For questions and assistance, contact the Special Service Support Center (SSSC) via the SSSC Web Contact Site. The SSSC Web Contact Site can be accessed through the Professional Technician Society (PTS) website using the SSSC link listed at the bottom of the OASIS VIN report screen or listed under the SSSC tab.

Sincerely,

David J. Johnson

**NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seatback Subassembly Fastener Torque

OASIS ACTIVATION

OASIS will be activated on August 24, 2020.

FSA VIN LISTS ACTIVATION

FSA VIN Lists will be available through <https://web.fsavinlists.dealerconnection.com> on August 24, 2020. Owner names and addresses will be available by September 9, 2020.

NOTE: Your FSA VIN Lists may contain owner names and addresses obtained from motor vehicle registration records. The use of such motor vehicle registration data for any purpose other than in connection with this recall is a violation of law in several states, provinces, and countries. Accordingly, you must limit the use of this listing to the follow-up necessary to complete this recall.

SOLD VEHICLES

- Ford has not issued instructions to stop selling/delivering or driving used vehicles under this safety recall. Owners should contact their dealer for an appointment to have their vehicles remedied as soon as practicable. Owners can continue to safely drive their vehicles.
- Immediately contact any of your affected customers whose vehicles are not on your VIN list but are identified in OASIS. Give the customer a copy of the Owner Notification Letter (when available) and schedule a service date.
- Correct other affected vehicles identified in OASIS which are brought to your dealership.
- Dealers are to prioritize repairs of customer vehicles over repairs of new and used vehicle inventory.

STOCK VEHICLES

- Correct all affected units in your new vehicle inventory before delivery.
- Use OASIS to identify any affected vehicles in your used vehicle inventory.

DEALER-OPERATED RENTAL VEHICLES

The Fixing America's Surface Transportation (FAST) Act law effective June 2016 prohibits a rental company from selling, renting or leasing vehicles subject to a safety or compliance recall. Please consult your legal counsel for legal advice.

TITLE BRANDED / SALVAGED VEHICLES

Affected title branded and salvaged vehicles are eligible for this recall.

OWNER REFUNDS

Refunds are not approved for this program.

RENTAL VEHICLES

Rental vehicles are not approved for this program.

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Safety Recall 20S48

Certain 2020 Model Year Aviator and Explorer
1st Row Seatback Subassembly Fastener Torque

ADDITIONAL REPAIR (LABOR TIME AND/OR PARTS)

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For related damage and access time requirements, refer to the Warranty and Policy Manual / Section 6 – Ford & Lincoln Program Policies / General Information & Special Circumstances for FSA's / Related Damage.
- For vehicles within new vehicle bumper-to-bumper warranty coverage, no SSSC approval is required, although related damage must be on a separate repair line with the "Related Damage" radio button checked.
 - Ford vehicles – 3 years or 36,000 miles
 - Lincoln vehicles – 4 years or 50,000 miles
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, submit an Approval Request to the SSSC Web Contact Site prior to completing the repair.

CLAIMS PREPARATION AND SUBMISSION

- **Claim Entry:** Enter claims using Dealer Management System (DMS) or One Warranty Solution (OWS) online.
 - When entering claims, select claim type 31: Field Service Action. The FSA number 20S48 is the sub code.
 - For additional claims preparation and submission information, refer to the Recall and Customer Satisfaction Program (CSP) Repairs in the OWS User Guide.
- **Related Damage/Additional labor and/or parts:** Must be claimed as Related Damage on a separate repair line from the FSA with same claim type and sub code as described in Claim Entry above.

IMPORTANT: Click the Related Damage Indicator radio button.

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seatback Subassembly Fastener Torque

LABOR ALLOWANCES

Description	Labor Operation	Labor Time
Torque Both front row driver and passenger seatback fasteners	20S48B	0.5 Hours
Torque One front driver OR front passenger seatback fasteners	20S48C	0.3 Hours

PARTS REQUIREMENTS / ORDERING INFORMATION**SSSC Web Contact Site:**

If any fasteners are found to be missing submit a VIN-specific Part Order contact via the SSSC Web Contact Site and send a picture to the SSSC if fastener is missing.

DEALER PRICE

For latest prices, refer to DOES II.

PARTS RETENTION AND RETURN

Follow the provisions of the Warranty and Policy Manual, Section 1 - WARRANTY PARTS RETENTION AND RETURN POLICIES.

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

CERTAIN 2020 MODEL YEAR AVIATOR AND EXPLORER VEHICLES — 1ST ROW SEAT BACK FASTENER TORQUE

SERVICE PROCEDURE

1. Refer to Attachment IV - Repair Table to determine the correct action and parts necessary. To search for a Vehicle Identification Number (VIN), click the search icon in the upper left corner of the Attachment IV, then type the VIN into the search field. See Figure 1.

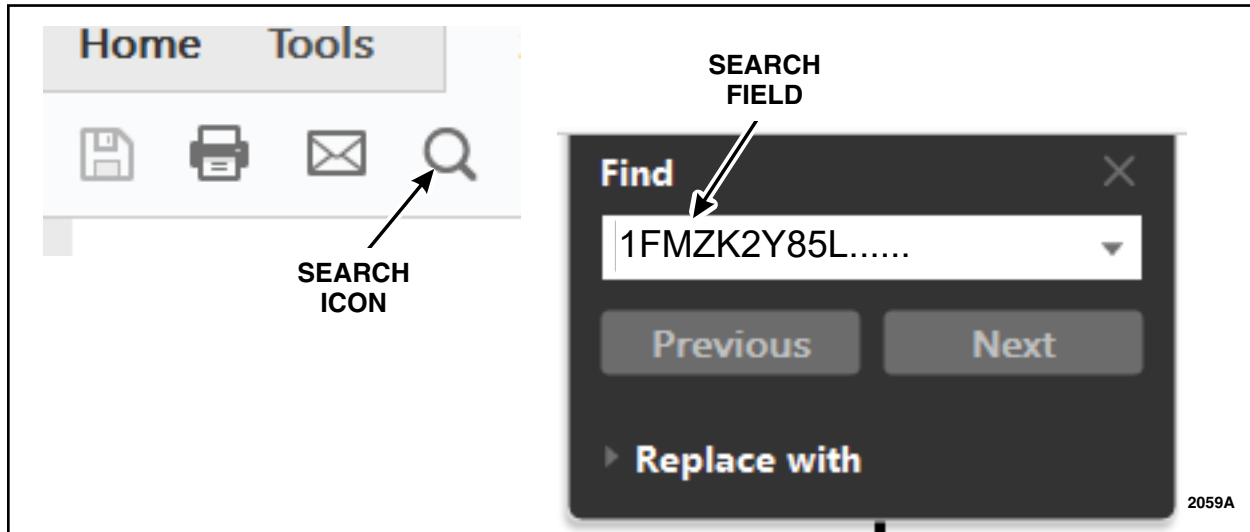


FIGURE 1

2. Is the VIN listed?

- No - This program does not apply to this vehicle.
- Yes - Proceed to Step 3.

3. Ensure the vehicle is on a flat level surface and apply the parking brake.

NOTE: This procedure is to be performed on the driver and/or passenger seats.

NOTE: Removal of the front seats is not required to complete this procedure.

4. Move the front seat forward and upward to the highest position for better access when performing this procedure.

5. Remove the front seat backrest panel. Please follow the Workshop Manual (WSM) procedures in Section 501-01A.

6. Torque the fasteners.

- For corresponding fasteners - See Figure 2.
- For Aviator - See Figure 3.
- For Explorer - See Figure 4.



NOTE: If any of the fasteners are missing they will need to be ordered, installed and torqued to specification.

NOTE: Each seat does not have all the same fasteners in the same locations, please review the figures carefully.

NOTE: Seats shown on bench for clarity.

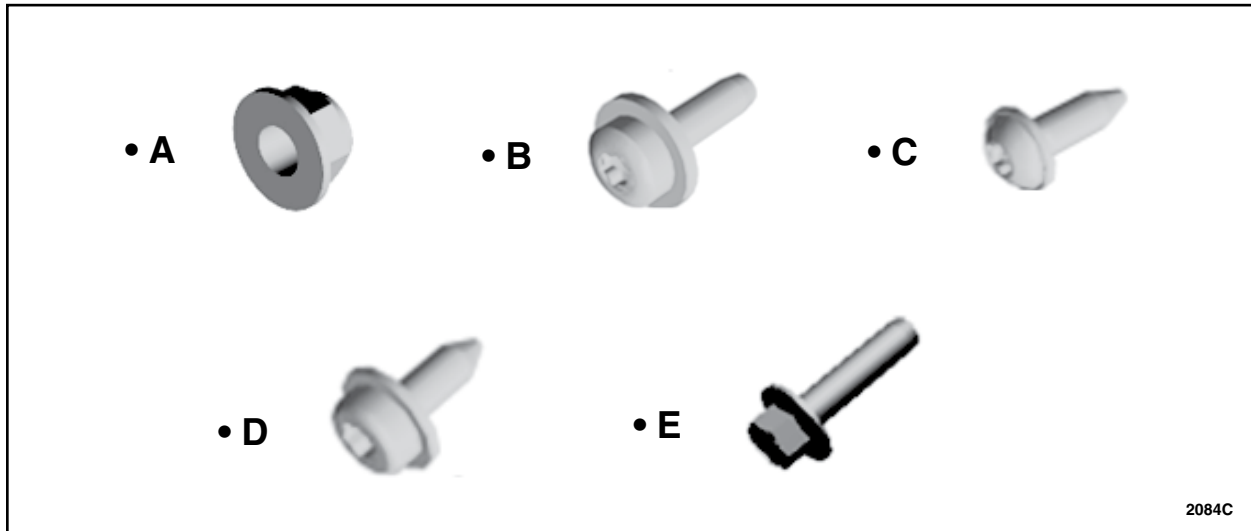


FIGURE 2

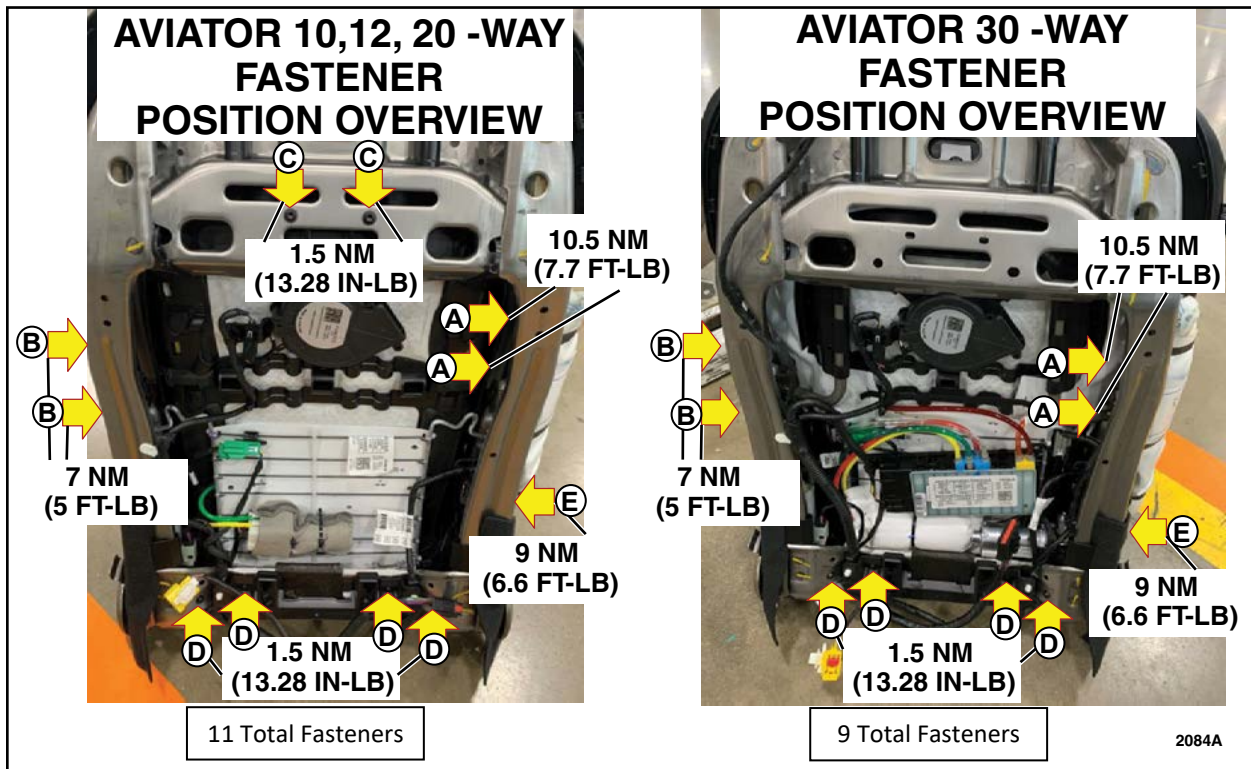


FIGURE 3



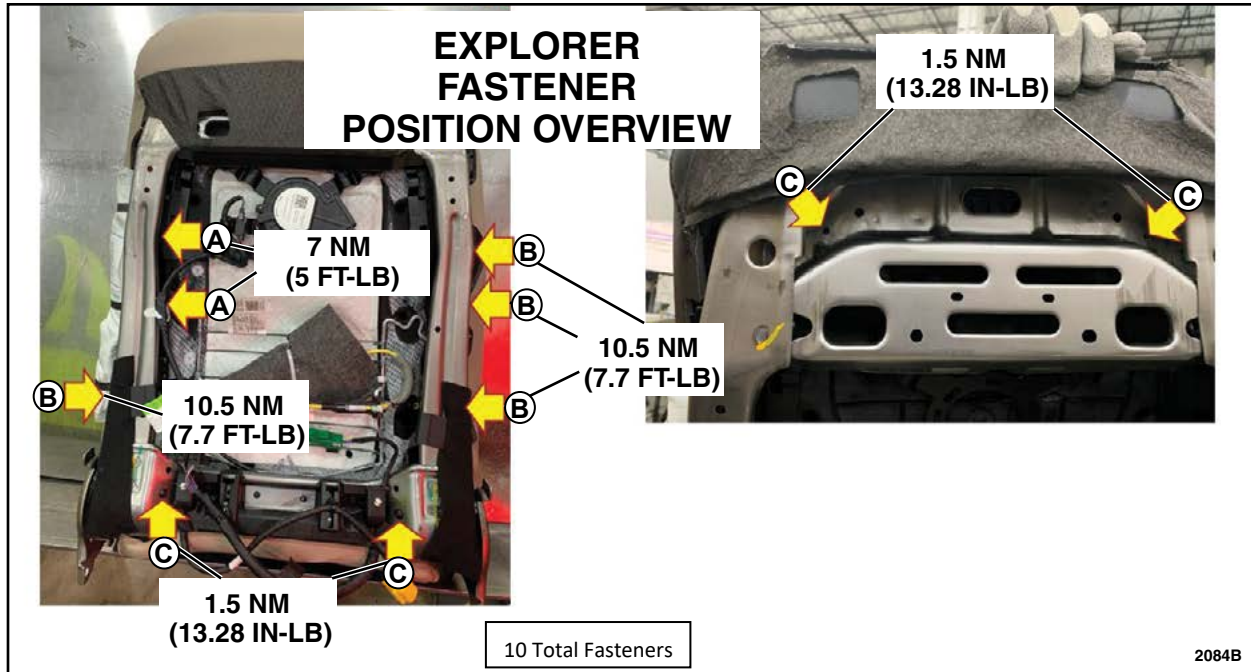


FIGURE 4

NOTE: The Service Manager is responsible to ensure that the repair procedure has been performed completely and properly and is required to sign off on the repair order.

7. Re-install the front seat backrest panel. Please follow the WSM procedures in Section 501-01A.
8. Return the front seat(s) to its original position.



**NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seat Back Subassembly Fastener Torque

AFFECTED VEHICLES

The following table contains a list of VINs and the affected seat back subassemblies that were delivered in the US and Canada.

To search for a VIN:

- Press the Ctrl key and the F key simultaneously, insert the VIN, and then press ENTER.
- Or use the Search Function (magnifier icon) in the Menu bar above.

VIN			Right/ Left/Both
1F	M5K8AC1LG	A00071	RH
1F	MSK8FH9LG	A00309	RH
1F	MSK8FH0LG	A00313	RH
1F	M5K8GCXLG	A00318	RH
1F	M5K8HC9LG	A00387	Both
1F	M5K8FW8LG	A00409	LH
1F	M5K8HC3LG	A00773	RH
1F	MSK7FH2LG	A02655	LH
1F	M5K8GC3LG	A03092	LH
1F	M5K8GC9LG	A03839	RH
1F	MSK7FH9LG	A04483	LH
1F	MSK8FH3LG	A06624	RH
1F	M5K8HC7LG	A06852	RH
1F	M5K8GC1LG	A06864	RH
1F	M5K8GC1LG	A07027	RH
1F	M5K8HC6LG	A07104	LH
1F	M5K8HCXLG	A07316	RH
1F	M5K8HC5LG	A07417	RH
1F	M5K8GC5LG	A07466	RH
1F	MSK8DH1LG	A08357	LH
1F	M5K8HC0LG	A09477	RH
1F	MSK7FH9LG	A10378	LH
1F	MSK7DH4LG	A10484	RH
1F	MSK8DH9LG	A13564	LH
1F	MSK7FH8LG	A14339	LH

VIN			Right/ Left/Both
1F	MSK7DH0LG	A15200	RH
1F	MSK7DH3LG	A15238	LH
1F	MSK8DH9LG	A15573	LH
1F	MSK7FHXLG	A16612	LH
1F	M5K8AB4LG	A18670	LH
1F	M5K8AB2LG	A19705	RH
1F	M5K8FW5LG	A20309	Both
1F	M5K8HC4LG	A24340	RH
1F	MSK8DH7LG	A26250	Both
1F	M5K8HC7LG	A27524	LH
1F	M5K8HC8LG	A29492	LH
1F	MSK7DH7LG	A30910	RH
1F	MSK8DH5LG	A31155	LH
1F	M5K8GC4LG	A32875	LH
1F	MSK7DH3LG	A33934	RH
1F	MSK7DH6LG	A34947	LH
1F	MSK8DH5LG	A36114	LH
1F	M5K8GCXLG	A36770	LH
1F	MSK7FH6LG	A40308	RH
1F	M5K8HC0LG	A40311	RH
1F	M5K8GC4LG	A40328	LH
1F	MSK8DH3LG	A42848	LH
1F	MSK8DH7LG	A43582	RH
1F	MSK8DH1LG	A43884	Both
1F	MSK8DH9LG	A47035	RH

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seat Back Subassembly Fastener Torque

	VIN		Right/ Left/Both
1F	M5K8GC4LG	A51037	Both
1F	M5K8GC5LG	A51094	RH
1F	MSK8FH3LG	A52406	LH
1F	MSK8FH9LG	A61210	LH
1F	M5K8HCXLG	A62834	RH
1F	MSK8DH3LG	A65563	Both
1F	MSK8FH5LG	A66100	Both
1F	M5K8AB4LG	A71871	LH
1F	M5K8GC4LG	A72034	RH
1F	MSK8FH1LG	A73447	Both
1F	MSK8FH7LG	A75798	Both
1F	MSK8DH8LG	A77529	LH
1F	MSK7DH0LG	A79723	LH
1F	M5K8GC3LG	A81470	RH
1F	MSK8FH4LG	A81607	LH
1F	M5K8HC4LG	A82562	Both
1F	M5K8AC3LG	A83390	LH
1F	M5K8AB4LG	A83485	LH
1F	M5K8AB6LG	A83486	RH
1F	M5K8AB8LG	A83487	Both
1F	M5K8GC6LG	A85254	LH
1F	MSK8DHXLG	A86944	Both
1F	MSK8FH0LG	A87002	LH
1F	MSK8FH9LG	A87032	Both
1F	M5K8GC7LG	A89300	Both
1F	M5K8HC3LG	A89714	RH
1F	M5K8GC2LG	A91133	RH
1F	MSK7DHXLG	A91569	RH
1F	MSK8DH6LG	A92112	RH
1F	M5K8GCXLG	A92420	RH
1F	MSK7DH7LG	A92727	LH
1F	MSK7FH0LG	A92744	Both
1F	M5K8GC8LG	A94358	LH

	VIN		Right/ Left/Both
1F	MSK8FH7LG	A94612	RH
1F	MSK7FH6LG	A94630	Both
1F	MSK8DH1LG	A94706	RH
1F	MSK8FH6LG	A96142	RH
1F	MSK8FH6LG	A96450	RH
1F	M5K8AC9LG	A96788	Both
1F	M5K8AB8LG	A96840	Both
1F	M5K8AW8LG	A97277	Both
1F	M5K8AB7LG	A97977	Both
1F	M5K8AB7LG	A98126	Both
1F	M5K8HC3LG	A98820	LH
1F	MSK8DH4LG	A99852	RH
1F	MSK7DHXLG	B04790	RH
1F	MSK8DH8LG	B05443	LH
1F	M5K8GC8LG	B06265	Both
1F	M5K8HC2LG	B06406	RH
1F	M5K8AW0LG	B07624	LH
1F	M5K8AWXLG	B07663	Both
1F	MSK8DH9LG	B08304	LH
1F	M5K8HC0LG	B08932	RH
1F	M5K8GC8LG	B09795	LH
1F	M5K8GC5LG	B09821	RH
1F	M5K8GC5LG	B11651	Both
1F	MSK7FH0LG	B12099	LH
1F	M5K8GC4LG	B12323	RH
1F	M5K8HC7LG	B15070	LH
1F	MSK8FH3LG	B15357	LH
1F	M5K8GC7LG	B15359	LH
1F	MSK8DH3LG	B17807	Both
1F	MSK7DH0LG	B22148	Both
1F	M5K8ACXLG	B22475	Both
1F	M5K8ABXLG	B22483	RH
1F	M5K8AB6LG	B23033	RH

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seat Back Subassembly Fastener Torque

	VIN		Right/ Left/Both
1F	M5K8AB6LG	B23128	RH
1F	M5K8AB9LG	B23141	RH
1F	M5K8AB1LG	B23196	RH
1F	M5K8AB8LG	B23311	RH
1F	M5K8AC7LG	B23776	Both
1F	M5K8AW7LG	B23867	Both
1F	M5K8FW8LG	B24373	Both
1F	M5K8GC6LG	B26854	RH
1F	MSK7FH6LG	B28629	Both
1F	M5K8AC2LG	B30683	Both
1F	MSK8FH6LG	B31553	LH
1F	MSK8DH2LG	B32119	RH
1F	MSK7DH0LG	B32680	LH
1F	M5K8GC0LG	B33489	Both
1F	MSK7DH7LG	B35480	LH
1F	MSK8FH8LG	B35717	RH
1F	M5K8GC7LG	B36390	LH
1F	M5K8GC5LG	B36422	RH
1F	M5K8GC4LG	B37500	RH
1F	M5K8GC6LG	B39720	RH
1F	MSK8DH2LG	B39958	LH
1F	MSK8FH3LG	B40436	RH
1F	MSK7DH0LG	B41105	RH
1F	M5K8HC3LG	B41181	RH
1F	MSK8FH4LG	B41515	LH
1F	MSK8FH7LG	B41587	LH
1F	M5K8GC9LG	B41753	Both
1F	MSK8DH4LG	B44658	Both
1F	MSK8DHXLG	B45040	LH
1F	M5K8GC9LG	B45205	Both
1F	MSK8DH1LG	B45279	Both
1F	MSK8DH7LG	B45285	LH
1F	MSK8FH3LG	B45412	RH

	VIN		Right/ Left/Both
1F	M5K8GCXLG	B46038	Both
1F	MSK7DH6LG	B46096	Both
1F	MSK7FH0LG	B46334	LH
1F	MSK7DH6LG	B46387	Both
1F	M5K8HC2LG	B46680	Both
1F	M5K8GCXLG	B46718	RH
1F	MSK8FH4LG	B46827	Both
1F	MSK7DH0LG	B47034	Both
1F	MSK7DH4LG	B47361	LH
1F	MSK8DHXLG	B48326	Both
1F	M5K8GC5LG	B48618	Both
1F	M5K8GC6LG	B48689	Both
1F	M5K8GC6LG	B48997	Both
1F	M5K8GC5LG	B49039	Both
1F	M5K8GC2LG	B49662	Both
1F	MSK8DH3LG	B50869	RH
1F	MSK7FH2LG	B51177	RH
1F	M5K8GC5LG	B51230	Both
1F	MSK7DH8LG	B51283	LH
1F	MSK7FH1LG	B51395	Both
1F	M5K8GC5LG	B52121	RH
1F	MSK7DH8LG	B52482	Both
1F	MSK8DH3LG	B53206	Both
1F	MSK8DH2LG	B53486	Both
1F	MSK7DHXLG	B54525	LH
1F	MSK7DH5LG	B54593	LH
1F	MSK7DH4LG	B54648	RH
1F	MSK8FH5LG	B54905	Both
1F	MSK8FH8LG	B54915	Both
1F	MSK8DH9LG	B55042	RH
1F	M5K8GC8LG	B55045	RH
1F	M5K8GCXLG	B55466	Both
1F	M5K8GCXLG	B55693	Both

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seat Back Subassembly Fastener Torque

	VIN		Right/ Left/Both
1F	MSK7FH5LG	B55904	Both
1F	M5K8HC2LG	B55914	Both
1F	MSK7FH6LG	B55992	Both
1F	M5K8GCXLG	B56312	Both
1F	MSK7DH7LG	B56314	Both
1F	MSK8DH4LG	B56972	Both
1F	MSK8FH6LG	B57344	Both
1F	MSK8DH6LG	B57427	Both
1F	M5K8GC5LG	B57481	Both
1F	M5K8GC9LG	B57516	Both
1F	MSK8FH0LG	B57551	Both
1F	MSK8DH2LG	B57876	LH
1F	MSK8DH6LG	B58108	Both
1F	M5K8HC1LG	B58352	Both
1F	MSK7DH9LG	B58484	Both
1F	MSK8FH0LG	B58733	RH
1F	MSK8FH9LG	B58925	Both
1F	MSK8FH7LG	B58955	Both
1F	MSK8DH2LG	B59157	Both
1F	MSK8DH8LG	B59437	Both
1F	M5K8GC3LG	B59522	Both
1F	MSK8DH1LG	B59537	Both
1F	MSK8DH6LG	B59632	Both
1F	MSK8DH5LG	B59766	Both
1F	MSK8DH0LG	B59948	Both
1F	M5K8GC8LG	B59970	Both
1F	M5K8GC7LG	B60205	Both
1F	M5K8GC6LG	B60387	Both
1F	M5K8GC6LG	B60566	Both
1F	MSK7FH0LG	B60749	RH
1F	MSK7DH4LG	B61048	Both
1F	MSK7DH1LG	B61170	Both
1F	MSK8DH4LG	B61296	Both

	VIN		Right/ Left/Both
1F	MSK8DH8LG	B61348	Both
1F	M5K8HC5LG	B61559	Both
1F	MSK8DH7LG	B61583	Both
1F	MSK8BH6LG	B61688	Both
1F	M5K8GC9LG	B61727	RH
1F	MSK8DH9LG	B62217	Both
1F	MSK8DH4LG	B62366	Both
1F	MSK8DH9LG	B62475	Both
1F	MSK8DH3LG	B62505	Both
1F	MSK8DH3LG	B62665	RH
1F	MSK8DH8LG	B62788	Both
1F	M5K8GC3LG	B62811	Both
1F	M5K8GC1LG	B63052	Both
1F	M5K8GC7LG	B63105	Both
1F	MSK8DH5LG	B63106	Both
1F	MSK8DH6LG	B63115	Both
1F	MSK8DH9LG	B63156	Both
1F	MSK7DH9LG	B63264	Both
1F	MSK8DH1LG	B63443	Both
1F	M5K8GC0LG	B63446	LH
1F	MSK8DH7LG	B63530	Both
1F	MSK7DH8LG	B63577	Both
1F	MSK7DH1LG	B63663	Both
1F	M5K8GC0LG	B63799	Both
1F	MSK8DH9LG	B63934	Both
1F	M5K8GC0LG	B64094	Both
1F	MSK8DH1LG	B64138	Both
1F	MSK8FH3LG	B64140	Both
1F	MSK7DH8LG	B64325	Both
1F	MSK7DHXLG	B64424	Both
1F	MSK8DH4LG	B64716	Both
1F	MSK8DH0LG	B64826	Both
1F	MSK8DH5LG	B64921	Both

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seat Back Subassembly Fastener Torque

	VIN		Right/ Left/Both
1F	MSK8FH4LG	B65037	Both
1F	MSK8DH6LG	B65124	Both
1F	MSK8DH4LG	B65154	Both
1F	MSK8DH7LG	B65309	Both
1F	MSK8FH8LG	B65364	Both
1F	M5K8GC9LG	B65468	Both
1F	MSK7FH3LG	B65492	Both
1F	MSK7FH5LG	B65591	Both
1F	MSK7FH4LG	B65601	Both
1F	M5K8ACXLG	B65679	RH
1F	MSK8DH9LG	B65702	Both
1F	MSK8FHXLG	B65785	Both
1F	MSK8FHXLG	B65799	Both
1F	M5K8AB3LG	B66096	RH
1F	M5K8AB4LG	B66365	RH
1F	M5K8AW3LG	B67056	Both
1F	MSK8DH8LG	B67098	Both
1F	M5K8AB8LG	B67115	RH
1F	M5K8AB2LG	B67160	RH
1F	M5K8AB6LG	B67212	RH
1F	M5K8AB3LG	B67216	RH
1F	M5K8AB7LG	B67218	RH
1F	M5K8AB8LG	B67308	RH
1F	MSK8BH1LG	B67348	Both
1F	M5K8AB2LG	B67384	RH
1F	M5K8AB1LG	B67389	RH
1F	M5K8AB3LG	B67720	RH
1F	M5K8AB9LG	B67754	RH
1F	M5K8AB8LG	B67809	RH
1F	M5K8ABXLG	B67858	RH
1F	M5K8ABXLG	B67861	RH
1F	M5K8AB0LG	B67867	RH
1F	M5K8AB5LG	B67962	RH

	VIN		Right/ Left/Both
1F	M5K8ABXLG	B67973	RH
1F	M5K8AB2LG	B67997	RH
1F	M5K8HC4LG	B69104	Both
1F	MSK8DHXLG	B69192	Both
1F	M5K8GC6LG	B69610	RH
1F	MSK8DH2LG	B69896	Both
1F	MSK8DH2LG	B69932	Both
1F	MSK7DHXLG	B71180	Both
1F	MSK7DH9LG	B71560	Both
1F	MSK8DH5LG	B71741	Both
1F	MSK8DH8LG	B72351	Both
1F	MSK7DH3LG	B73045	Both
1F	MSK8FHXLG	B73224	LH
1F	MSK7DH7LG	B73422	RH
1F	MSK7DH9LG	B73437	Both
1F	MSK7DH5LG	B73533	RH
1F	MSK8FHXLG	B74034	RH
1F	MSK8DHXLG	B74196	Both
1F	MSK8DH4LG	B75215	Both
1F	MSK8DH1LG	B75303	Both
1F	MSK8FH5LG	B75723	LH
1F	MSK7DH6LG	B76084	Both
1F	MSK8BH9LG	B76900	LH
1F	MSK8DH8LG	B76982	Both
1F	M5K8AB6LG	B77626	LH
1F	MSK8DHXLG	B81102	RH
1F	MSK8DHXLG	B82377	LH
1F	MSK7FHXLG	B82838	RH
1F	M5K8GC3LG	B83013	RH
1F	MSK8FH0LG	B83471	RH
1F	MSK8FH3LG	B83710	LH
1F	M5K8AB0LG	B83938	RH
1F	M5K8AB8LG	B83962	RH

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seat Back Subassembly Fastener Torque

VIN			Right/ Left/Both
1F	M5K8AB5LG	B83966	RH
1F	M5K8AB0LG	B83986	RH
1F	M5K8AB2LG	B83990	RH
1F	M5K8AB0LG	B84023	RH
1F	M5K8AB1LG	B84046	LH
1F	M5K8ABXLG	B84224	RH
1F	M5K8AW8LG	B84306	LH
1F	M5K8AB6LG	B84754	RH
1F	M5K8AB6LG	B84821	LH
1F	M5K8AB2LG	B84847	Both
1F	M5K8ABXLG	B84983	RH
1F	M5K8AW9LG	B85044	LH
1F	M5K8AB9LG	B85509	RH
1F	M5K8AB0LG	B85513	RH
1F	M5K8AB9LG	B85543	RH
1F	M5K8AB0LG	B85544	RH
1F	M5K8AB8LG	B85551	RH
1F	M5K8AB3LG	B85554	RH
1F	M5K8AB5LG	B85555	RH
1F	M5K8AB8LG	B85727	RH
1F	M5K8AB5LG	B85894	RH
1F	M5K8AB4LG	B86115	RH
1F	MSK8DH0LG	B90875	RH
1F	MSK7DH0LG	B93818	RH
1F	MSK8FHXLG	B95269	LH
1F	M5K8GC3LG	B97381	RH
1F	MSK7FH7LG	B97555	RH
1F	MSK8DH5LG	C00798	RH
1F	MSK8FH6LG	C03531	RH
1F	MSK8DH0LG	C08520	LH
1F	MSK8DH5LG	C09940	RH
1F	M5K8AB5LG	C14519	LH
1F	M5K8AW3LG	C15056	LH

VIN			Right/ Left/Both
1F	M5K8AW7LG	C15061	LH
1F	MSK8DH4LG	C18774	RH
1F	MSK8DH8LG	C21970	RH
1F	MSK8DH6LG	C24608	LH
1F	MSK8DH1LG	C25956	LH
1F	MSK8DH2LG	C26257	Both
1F	MSK7DH2LG	C27810	LH
1F	M5K8GC8LG	C30536	RH
1F	MSK7DH3LG	C41053	RH
5L	M5J7XC3LG	L00129	RH
5L	M5J7XC1LG	L00145	LH
5L	M5J9XC2LG	L00148	RH
5L	M5J7XC6LG	L00156	RH
5L	M5J7XC8LG	L00157	RH
5L	MYJ8XYXLG	L00627	RH
5L	M5J7XC7LG	L00747	RH
5L	M5J7XC5LG	L00763	RH
5L	M5J7XCXLG	L01150	LH
5L	M5J7XC2LG	L01367	RH
5L	M5J7XC8LG	L01499	RH
5L	M5J7XC0LG	L01514	Both
5L	M5J7WC7LG	L01849	LH
5L	M5J9XCXLG	L02102	LH
5L	M5J9XC9LG	L02267	RH
5L	M5J7XC5LG	L02285	Both
5L	M5J9XC2LG	L02319	LH
5L	M5J7XC2LG	L02552	RH
5L	M5J9XC4LG	L02578	LH
5L	M5J7WC0LG	L03068	RH
5L	M5J7WC8LG	L03075	Both
5L	M5J7XC5LG	L03355	Both
5L	M5J9XC3LG	L03379	LH
5L	M5J9XC5LG	L03402	RH

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seat Back Subassembly Fastener Torque

VIN			Right/ Left/Both
5L	M5J7XC0LG	L03568	LH
5L	M5J7XC6LG	L03753	RH
5L	M5J9XC8LG	L03930	RH
5L	M5J7XC5LG	L03940	LH
5L	M5J7XC5LG	L04196	Both
5L	M5J7XCXLG	L04422	LH
5L	M5J7XC6LG	L04451	RH
5L	M5J7XC5LG	L04473	Both
5L	M5J9XCXLG	L04965	Both
5L	M5J7XC3LG	L05010	LH
5L	M5J7XC9LG	L05142	RH
5L	M5J7XC3LG	L05279	RH
5L	M5J7WC3LG	L05476	LH
5L	M5J7XC9LG	L05500	RH
5L	M5J7WC6LG	L05536	LH
5L	M5J7XC7LG	L05804	Both
5L	M5J7WC5LG	L05883	LH
5L	M5J8WC7LG	L06216	RH
5L	M5J8WC2LG	L06270	LH
5L	M5J7XC8LG	L06475	LH
5L	M5J9XC5LG	L06770	RH
5L	M5J7XC1LG	L06866	LH
5L	M5J7XC9LG	L07022	RH
5L	M5J7XC7LG	L07035	RH
5L	M5J8BC6LG	L07217	LH
5L	M5J8BC0LG	L07701	LH
5L	M5J8BCXLG	L07799	LH
5L	M5J7XC2LG	L08559	LH
5L	M5J7XC4LG	L08711	LH
5L	M5J7XC2LG	L08822	RH
5L	M5J7XC6LG	L09049	LH
5L	M5J7XC0LG	L09063	RH
5L	M5J7WC2LG	L09468	LH

VIN			Right/ Left/Both
5L	M5J7XC4LG	L09633	LH
5L	M5J8BCXLG	L09987	Both
5L	M5J7WC4LG	L11321	LH
5L	M5J9XC0LG	L11987	RH
5L	M5J7XC9LG	L12124	Both
5L	M5J7XC3LG	L12149	LH
5L	M5J7XC4LG	L12211	LH
5L	M5J9XC9LG	L12443	RH
5L	M5J9XC8LG	L12451	LH
5L	M5J7XC1LG	L12490	LH
5L	M5J7XC2LG	L12515	RH
5L	M5J7XC1LG	L13008	LH
5L	M5J7XC6LG	L14090	LH
5L	M5J7XC5LG	L14324	Both
5L	M5J7XC2LG	L14409	LH
5L	M5J7XC4LG	L14461	RH
5L	M5J9XC6LG	L15719	RH
5L	M5J9XC1LG	L15739	RH
5L	M5J9XC9LG	L15889	RH
5L	M5J7XCXLG	L16960	RH
5L	M5J7XC2LG	L17021	LH
5L	M5J9XC7LG	L17141	LH
5L	M5J9XC2LG	L17144	RH
5L	M5J7XCXLG	L17283	LH
5L	M5J9XC4LG	L17338	RH
5L	M5J7XC1LG	L17706	LH
5L	M5J7XC5LG	L17711	LH
5L	M5J7XC9LG	L17727	LH
5L	M5J7XC7LG	L18312	RH
5L	M5J7WC6LG	L18416	LH
5L	M5J7XCXLG	L18465	LH
5L	MYJ8XY9LG	L18570	LH
5L	M5J7WC0LG	L18573	LH

**NEW VEHICLE DEMONSTRATION / DELIVERY HOLD
Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seat Back Subassembly Fastener Torque

VIN			Right/ Left/Both
5L	MYJ9YY5LG	L18621	RH
5L	MYJ9YY4LG	L18626	LH
5L	M5J7XC7LG	L18732	LH
5L	MYJ9YY0LG	L18753	LH
5L	MYJ8XY5LG	L18789	RH
5L	MYJ9YY4LG	L18870	RH
5L	MYJ9YY4LG	L18979	RH
5L	M5J7WC9LG	L18992	LH
5L	M5J7XC2LG	L19030	LH
5L	M5J7XCXLG	L19051	LH
5L	M5J7XC1LG	L19147	LH
5L	MYJ8XY2LG	L19317	LH
5L	M5J7WC5LG	L19346	RH
5L	M5J7XC6LG	L19452	LH
5L	MYJ8XY9LG	L19542	LH
5L	M5J7XC1LG	L19570	LH
5L	MYJ9YY8LG	L19598	RH
5L	M5J9XC8LG	L19786	Both
5L	M5J9XC6LG	L19799	Both
5L	M5J9XC2LG	L19833	LH
5L	M5J7XC4LG	L20051	RH
5L	M5J7XC4LG	L20180	Both
5L	M5J7XC9LG	L20191	RH
5L	M5J7XC1LG	L20329	Both
5L	M5J7WC5LG	L20416	LH
5L	M5J7XC9LG	L20515	RH
5L	M5J7XCXLG	L20569	RH
5L	M5J7XC7LG	L20657	LH
5L	M5J7XC7LG	L20822	RH
5L	M5J7XC6LG	L20892	LH
5L	M5J7WC8LG	L20975	LH
5L	M5J7WC2LG	L21006	RH
5L	M5J7WC2LG	L21023	LH

VIN			Right/ Left/Both
5L	MYJ8XY8LG	L21055	LH
5L	M5J9XC8LG	L21151	LH
5L	M5J7XC3LG	L21269	RH
5L	M5J7XCXLG	L21480	RH
5L	M5J7XC3LG	L21532	Both
5L	M5J7XC2LG	L21571	LH
5L	M5J7XC4LG	L21815	RH
5L	M5J7WC0LG	L21957	LH
5L	M5J7WC6LG	L21963	LH
5L	M5J6WC8LG	L22073	LH
5L	M5J7XC1LG	L22095	LH
5L	M5J7WC6LG	L22143	Both
5L	M5J7XC2LG	L22249	Both
5L	M5J7XC7LG	L22389	LH
5L	M5J7XCXLG	L22550	Both
5L	M5J7XC8LG	L22644	LH
5L	M5J7XC3LG	L22857	LH
5L	M5J9XCXLG	L23130	RH
5L	M5J7XC8LG	L23194	Both
5L	M5J7XC4LG	L23290	LH
5L	M5J7WC1LG	L23460	LH
5L	M5J7WC5LG	L23655	LH
5L	M5J7XC8LG	L23681	Both
5L	M5J6XC0LG	L23734	LH
5L	M5J7XC9LG	L23737	LH
5L	M5J9XC1LG	L24246	RH
5L	M5J9XC1LG	L24439	RH
5L	MYJ9YY5LG	L24600	LH
5L	M5J7XC0LG	L24825	RH
5L	M5J6WC8LG	L24874	RH
5L	M5J7XC8LG	L24913	Both
5L	M5J6XC0LG	L24950	LH
5L	M5J6WC5LG	L25125	LH

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD**Safety Recall 20S48**

Certain 2020 Model Year Aviator and Explorer
1st Row Seat Back Subassembly Fastener Torque

VIN			Right/ Left/Both
5L	M5J7XC9LG	L25343	RH
5L	M5J7XC5LG	L25548	LH
5L	M5J7XC1LG	L25966	RH
5L	M5J7XC5LG	L26263	LH
5L	M5J7XC1LG	L26325	Both
5L	M5J7XC1LG	L26387	Both
5L	M5J7WC6LG	L26418	Both
5L	M5J7XC5LG	L26523	RH
5L	M5J7XC5LG	L26618	Both
5L	M5J7XC2LG	L26723	LH
5L	M5J9XC3LG	L26726	RH
5L	M5J7WC8LG	L26825	LH
5L	M5J7XC4LG	L26948	Both
5L	M5J7WC7LG	L27108	Both
5L	M5J9XC8LG	L27144	RH
5L	M5J7XC5LG	L27168	LH
5L	M5J9XC0LG	L27266	RH
5L	M5J7XC0LG	L27319	LH
5L	M5J9XC6LG	L27353	RH
5L	M5J9XC4LG	L27559	LH
5L	M5J7WC2LG	L27906	LH
5L	M5J9XC7LG	L27913	RH
5L	M5J9XC9LG	L28044	RH
5L	M5J7XCXLG	L28154	RH
5L	M5J9XC1LG	L28233	RH
5L	M5J7XC0LG	L28518	RH
5L	M5J9XC8LG	L28536	LH
5L	M5J7WC5LG	L29049	RH
5L	M5J9XC9LG	L29159	LH
5L	M5J7XC3LG	L29243	Both
5L	M5J9XC7LG	L29418	RH
5L	M5J7XC2LG	L29427	RH
5L	M5J7WC0LG	L29489	Both

VIN			Right/ Left/Both
5L	M5J7XC0LG	L29541	Both
5L	M5J6WC7LG	L29659	RH
5L	M5J9XC2LG	L29679	RH
5L	M5J9XC5LG	L29773	LH
5L	M5J9XC2LG	L29780	LH
5L	M5J9XC4LG	L29991	LH
5L	M5J7XC9LG	L31224	RH
5L	M5J7XC7LG	L31660	RH
WF	02K8GY6LG	A66223	Both
WF	02K8GY9LG	B24633	RH
WF	02K8HY5LG	B58311	LH
WF	02K8HY7LG	B58312	LH
WF	02K8HY5LG	B58325	LH
WF	02K8HY5LG	C11413	RH