



Mercedes-Benz

Campaign No. 2020020023, March 2020  
Version A

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Models Various**  
**Model years 2018-2019****Oil Feed Line Turbocharger**

Mercedes-Benz AG ("MBAG"), the manufacturer of Mercedes-Benz vehicles, has determined that on certain MY 2018-2019 E-Class (213 platform), G-Class (463 platform), S-Class (222 platform), S-Class Coupe and Convertible(217 platform), and GT-Class 4-door Coupe (290 platform) vehicles equipped with 4.0L 8-cylinder gasoline-engines (M177), the material of the oil feed line to the turbochargers might not meet current production specifications. Due to thermal loading while driving, the oil feed line might exhibit selective leakage. If leaked oil contacts hot components in the engine compartment the risk of fire cannot be ruled out. An authorized Mercedes-Benz dealer will replace the oil feed line to the turbocharger on the affected vehicles.

Prior to performing this Recall Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired. Always Check VMI for any open campaigns, and perform accordingly.
- **VMI must always be checked before performing campaigns to verify that the campaign is required on a specific vehicle. Always check for any other open campaigns, and perform accordingly.**
- Please review the entire Recall Campaign bulletin and follow the repair procedure exactly as described.

Please note that Recall Campaigns **do not expire** and may also be performed on a vehicle with a vehicle status indicator.

 
Approximately 2518 vehicles are involved.

Order No. P-RC-2020020023

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

## Work procedure

1. Replace exhaust gas turbocharger oil circuit feed line (**AR09.40-P-6040\***).

 \* Select the WIS document according to the vehicle model.

<b>213</b>	<b>ar09.40-P-6040mne</b>
463	ar09.40-p-6040xga
253	ar09.40-p-6040mng
217,222	ar09.40-p-6040mnl
167	ar09.40-p-6040mno
290	ar09.40-p-6040mni

## Primary Parts Information

Qty.	Part Name	Part Number
1	Feed line	A 177 090 85 01

## Warranty Information

**Operation:** Replace oil feed line for exhaust gas turbocharger (02-1454)

Damage Code	Operation Number	Labor Time (hrs.)
09 931 02 7	02-1454	1.6

## Note

Operation Number labor times are subject to change.