

TOPIC	TYPE	RECALL CODE	QUESTION	ANSWER								
Safety Recall 47P8	Safety Recall	47P8	What vehicles are included in Safety Recall 47P8?	<table border="1"> <thead> <tr> <th>Country</th> <th>Beginning Model Year</th> <th>Ending Model Year</th> <th>Vehicle</th> </tr> </thead> <tbody> <tr> <td>USA</td> <td>2019</td> <td>2019</td> <td>ARTEON</td> </tr> </tbody> </table>	Country	Beginning Model Year	Ending Model Year	Vehicle	USA	2019	2019	ARTEON
				Country	Beginning Model Year	Ending Model Year	Vehicle					
USA	2019	2019	ARTEON									
Due to a possible manufacturing error, the electronic brake booster pressure input rod may not be correctly attached to the brake pedal. This may lead to a reduced pedal ratio and to an increased actuating force or to a disconnection of the pressure input rod. Additionally, in the event of a failure of the 12V power supply, the brake performance may be impaired due to the reduced pedal ratio and the resulting increased actuation force. An increased actuating force or a disconnected input rod may lead to abnormal brake behavior and may increase the risk for a crash.												
			What is the safety concern for Safety Recall 47P8?	To correct this defect, dealers will inspect and, if necessary, replace the electronic brake booster and mounting of the pressure rod OR the mounting of the pressure rod only, depending on the inspection results.								
			What is the repair for Safety Recall 47P8?	To remove the safety defect, dealers will inspect and, if necessary, replace the electronic brake booster and mounting of the pressure rod OR the mounting of the pressure rod only, depending on the inspection results. This repair can be scheduled now with an authorized Volkswagen dealer. To schedule an appointment, click here.								
			When will the repair for Safety Recall 47P8 be available?	Volkswagen will notify all affected owners via first-class mail to let them know the recall repair is available.								