



ALA5 Stop Sale – Preliminary check instructions

Cayenne (9YA), Cayenne Coupé (9YB) – MY 2020

Checking an ATF oil line at the Tiptronic transmission

Reason:


The vehicle may leak transmission fluid due to a possibly insufficient weld on a transmission oil pipe.

Remedial action:

Checking the production date of the ATF oil line.

Installation position:

(1) ATF oil line (**checking**)

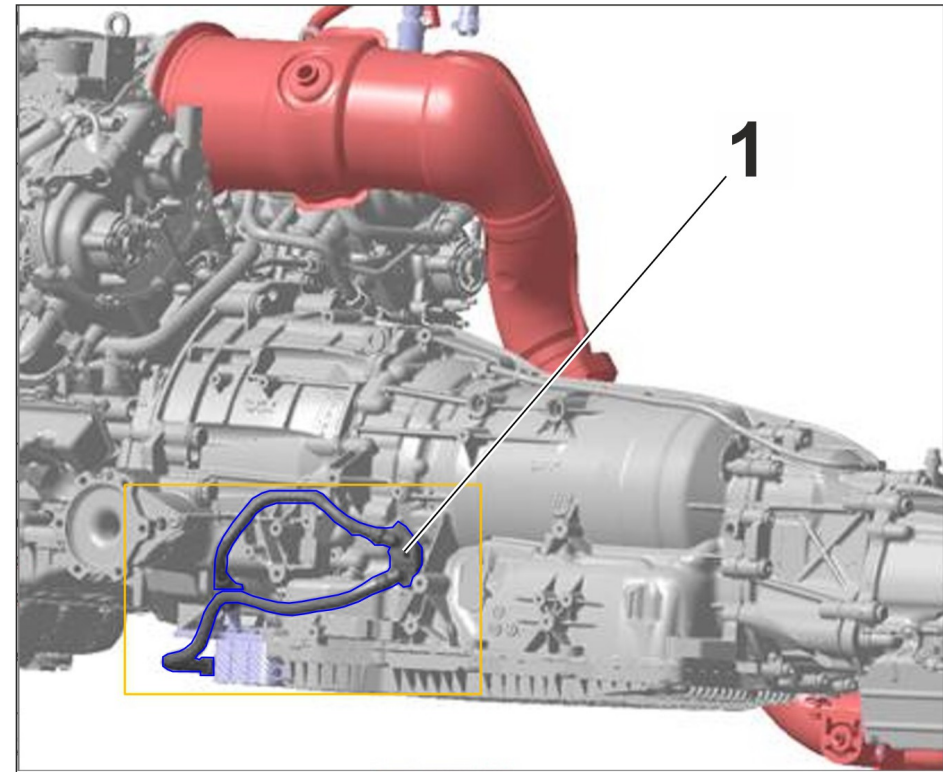

Required tools:

- Torque screwdriver 1,5 – 3 Nm (1-2 ftlb.), e.g. VAS 6494 Torque screwdriver
- Flashlight

Preliminary work

1. Move the vehicle onto a lifting platform and raise the vehicle.
⇒ **Workshop Manual 4X00IN Lifting the vehicle**


2. Remove rear and side section of the front underbody cover.
⇒ **Workshop Manual 519219 Removing and installing cover for front underbody**

Checking production date of ATF oil line

1. Check production date of the ATF oil line.

To do this, read out the **production calendar week** of the oil line from the **label attached to the line**.

- The production calendar week is **outside of the period** calendar week **36/2019 through 42/2019, inclusive**.
⇒ **The installed ATF oil line is not affected, proceed with chapter “Subsequent work“.**
- The production date of the oil line is **within calendar week 36/2019 through 42/2019, inclusive**.
⇒ **The welding of the ATF oil line is not correct.**
⇒ **The affected vehicle remains blocked until the publication of the remedial measure and must not be delivered to the customer.**
⇒ Complete the vehicle provisionally and remove it from the lifting platform.

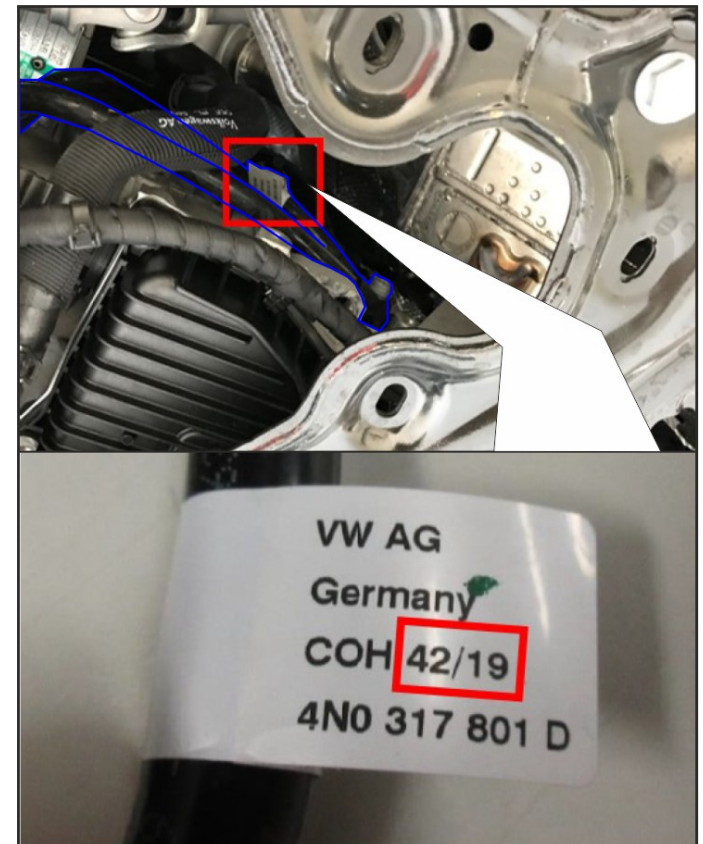

Subsequent work

1. Install rear and side section of the front underbody cover.
⇒ ***Workshop Manual 519219 Removing and installing cover for front underbody***

2. Lower the vehicle and remove it from the lifting platform.

End of measure

Do not enter the campaign in the Warranty and Maintenance booklet

Warranty processing

Scope 1: **Checking ATF oil line at the Tiptronic transmission – the ATF oil line was produced outside of the affected period only**

Working time:

Checking ATF oil line at the Tiptronic transmission

62 TU

Includes: Raising and lowering the vehicle

Removing and installing cover for front underbody, rear section

Removing and installing cover for front underbody, side section

Invoicing: Damage Code ALA5 99 000 1



Information

The **warranty processing** of the check for vehicles, where an **affected ATF oil line has been detected**, will be possible as scope 2 together with the **publication of the final remedial measure** at PCSS. **Do not claim work for these vehicles under scope 1.**