OMB Control No.: 2127-0004

Part 573 Safety Recall Report

21V-00H

Manufacturer Name: Daimler Trucks North America, LLC

Submission Date: APR 21, 2022 NHTSA Recall No.: 21V-00H Manufacturer Recall No.: FL917



Manufacturer Information:

Manufacturer Name: Daimler Trucks North America, LLC

Address: 4747 N. Channel Avenue

Portland OR 97217-3849

Company phone: 800-745-8000

Population:

Number of potentially involved: 24,869 Estimated percentage with defect: 1 %

Vehicle Information:

Vehicle 1: 2018-2018 Freightliner Custom Chass XBP

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Certain XB and XC FCCC Chassis receiving a certain PDM manufactured within the

suspect dates

including units from FL856.

Production Dates: NOV 23, 2015 - DEC 07, 2021

VIN Range 1 : Begin : NR End : NR Not sequential

Vehicle 2: 2017-2020 Freightliner Custom Chass XBR

Vehicle Type :
Body Style :
Power Train : NR

Descriptive Information: Certain XB and XC FCCC Chassis receiving a certain PDM manufactured within the

suspect dates

including units from FL856

Production Dates: APR 11, 2016 - NOV 12, 2019

Vehicle 3 : Vehicle Type :	: 2017-2022 Freightliner Custom Chass XBS						
Body Style :							
Power Train :							
Descriptive Information :	on: Certain XB and XC FCCC Chassis receiving a certain PDM manufactured within the						
	suspect dates including units from FL856.						
Production Dates:	: APR 20, 2016 - OCT 29, 2021						
VIN Range 1:		NR	End:	NR	☐ Not sequential		
viiv italige 1.	Degiii.	IVIC	Ellu .	IVIC	Not sequential		
Vehicle 4:	Vehicle 4: 2016-2019 Freightliner Custom Chass XCL						
Vehicle Type :							
Body Style :							
Power Train :	NR						
Descriptive Information :	: Certain XB and XC FCCC Chassis receiving a certain PDM manufactured within the						
	suspect dates						
	including units from FL856.						
Production Dates :	: MAR 03, 2016 - OCT 30, 2018						
VIN Range 1:	Begin:	NR	End:	NR	☐ Not sequential		
Vehicle 5: 2016-2022 Freightliner Custom Chass XCM							
Vehicle Type :							
Body Style :							
Power Train:							
		VC FCCC Chase	ic rocoiv	ing a cortair	DDM manufactured within the		
Descriptive information.	: Certain XB and XC FCCC Chassis receiving a certain PDM manufactured within the suspect dates						
	including units from FL856.						
Production Dates :	_						
VIN Range 1:		NR	End:	NR	☐ Not sequential		
Vahiala 6:	2017 2021 Ero	ightlingr Custo	n Chass	VCD			
Vehicle 6: 2017-2021 Freightliner Custom Chass XCP Vehicle Type:							
Body Style:							
Power Train :							
		VC ECCC Chass	ic rocoiv	ing a cortair	DDM manufactured within the		
Descriptive information.	Descriptive Information : Certain XB and XC FCCC Chassis receiving a certain PDM manufactured within the suspect dates including units from FL856.						
Production Dates :	· ·						
VIN Range 1:		NR	End:	NR	■ Not sequential		
-					_		

☐ Not sequential

Vehicle 7:	2016-2023 Freightliner Custom Chass XCR					
Vehicle Type :						
Body Style :						
Power Train:	NR					
Descriptive Information :	Certain XB and XC FCCC Chassis receiving a certain PDM manufactured within the suspect dates including units from FL856.					
Production Dates:	tes: DEC 07, 2015 - DEC 07, 2021					
VIN Range 1:	Begin: NR	End: NR	☐ Not sequential			
Vehicle 8: 2017-2023 Freightliner Custom Chass XCS Vehicle Type: Body Style:						
Power Train:	NR					
Descriptive Information :	Certain XB and XC FCCC Chassis receiving a certain PDM manufactured within the suspect dates including units from FL856.					
Production Dates :	MAR 23, 2016 - DEC 07, 2	2021				

Description of Defect:

Description of the Defect: This recall amends and supersedes existing recall FL-856 (NHTSA Campaign

No. 20V-404). On certain

FCCC XB and XC chassis, equipped with a certain rear mounted Power

End: NR

Distribution Module (PDM), a

NR

PDM unique to these chassis, may experience cracked internal solder joints,

which after a period of

vehicle use may lead to intermittent open circuits, in which the rear marker,

brake lights or left turn

signal lights may not function.

FMVSS 1: NR FMVSS 2: NR

VIN Range 1 : Begin :

Description of the Safety Risk: Brake lights not working correctly may not notify motorists of a braking

event, which may lead to an

increase crash risk.

Description of the Cause: NR

Identification of Any Warning Inoperative exterior lights can be detected during a pre-trip inspection.

that can Occur:

Involved Components:

Component Name 1: Power Distribution Module

Component Description : Power Distribution Module

Component Part Number: A66-05172-000

Component Name 2 : Power Distribution Module Component Description : Power Distribution Module

Component Part Number: A66-05172-001

Component Name 3 : Power Distribution Module Component Description : Power Distribution Module

Component Part Number: A66-05172-002

Component Name 4 : Power Distribution Module Component Description : Power Distribution Module

Component Part Number: A66-05172-004

Component Name 5 : Power Distribution Module Component Description : Power Distribution Module

Component Part Number: A66-05172-005

Component Name 6: Power Distribution Module Component Description: Power Distribution Module

Component Part Number: A66-05172-006

Component Name 7 : Power Distribution Module Component Description : Power Distribution Module

Component Part Number: A66-05172-007

Component Name 8: Power Distribution Module

Component Description : Power Distribution Module

Component Part Number: A66-05172-008

Component Name 9: Power Distribution Module

Component Description : Power Distribution Module

Component Part Number: A66-05172-009

Component Name 10: Power Distribution Module Component Description: Power Distribution Module

Component Part Number: A66-05172-010

Component Name 11: Power Distribution Module

Component Description: Power Distribution Module

Component Part Number: A66-05172-011

Component Name 12 : Power Distribution Module Component Description : Power Distribution Module

Component Part Number: A66-05172-012

Supplier Identification:

Component Manufacturer

Name: Sure Power Inc

Address: 10955 SW Avery Street

Tualatin Oregon 97062

Country: United States

Chronology:

This matter involves several related and overlapping recall campaigns. On June 18, 2020, NHTSA notified DTNA

of one vehicle owner questionnaire (VOQ) and two field complaints that may be related to a then open recall campaign, FL-788 (NHTSA Campaign No. 18V-852). Given the data and NHTSA's direction, DTNA opened an investigation to reevaluate the scope of that recall, which it did at an expedited pace. Out of an abundance of caution, to further promote safety, and following NHTSA's express instructions to the company, DTNA hastened to issue a recall, and did so on an expedited basis and before understanding the root cause, issuing a second recall campaign FL-856 (NHTSA Campaign No. 20V-404) in July 2020. In determining the population for this recall, DTNA used the supplier's best available information of end-dates, which it had no good faith reason to dispute. Those recall campaigns proceeded in accordance with applicable law, DTNA continued to monitor the matters, and DTNA and NHTSA continued their ongoing communication regarding the matters. Later, in July 2021, a dealer notified DTNA of a potential failed PDM in a vehicle built after DTNA reasonably believed the unknown production problem had been resolved. DTNA did not reasonably believe a safetyrelated issue was presented. Later, in September 2021 a second dealer reported an alleged PDM failure in a vehicle that had received the recall remedy in FL-856. Now presented with a alleged second incident, DTNA proactively began to investigate the matter afresh, including to determine if the incidents were from the same problem recurring, a different problem, or a mix, as well as ensuring the adequacy of the FL-856 remedy. Taking all reasonable, good faith efforts to understand the issue, DTNA recovered and analyzed failed PDMs in Fall 2021 as part of its investigation, albeit with the limited data and parts available. Chronology continued in PDF attachment.

Description of Remedy:

Description of Remedy Program: A secondary fused harness will be added which bypasses affected suspect

portion of the PDM and, based upon the information available at this time, is reasonably believed to resolve the issue. Repairs will be performed by Daimler Trucks North America authorized service facilities. Details of the

reimbursement plan will be included in the owner's notification letter.

How Remedy Component Differs NR

from Recalled Component:

Identify How/When Recall Condition NR

was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: Customer notification will be made by first class mail using Daimler

Trucks North America records to determine the customers affected.

Planned Dealer Notification Date: FEB 20, 2022 - FEB 20, 2022

Planned Owner Notification Date: FEB 20, 2022 - FEB 20, 2022

* NR - Not Reported