

Part 573 Safety Recall Report

21V-089

Manufacturer Name : BMW of North America, LLC

Submission Date : FEB 18, 2021

NHTSA Recall No. : 21V-089

Manufacturer Recall No. : NR



Manufacturer Information :

Manufacturer Name : BMW of North America, LLC

Address : P.O. Box 1227

Westwood NJ 07675-1227

Company phone : 18005257417

Population :

Number of potentially involved : 9

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2021-2021 BMW X5 sDrive40i, X5 xDrive40i

Vehicle Type : LIGHT VEHICLES

Body Style : SUV

Power Train : GAS

Descriptive Information : Approximately 9 vehicles have been assembled with a front right brake disc which may not have been assembled to specifications.

Basis for recall population determination: Vehicle assembly information was reviewed to determine the production dates of potentially affected vehicles.

Recall component difference to non-recall component: The front right brake disc may not have been assembled to specifications.

Production Dates : FEB 06, 2021 - FEB 10, 2021

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : This safety recall involves the front right brake disc. Out-of-specification fasteners may have been used during the brake disc assembly process.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Over time, if a front right brake disc became loose, it could affect vehicle handling and control, and increase the risk of a crash.

Description of the Cause : NR

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : Front Right Brake Disc

Component Description : Front Right Brake Disc

Component Part Number : 6860912-03

Supplier Identification :**Component Manufacturer**

Name : BMW AG vehicle sub-assembly plant

Address : NR

NR

Country : NR

Chronology :

On January 26, 2021, BMW was notified concerning a deviation that was detected by the supplier during brake disc production.

An engineering review was initiated. All potentially affected vehicle assembly plants were contacted.

The review indicated that some brake disc fasteners had been delivered into the supply chain which may not have been produced to specifications. Further reviews indicated that the out-of-specification fasteners may have been used during brake disc production.

Vehicle assembly information and supplier production records were reviewed to determine the number and production dates of potentially affected vehicles.

On February 10, 2021, BMW decided to conduct a voluntary recall.

BMW has not received any reports, nor is BMW otherwise aware, of any accidents or injuries related to this issue.

Description of Remedy :

Description of Remedy Program : The front right brake disc will be inspected and, if necessary, replaced, including the unaffected front left brake disc.

Owners will be notified by First Class mail and instructed to take their vehicles to an authorized BMW center to have the remedy performed for free. If this condition were to occur on a potentially affected vehicle prior to this recall, the remedy would be covered by the BMW New Vehicle Limited Warranty program. Therefore, reimbursement for a pre-notification remedy re Part 573.13 and Part 577.11 is not necessary.

How Remedy Component Differs from Recalled Component : Recalled Component: Front Right Brake Disc - p/n - 6860912-03

Identify How/When Recall Condition was Corrected in Production : NR

Recall Schedule :

Description of Recall Schedule : Notification to dealers is planned to begin and end on February 18, 2021. Notification to owners is planned to begin and end on April 12, 2021.

Planned Dealer Notification Date : FEB 18, 2021 - FEB 18, 2021

Planned Owner Notification Date : APR 12, 2021 - APR 12, 2021

* NR - Not Reported