OMB Control No.: 2127-0004

Part 573 Safety Recall Report

21V-116

Manufacturer Name: Black Series Campers Inc.

Submission Date: FEB 25, 2021 NHTSA Recall No.: 21V-116 Manufacturer Recall No.: NR



Manufacturer Information:

Manufacturer Name: Black Series Campers Inc.

Address: 19501 E Walnut dr s

City of Industry CA 91748

Company phone: 833-822-6737

Population:

Number of potentially involved : 412 Estimated percentage with defect : 80%

Vehicle Information:

Vehicle 1: 2020-2021 Black Series Camper C12, C13, C15, HQ12, HQ15, HQ17, HQ19, HQ19T,

HQ21, HQ22T

Vehicle Type: TRAILERS

Body Style: ALL Power Train: NR

Descriptive Information: Certain models have Curt part 52041 and 52044 breakaway kits with batteries that

can become depleted, which can lead to an overload on the main battery

Production Dates: OCT 01, 2020 - FEB 10, 2021

VIN Range 1: Begin: 4B9B1AB10KA165230 End: 4B9B1AD2XMA165616 ✓ Not sequential

Description of Defect:

Description of the Defect: When the emergency breakaway system pin is pulled and not replaced the

electrical circuit is closed. When the small breakaway battery (CURT) is depleted, the emergency brake system draws through the charger from the main battery. The total assumed draw is around 10amps - 12 amps. The charger is rated around 5amps. This causes an overload which could lead to a

fire.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: Increased risk of fire and/or property damage.

Description of the Cause: When the emergency breakaway pin/clip is pulled and is not replaced, the

small battery (CURT) continuously drains until it is depleted.

Identification of Any Warning Smoke or fire from the battery compartment.

that can Occur:

Involved Components:

Component Name 1: Curt Breakaway Kit

Component Description: NR

Component Part Number: 52041 & 52044

Supplier Identification:

Component Manufacturer

Name: CURT Manufacturing, LLC

Address: 6208 Industrial Drive

Eau Claire Wisconsin 54701

Country: United States

Chronology:

We first received a unit with burn damage on January 27, 2021 from a dealership. Upon visual inspection, it was determined that the burn was isolated to the components location. We have been conducting testing during the month of February to identify issue. New components are being tested. During the third week of February the issue was sent to the board to determine the next steps. On February the board determined

Description of Remedy:

Description of Remedy Program: Black Series Campers will supply the updated components. BSC will pay/

reimburse for the labor of the replacement and BSC will reimburse the value of the part and the labor if the component has been replaced.

How Remedy Component Differs The new component works and upon rigorous testing, no identifiable

from Recalled Component: issues were found.

Identify How/When Recall Condition NR

was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: Black Series will notify owner and dealers within 60 days of filing this

report.

Planned Dealer Notification Date: APR 10, 2021 - APR 16, 2021 Planned Owner Notification Date: APR 10, 2021 - APR 15, 2021

Part 573 Safety Recall Report	21V-116	Page 3
* NR - Not Reported		
•		
The information contained in this report was submitted	d pursuant to 49 CFR §573	