

# Part 573 Safety Recall Report

## 21V-180

**Manufacturer Name :** Jayco, Inc.

**Submission Date :** APR 27, 2021

**NHTSA Recall No. :** 21V-180

**Manufacturer Recall No. :** 9903565



### Manufacturer Information :

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

### Population :

Number of potentially involved : 29

Estimated percentage with defect : 100 %

### Vehicle Information :

Vehicle 1 : 2021-2021 Class A Motohome Embark Reatta

Vehicle Type : BUSES, MEDIUM & HEAVY VEHICLES

Body Style :

Power Train : NR

Descriptive Information : At the time discovered by Operations - 29 units were produced with 23 corrected on remises.. only 6 shipped to repair in filed under recall

Production Dates : JAN 01, 2021 - FEB 10, 2021

VIN Range 1 : Begin :

NR

End : NR

☐ Not sequential

### Description of Defect :

Description of the Defect : Routing of LP hose to the furnace is incorrect. LP hose may kink, restricting gas flow and could chaff on surrounding components.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : LP leak - increases risk of fire with personal and/or property damage

Description of the Cause : Line worker error

Identification of Any Warning NR  
that can Occur :

### Involved Components :

Component Name 1 : HOSE,LP

Component Description : 38IDX108.00 STY: H72625-108

Component Part Number : 0224316

Component Name 2 : Gas Manifold

Component Description : MANIFOLD,KIT EXT FURNACE ATWOOD MOD# AFMD3512

Component Part Number : 0337236

### Supplier Identification :

#### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

### Chronology :

Incident reported 2-17-21 from operations that LP line to furnace routing incorrect and error required repair in units shipped

CPAC reviewed incident 2-17 and recommend a TSB for 6 units shipped

3-3-2021 CPAC found through additional research, that the error may allow hose to kink, restricting gas flow and could chaff on surrounding components - creating a safety risk to occupant/s. - 3-3-21 CPAC recommended a safety recall and elevated to Safety Steering committee - 3-12-2021 SSC agreed Safety Recall required.

### Description of Remedy :

Description of Remedy Program : Remove existing LP line to furnace and discard. Install a new extended gas manifold

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : Error noted and corrected in Operations 2-10-2021

**Recall Schedule :**

Description of Recall Schedule : Jayco is prepared to release upon receipt of recall #

Planned Dealer Notification Date : APR 16, 2021 - APR 16, 2021

Planned Owner Notification Date : APR 16, 2021 - APR 16, 2021

\* NR - Not Reported