

# Part 573 Safety Recall Report

# 21V-272

**Manufacturer Name :** Airstream, Inc.

**Submission Date :** MAY 27, 2021

**NHTSA Recall No. :** 21V-272

**Manufacturer Recall No. :** NR



## Manufacturer Information :

**Manufacturer Name :** Airstream, Inc.

**Address :** 419 West Pike Street  
PO Box 629 Jackson Center OH  
45334-0629

**Company phone :** 937-596-6111

## Population :

**Number of potentially involved :** 180

**Estimated percentage with defect :** 100 %

## Vehicle Information :

**Vehicle 1 :** 2021-2021 Airstream Interstate 19

**Vehicle Type :** LIGHT VEHICLES

**Body Style :** UNKNOWN

**Power Train :** DIESEL

**Descriptive Information :** To determine the recall population we established that we began using the Sony radio at the start of MY 2021 affecting the model year 2021 Interstate 19 touring coaches.

**Production Dates :** MAY 15, 2020 - APR 19, 2021

**VIN Range 1 : Begin :** 1B9GUWA21MJ306010 **End :** 1B9GUWA2XMJ308872  Not sequential

## Description of Defect :

**Description of the Defect :** On 2021 Interstate touring coaches, the ceiling harness that interfaces with the radio uses a 14 AWG wire. The wire size in the body harness is 16 AWG, which is undersized for the 10 A circuit. In an overcurrent situation, the 16 AWG wire could melt and cause a fire.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** If there is an instance of overcurrent the 16 AWG wire could melt and potentially cause a fire resulting in personal injury and/or property damage. Airstream is not aware of any occurrences or injuries related to this condition.

**Description of the Cause :** Determined an error in the spec drawing used to to create the wiring harness.

**Identification of Any Warning that can Occur :** None

## Involved Components :

Component Name 1 : Circuit Breaker CB1

Component Description : Circuit Breaker

Component Part Number : 510947-15

## Supplier Identification :

### Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

## Chronology :

4/15/21 - Airstream learns about the radio wiring discrepancy during an audit. Investigation begins.

4/16/2021 - Safety committee meets and reviews all known data. Determines a recall is warranted.

## Description of Remedy :

Description of Remedy Program : Replace the 15 A resettable circuit breaker that supplies power to the radio through the 16 AWG body harness wire with an 8 A resettable breaker. Maximun normal radio power draw is 4.5 A.

How Remedy Component Differs from Recalled Component : There is not a distinguishable difference in the appearance of the breaker except for the label. The label will either indicate 15 A or 8 A rating. Any unit manufactured after 4/19/2021 would have the proper sized circuit breaker.

Identify How/When Recall Condition was Corrected in Production : The condition was corrected when production implemented Temporary Deviation TD-00193 process for the installation of the Sony radio Power circuit. Circuit design will change at Model Year in July.

## Recall Schedule :

Description of Recall Schedule : Airstream will send dealer and owner notification letters once approved by NHTSA.

Planned Dealer Notification Date : JUN 20, 2021 - JUN 20, 2021

Planned Owner Notification Date : JUN 20, 2021 - JUN 20, 2021

\* NR - Not Reported