OMB Control No.: 2127-0004

Part 573 Safety Recall Report

21V-323

Manufacturer Name: Spartan Fire, LLC Submission Date: JUN 23, 2021 NHTSA Recall No.: 21V-323



Manufacturer Information:

Manufacturer Name: Spartan Fire, LLC

Manufacturer Recall No.: 21009

Address: 1541 Reynolds Road

Charlotte MI 48813

Company phone: 517-588-4700

Population:

Number of potentially involved: 1,447 Estimated percentage with defect: 100 %

Vehicle Information:

Vehicle 1: 2017-2020 Spartan Fire Gladiator and MetroStar

Vehicle Type: BUSES, MEDIUM & HEAVY VEHICLES

Body Style : OTHER Power Train : DIESEL

Descriptive Information: This recall is based on information supplied by Cummins. Cummins provided a list of

engine serial numbers and spartan part numbers that may be affected. Spartan cross referenced the Cummins supplied list with Spartan part number build populations. The emergency response cab chassis affected by this recall are equipped with certain

L9 and ISX12 engines supplied by Cummins.

Production Dates: JAN 02, 2017 - OCT 16, 2020

VIN Range 1 : Begin : NR End : NR Not sequential

Description of Defect:

Description of the Defect: The fuel rail assembly may develop leaks, which may result in an undetected

prolonged diesel fuel spray.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: A leak involving spraying/misting fuel in the presence of an ignition source

may increase the risk of fire.

Description of the Cause: The rail end sealing bores in the fuel rail may have undersized pilot bores for

the sealing washer, thus preventing the washer from properly seating,

potentially resulting in inadequate load for the joint to remain properly sealed

in service.

Identification of Any Warning The operator may see or smell diesel fuel. In some cases, the check engine lamp

that can Occur: may illuminate.

Involved Components:

Component Name 1: Engine

Component Description: Diesel Engine

Component Part Number: See descriptive information

Supplier Identification:

Component Manufacturer

Name: Cummins, Inc

Address: 301 Washington Street

Box 3005, Mail Code 91630 Columbus Indiana 47202

Country: United States

Chronology:

On April 30, 2021, Spartan Fire received communication from Cummins about recall 21E-032 for their L9 and ISX12 engines. On May 4, 2021, it was agreed that Spartan Fire should file a Part 573.

Description of Remedy:

Description of Remedy Program: Cummins has stated that they are developing a remedy plan and will

communicate it as soon as it is available.

How Remedy Component Differs N/A

from Recalled Component:

Identify How/When Recall Condition Cummins has stated that the rail manufacturing statistical process control was Corrected in Production: for the pilot bores was confirmed in control after October 19, 2020. Cummins has requested that their Customer Quality Assurance division should be contacted for any engines/vehicles that are still in Spartan Fire's inventory to arrange for repairs, as necessary. Spartan reviewed inventory on April 30, 2021 and did not find any affected engines from Cummins

serial number list.

Recall Schedule:

Description of Recall Schedule: Spartan to begin owner notifications by week of June 28, 2021.

Planned Dealer Notification Date: NR - NR

| Part | 573 | Safety | Recall | Report |
|------|------------|---------------|--------|--------|
| | | • / | | |

21V-323

Page 3

Planned Owner Notification Date: JUN 28, 2021 - JUN 28, 2021

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573