

Part 573 Safety Recall Report

21V-345

Manufacturer Name : Airstream, Inc.**Submission Date :** JUN 22, 2021**NHTSA Recall No. :** 21V-345**Manufacturer Recall No. :** NR**Manufacturer Information :**

Manufacturer Name : Airstream, Inc.

Address : 419 West Pike Street
PO Box 629 Jackson Center OH
45334-0629

Company phone : 937-596-6111

Population :

Number of potentially involved : 667

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2020-2021 Airstream MY 2020 - 25RB, 26RB, 28RB & 30RB FlyingCloud, 25RB, 28RB & 30RB International, MY 2021 - 25RB, 28RB & 30RB Flying Cloud, 25RB, 28RB & 30RB International

Vehicle Type : TRAILERS

Body Style : UNKNOWN

Power Train : NR

Descriptive Information : Airstream started using the Furrion stove top on 5/7/2019 for model year 2020 units, and announced a stop ship on 5/6/2021. Production implemented the change in process 5/6/2021. 605 Airstream travel trailers were potentially affected.

Production Dates : MAY 07, 2019 - MAY 06, 2021

VIN Range 1 : Begin : 1STX9YJ26LJ549415 End : 1STJ9YM28MJ558555 Not sequential**Description of Defect :**

Description of the Defect : The stove top range was not installed in a non-sealed cabinet. The affected units have a furnace installed in an adjoining cabinet and when the furnace turns on, causes a potential for the stove top burner flame to invert due to a negative draft cause by being installed in a non-sealed cabinet.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : If the stove top burner flame becomes inverted, this increases the risk of fire.

Description of the Cause : The stove top range was installed in a non-sealed cabinet.

Identification of Any Warning that can Occur : None

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

5/5/2021 - We received information regarding a customer's units that stated while using the Furrion stove top range, the furnace started and caused the stove top burner flame to invert. 5/6/2021 - Safety committee meets and reviews all known data. Determines a recall is warranted.

Description of Remedy :

Description of Remedy Program : 5/12/2021 - Remedy process for the dealer stock units & the retailed units is not complete at this time. We will update the 573 once this has been finalized. 6/22/21 - Dealers will be instructed to stop the air flow by installing panels/baffling in the cabinet containing the appliance to isolate it from the negative air pressure and preventing the flame inversion.

How Remedy Component Differs from Recalled Component : There is not a distinguishable difference in the appearance of the stove top range cabinetry. The date of manufacture on the Federal Certification Label would be the way to determine if the cabinet is correct.

Identify How/When Recall Condition was Corrected in Production : The stove top range cabinet installation process has been correct to seal the cabinet the stove top range is installed in to prevent the negative draft on 5/6/2021.

Recall Schedule :

Description of Recall Schedule : Airstream will send dealer and owner notification letters once approved by NHTSA.

Planned Dealer Notification Date : JUL 11, 2021 - JUL 11, 2021

Planned Owner Notification Date : JUL 11, 2021 - JUL 11, 2021

* NR - Not Reported