

Part 573 Safety Recall Report

21V-676

Manufacturer Name : Utility Trailer Manufacturing Company**Submission Date :** OCT 13, 2021**NHTSA Recall No. :** 21V-676**Manufacturer Recall No. :** SB-19-009**Manufacturer Information :****Population :**

Manufacturer Name : Utility Trailer Manufacturing Company

Number of potentially involved : 260

Address : 17295 E. Railroad Street

Estimated percentage with defect : 50 %

City Of Industry CA 91748-1022

Company phone : 818-965-1541

Vehicle Information :

Vehicle 1 : 2022-2022 Utility VS2RA

Vehicle Type : TRAILERS

Body Style : VAN

Power Train : NR

Descriptive Information : - During delivery of trailers from the Piedras Negras factory to the dealer location, 5 trailers from job 7312 were found to have the incorrect tape on the top foil.

- Recalled products have incorrect gray tape. Not included in the recall are top foils with black tape.

- 260 (or less) trailers are identified in this recall.

Production Dates : JUN 01, 2021 -JUL 31, 2021

VIN Range 1 : Begin : 3UTVS2536N8706201 End : 3UTVS2538N8706250

 Not sequential

VIN Range 2 : Begin : 3UTVS253XN8731201 End : 3UTVS2538N8731200

 Not sequential

VIN Range 3 : Begin : 3UTVS2536N8731101 End : 3UTVS2534N8731100

 Not sequential

VIN Range 4 : Begin : 3UTVS2532N8731001 End : 3UTVS2530N8731010

 Not sequential**Description of Noncompliance :**

Description of the Noncompliance : Factory used the incorrect tape on top foil.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : Sealer plate can separate from the roofskin. If sealer plate detaches from the roofskin, there is a possibility that the top foil can come loose from the trailer and increase risk of crash or injury to surrounding vehicles.

Description of the Cause : Factory used incorrect tape.

Identification of Any Warning that can Occur : Identification of Gray tape used vs the correct black tape on top foil.

Involved Components :

Component Name 1 : Top Foil

Component Description : Aero device

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : Utility Trailer Manufacturing Co.

Address : 17295 E. Railroad St.

City of Industry California 91748

Country : United States

Chronology :

On August 24th, 2021 a dealer reported that the top foil from job 22 N 7312 arrived partially separated. This was the one warranty claim that lead us to inspect all trailers included in this group. There were and are no injuries or deaths associated with this report.

Description of Remedy :

Description of Remedy Program : If the sealer plate is affixed to the roof with gray foam tape and/or is showing signs of separating – remove the top foil and order a replacement to be covered under UTM Warranty.

How Remedy Component Differs from Recalled Component : Recalled component is built with gray tape. Remedy component will be an OEM equivalent with the correct tape.

Identify How/When Recall Condition was Corrected in Production : Report of incorrect tape used on top foil was furnished to Corporate Quality. Inspection of all top foils on factory grounds was conducted and repairs made as necessary. Bill of Materials are correct and must be followed and cannot be substituted.

Recall Schedule :

Description of Recall Schedule : Owners of these recalled components are our Dealers

Planned Dealer Notification Date : SEP 01, 2021 - SEP 03, 2021

Planned Owner Notification Date : SEP 01, 2021 - OCT 03, 2021

* NR - Not Reported