#### OMB Control No.: 2127-0004

2

# **Part 573 Safety Recall Report**

Manufacturer Name : Chrysler (FCA US, LLC) Submission Date : SEP 09, 2021 NHTSA Recall No.: 21V-698 Manufacturer Recall No.: Y62

### **Manufacturer Information :**

Manufacturer Name : Chrysler (FCA US, LLC) Address: 800 Chrysler Drive CIMS 482-00-91 Auburn Hills MI

48326-2757 Company phone : 1-800-853-1403

## Vehicle Information :

	Vehicle 1:	2021-2021 Ram 1500				
	Vehicle Type :					
	Body Style :	PICKUP TRUCK				
	Power Train :	NR				
	Descriptive Information :	: Some 2021 MY Ram 1500 pickup trucks may be equipped with a spare tire different than the spare tire size and cold inflation pressure designated on the tire placard label.				
		-		to identify the suspect veh anufactured on July 2, 202		
				all were built outside of th ated on the tire placard la	1 1	
	Production Dates :	JUL 02, 2021 - JUL 02,	2021			
	VIN Range 1:	Begin : NR	End :	NR	Not sequential	
D	<b>Description of Noncompliance :</b>					
	Description of	the Hederal Motor Veh	ICIA Vataty Stand	ara ("HMIVSS")         S/I 3 ra	autros that "Hach	

Description of the Federal Motor Vehicle Safety Standard ("FMVSS") 110 S4.3 requires that, "Each Noncompliance : vehicle [ ... ] shall show the information specified in S4.3 (a) through (g) [ ... ] on a placard [...] (c) [...] recommended cold tire inflation pressure for front, rear, and spare tires, [...] (d) Tire size designation, indicated by headings [...] and spare tire or spare, for the tires [ ... ] ." Some vehicles may have been built with the incorrect size spare tire, and thus may not accurately indicate the correct spare tire size designation on the placard. FMVSS 1: 110 - Tire selection and rims FMVSS 2: NR

The information contained in this report was submitted pursuant to 49 CFR §573



Number of potentially involved :

Estimated percentage with defect : 100 %

**Population**:

## 21V-698

# Part 573 Safety Recall Report

Description of the Safety Risk :	A driver may rely on the incorrect spare tire inflation pressure on the tire placard label and inflate the spare tire to an incorrect pressure resulting in potentially degraded vehicle performance, which may cause vehicle crash without prior warning.
Description of the Cause :	NR
Identification of Any Warning that can Occur :	None
Involved Components :	
Component Name 1:	Purpose Built Spare Tire
Component Description :	Spare Tire
Component Part Number :	Y769007543
Component Name 2 :	Spare Wheel
Component Description :	Spare Wheel
Component Part Number :	-
Component Name 3 :	Wheel Tire Valve Stem
Component Description :	
Component Part Number :	
Supplier Identification :	
Component Manufacturer	
Name : NR	
Address : NR	
NR	
Country: NR	

The information contained in this report was submitted pursuant to 49 CFR §573

**21V-698** 

### **Chronology**:

• On August 18, 2021 FCA US, LLC ("FCA US") Technical Safety and Regulatory Compliance determined the tire size designation for spare tires on placards installed on the subject vehicles may not be accurate.

• On September 02, 2021, FCA US determined, through the Vehicle Regulations Committee, to conduct a voluntary safety recall of the affected vehicles.

### **Description of Remedy :**

Description of Remedy Program :	FCA US will conduct a Voluntary Safety Recall to replace the incorrect size spare tire assembly with the correct size spare tire assembly.
	FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.
5 1	This recall is not related to a tire defect but rather an assembly issue where the vehicle was built with the incorrect spare tire.
Identify How/When Recall Condition was Corrected in Production :	NR

### **Recall Schedule :**

Description of Recall Schedule :	**09/09/2021: FCA US notified dealers on 09/04/2021. Involved
	vehicles are unsold so there will be no owner notification.
Planned Dealer Notification Date :	SEP 09, 2021 - SEP 09, 2021
Planned Owner Notification Date :	SEP 09, 2021 - SEP 09, 2021

\* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573