

Part 573 Safety Recall Report

21V-762

Manufacturer Name : Jayco, Inc.**Submission Date :** DEC 09, 2021**NHTSA Recall No. :** 21V-762**Manufacturer Recall No. :** 9901571**Manufacturer Information :**

Manufacturer Name : Jayco, Inc.

Address : 903 South Main Street

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Population :

Number of potentially involved : 1,155

Estimated percentage with defect : 100 %

Vehicle Information :

Vehicle 1 : 2021-2022 JAYCO JAY FLIGHT SLX

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : MY 2021-2022 JAY FLIGHT SLX - 1155 UNITS

Production Dates : JUL 07, 2021 - SEP 16, 2021

VIN Range 1 : Begin : 1UJB0AJ0N17A0059 End : 1UJB0AJXN17J0456

☒ Not sequential**Description of Defect :**

Description of the Defect : Flame on the cook top will invert when the furnace is running.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : When the furnace and cooktop are operated at the same time the cooktop burner flame can invert leading to an increased risk of personal injury or fire.

Description of the Cause : The cooktop is installed in a cabinet that is not sealed from the furnace area.

Identification of Any Warning that can Occur : An inverted flame may be observed on the cooktop.

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

On July 12, 2021 Jayco received a complaint alleging the flame on the stove inverted when the furnace and stove were running. This was investigated by WIRC and when it was discussed on 8/23/21, the Warranty Incident Review Committee decided to elevate the incident to CPAC. The Corrective and Preventive Action Committee reviewed this allegation on 9/1/21. CPAC determined that a change was made from a Dometic furnace to a Suburban furnace which had a higher output causing negative pressure resulting in the inversion of the flame when the stove and Suburban furnace operated at the same time. An investigation began to identify which units had the change made to the furnace and could exhibit this condition. Four more similar allegations were identified from our records. During the 9/15/21 CPAC meeting it was decided to elevate this incident to SSC. On 9/23/21, the Safety Steering Committee met and voted to proceed with a safety recall for this incident.

12/9/21 Identified a 7A floorplan of Jay Flight SLX that had the same condition as the units in this recall so we decided to add these units to the scope and expand the recall to include them.

Description of Remedy :

Description of Remedy Program : Sealant and plywood panels will be used to seal the area around the gas line hose and the area adjoining the cooktop. On some units, plywood panels will be installed to separate the furnace and cooktop. This remedy will be done at no cost to the owner. Prenotification remedy will be handled by our recall reimbursement plan on file with NHTSA.

How Remedy Component Differs Sealant will be visible in the area around the gas line hose and the area

from Recalled Component : adjoining the cooktop.

Identify How/When Recall Condition was Corrected in Production : Sealant and plywood panels were used to seal the area around the gas line hose and the area adjoining the cooktop beginning 9/27/2021

Recall Schedule :

Description of Recall Schedule : Jayco will notify the dealers and owners of these recreational vehicles by letter. A final copy of the owner letter and dealer repair instructions will be provided to NHTSA.

Planned Dealer Notification Date : NOV 29, 2021 - NOV 29, 2021

Planned Owner Notification Date : NOV 29, 2021 - NOV 29, 2021

* NR - Not Reported