

# Part 573 Safety Recall Report

# 21V-839

**Manufacturer Name :** Nissan North America, Inc.

**Submission Date :** DEC 17, 2021

**NHTSA Recall No. :** 21V-839

**Manufacturer Recall No. :** R21B6



## Manufacturer Information :

**Manufacturer Name :** Nissan North America, Inc.

**Address :** P. O. BOX 685001

Franklin TN 37068-5009

**Company phone :** 800-647-7261

## Population :

**Number of potentially involved :** 5,905

**Estimated percentage with defect :** 1 %

## Vehicle Information :

**Vehicle 1 :** 2017-2019 Nissan Rogue

**Vehicle Type :** LIGHT VEHICLES

**Body Style :** SUV

**Power Train :** HYBRID ELECTRIC

**Descriptive Information :** Based on production records, this issue is unique to certain Nissan Rogue vehicles models equipped with a hybrid powertrain produced at the Smyrna plant. The defect is unique to these models and dates of manufacture; no other Nissan or INFINITI vehicles are affected.

**Production Dates :** JUL 26, 2016 - DEC 15, 2018

**VIN Range 1 : Begin :**

NR

**End :** NR

Not sequential

## Description of Defect :

**Description of the Defect :** On certain Rogue Hybrid vehicles, the engine harness may contact the Electronic Control Module (ECM) bracket. Due to the interference from the wire routing, the engine harness may become damaged. Over time, the damage to the harness may cause a short circuit, which can lead to a blown fuse. If this occurs, it may disable drive power to the engine and electric motor, without the ability to restart.

**FMVSS 1 :** NR

**FMVSS 2 :** NR

**Description of the Safety Risk :** With a potential loss of drivetrain power, the customer may experience an engine stall while driving, increasing the risk of a crash.

**Description of the Cause :** NR

**Identification of Any Warning that can Occur :** The is no preceding warning that occurs.

**Involved Components :**

Component Name 1 : HARNESS-ENGINE ROOM

Component Description : Engine Room Harness

Component Part Number : 24012 6FM0C

**Supplier Identification :****Component Manufacturer**

Name : NR

Address : NR

NR

Country : NR

**Chronology :**

See attached Part 573 with Chronology of Principle Events.

**Description of Remedy :**

Description of Remedy Program : Dealers will install a harness protector cover on the engine harness to prevent damage.

Nissan will include a statement in the Part 577 owner notification concerning reimbursement for the cost of obtaining a pre-notification remedy for the subject vehicles that are no longer under warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

**Recall Schedule :**

Description of Recall Schedule : Dealers were notified beginning October 27, 2021. Owners of all potentially affected vehicles were notified beginning on December 15, 2021, to bring their vehicle to the dealer for repair.

Planned Dealer Notification Date : OCT 27, 2021 - NR

Planned Owner Notification Date : DEC 15, 2021 - NR

\* NR - Not Reported