

Part 573 Safety Recall Report

21V-897

Manufacturer Name : Jayco, Inc.**Submission Date :** JAN 10, 2022**NHTSA Recall No. :** 21V-897**Manufacturer Recall No. :** NR**Manufacturer Information :****Population :**

Manufacturer Name : Jayco, Inc.

Number of potentially involved : 108

Address : 903 South Main Street

Estimated percentage with defect : 100 %

PO Box 460 Middlebury IN 46540

Company phone : 800-283-8267

Vehicle Information :

Vehicle 1 : 2021-2021 Jayco Towable Jay Flight Octane

Vehicle Type : TRAILERS

Body Style : OTHER

Power Train : NR

Descriptive Information : Jayco determined the scope from its production records. This model was not built prior to model year 2021.

Production Dates : OCT 08, 2020 - JUN 29, 2021

VIN Range 1 : Begin : 1UJBJSBN0M1VD0054 End : 1UJBJSBNXM1VD0160 ☒ Not sequential**Description of Defect :**

Description of the Defect : NFPA 1192 specifies that when an appliance exhaust is located directly under a slideout it must be a minimum of 36 inches below the slideout. If the exhaust is not directly below the slideout the minimum does not apply. Jayco built these units with the water heater exhaust directly below the slideout and within 36 inches of the slideout.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : There is a chance that exhaust fumes from the water heater can enter the slideout. This could increase the risk of an injury.

Description of the Cause : The water heater was mistakenly located directly under the slideout which did not correspond to the engineering drawings which show it not located directly under the slideout.

Identification of Any Warning that can Occur : The carbon monoxide detector should sound indicating the presence of carbon monoxide from the exhaust fumes.

Involved Components :

Component Name 1 : Water heater 6 Gal E/G

Component Description : Water heater

Component Part Number : 2004902

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

10/6/2021 Jayco Compliance received an email from Corporate Engineering stating that the water heater was improperly located when it was installed in all units we had built. 10/11/2021 Warranty Incident Review Committee (WIRC) discussed this incident and elevated to the Corrective and Preventive Action Committee (CPAC). 10/20/2021 CPAC met to discuss this incident and assigned Engineering to determine an appropriate repair. CPAC elevated this incident to the Safety Steering Committee (SSC). On 11/11/2021 SSC met and voted that a safety recall was appropriate for this incident.

Description of Remedy :

Description of Remedy Program : The water heater will be relocated so that its exhaust is not directly below the slideout. Repairs made prior to the recall will be reimbursed in accordance with our Recall Reimbursement Plan on file with NHTSA.

How Remedy Component Differs from Recalled Component : The remedied units will have the water heater exhaust not located directly below the slideout.

Identify How/When Recall Condition was Corrected in Production : On 10/6/2021 Production made the correction to units on site and will now locate the water heater exhaust so it is not directly below the slide out.

Recall Schedule :

Description of Recall Schedule : Jayco will notify its dealers and affected retail owners.

Planned Dealer Notification Date : JAN 17, 2022 - JAN 17, 2022

Planned Owner Notification Date : JAN 17, 2022 - JAN 17, 2022

* NR - Not Reported