# \* \* TECHNICAL INFORMATION NOTICE \* \*

DATE: November 29, 2021

TO: Mitsubishi Motors US and Puerto Rico Dealer Principals, General Managers,

Service Managers, and Parts Managers

RE: SEAT BELT AUTOMATIC LOCKING RETRACTOR (ALR) – SAFETY RECALL CAMPAIGN


TIN NO. TIN-21-SR-007C

\*

# **AFFECTED VEHICLES: Certain 2022 Outlander vehicles**

### **PURPOSE**

MMNA would like to remind all dealers and technicians that <u>CHECKING AND CLEARING DTCs</u> are essential to the repair process when replacing seat belts for this recall. On CSI surveys, customers have indicated their vehicle was not *Fixed Right the First Time* due to the SRS light being illuminated after one of the seat belts were replaced. The most likely cause of this is the technician failed to insert and lock the connector in place and then turns the ignition on with the connector not fully attached. As referenced in Recall Bulletin SR-21-007REV2 and listed below, please be sure to <u>CHECK AND CLEAR ALL DTCs after seat belt replacement</u>. Many of these customers are new to the brand and having this recall completed is their first visit to your Service Department. It is imperative that we amplify our customer satisfaction efforts – including performing a thorough quality check – to retain these customers for their future service and sales needs.

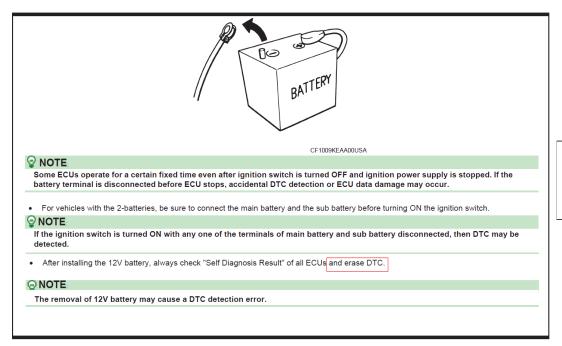

From Recall Bulletin: SR-21-007REV2 Page 6

## CAUTION

While waiting, never operate the vehicle such as locking, opening, and closing doors. Violation of this caution results in the activation of ACC power supply according to the Auto ACC function.

6. Remove 12V battery terminal.

#### CAUTION

After installing 12V battery, always check self-diagnosis results of all ECUs and erase DTC.


# **Precaution for Seat Belt Service**

### **CAUTION:**


- Before removing the seat belt assembly, turn the ignition switch OFF, disconnect the battery negative terminal and wait at least 3 minutes.
- · Never use electrical test equipment for seat belt connectors.
- After replacing or reinstalling seat belt assembly, or reconnecting seat belt connectors, check the system function. Refer
  to M.U.T.-III SE Function <u>DIAGNOSIS SYSTEM (AIR BAG DIAGNOSIS SENSOR UNIT).</u>

From Recall Bulletin: SR-21-007REV2 Page 7

Please be sure to insert and lock the connector in place prior to turning on the ignition at this step or a code will set.

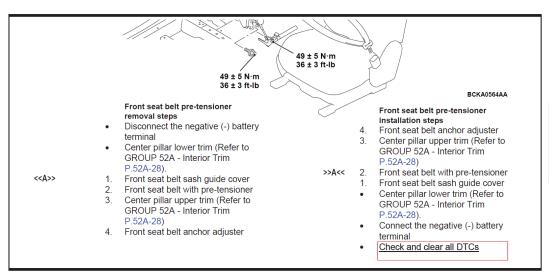

From Recall Bulletin: SR-21-007REV2 Page 8

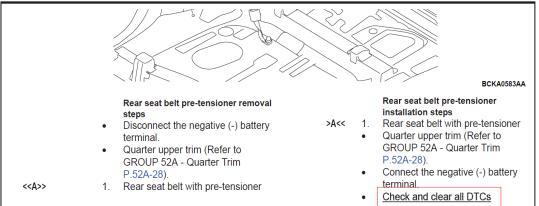

From Recall Bulletin: SR-21-007REV2 Page 9

## **IMPORTANT**

Affected new or used inventory vehicles must be repaired before the vehicle is sold/delivered. Dealers must check their inventory vehicles' VINs on the Warranty Superscreen to verify whether the vehicle is involved in this recall campaign. It is a violation of Federal law for a dealer to sell/deliver a new motor vehicle or any new or used item of motor vehicle equipment (including a tire) covered by the notification