



GROUP Safety Recall Campaign	MODEL 2017-2021MY Sportage (QL) & 2017-2019MY Cadenza (YG)
NUMBER SC206	DATE March 2021

SAFETY RECALL CAMPAIGN

SUBJECT: NEW FUSE KIT INSTALLATION IN JUNCTION BOX (SC206)

This bulletin provides the procedure to install a new fuse kit for the Hydraulic Electronic Control Unit (HECU) in the junction box on some Sportage (QL) and Cadenza (YG) vehicles listed in the table below. Also, affected Sportage (QL) vehicles equipped with the Electronic Parking Brake (EPB) will also get the HECU software logic update. The affected vehicles may exhibit numerous warnings, including illumination of the tire pressure warning light, ABS warning light, MIL warning light, a burning/melting smell and/or smoke from engine compartment in the area where the HECU is located. It is believed that the electrical circuit within the HECU experiences a short circuit condition that results in excessive current, thereby increasing the risk of an engine compartment fire. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.

SC206_	MY	Model	Production Date	Procedure
SC206A	17-21MY	Sportage (QL) w/No EPB	12/10/2015 – 10/23/2020	Junction Box HECU Fuse Replacement (Page 2)
SC206B*	17-21MY	Sportage (QL) w/EPB	12/10/2015 – 10/23/2020	TBD
SC206C*	17-19MY	Cadenza (YG)	06/02/2016 – 06/14/2019	TBD

*The remedy procedures for SC206B (17-21MY Sportage w/EPB) and for SC206C (17-19MY Cadenza) are NOT available at this time. They will be published in this TSB as soon as they become available.

* NOTICE

There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.

* NOTICE

To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service → Warranty Coverage → Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.

Printed TSB copy is for reference only; information may be updated at any time.
Always refer to KGIS for the latest information.

Circulate To: General Manager Service Manager Parts Manager
 Service Advisors Technicians Body Shop Manager Fleet Repair

SUBJECT: NEW FUSE KIT INSTALLATION IN JUNCTION BOX (SC206)

HECU Fuse Replacement Procedure for Sportage (QL) No EPB:

1. Disconnect the negative (-) battery terminal and open the junction box cover.

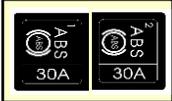


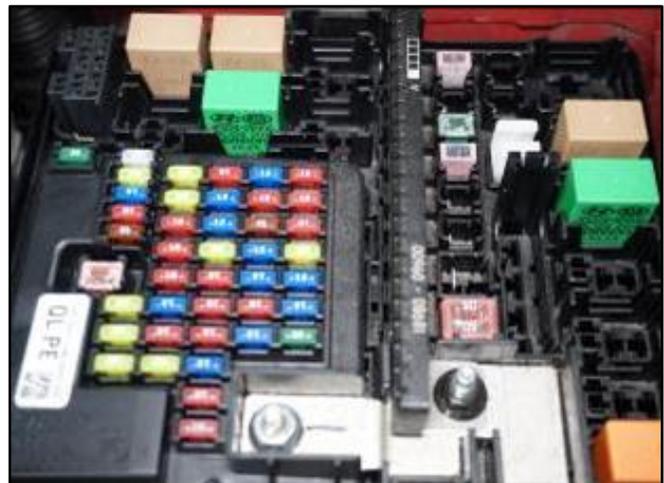
2. Remove the following two (2) fuses from the junction box:

1. ABS1
2. ABS2



3. Install the new required two (2) new 30A fuses.

Applicable Fuses	
(QL) NO EPB (30A)	



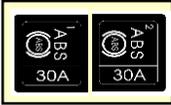
SUBJECT:

NEW FUSE KIT INSTALLATION IN JUNCTION BOX (SC206)

AFFECTED VEHICLE RANGE:

Model	Production Date Range
Sportage (QL)	December 10, 2015 to October 23, 2020
Cadenza (YG)	June 02, 2015 to June 14, 2019

REQUIRED PART:

Part Name	Part Number	Figure	Qty.
Fuse Kit (QL) No EPB	91KIT D330AQQK*	 ABS1 ABS2 	1

*Note: Only use the specified parts shown above; additional parts included in the kit may be discarded. Kit P/N 91KIT D330AQQK may be superseded by P/N 91950 D9300QQK upon depletion of part stock.

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Model	Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
QL	R	58920 D9530	0	(SC206A) ABS1/ABS2 Fuse Replacement (No EPB)	211038R0	0.3 M/H	91KIT D330AQQK or 91950 D9300QQK	1
				(SC206B*) (w/EPB)	Not Available	TBD	N/A	1
YG		N/A	0	(SC206C*)	Not Available	TBD	N/A	1

Note: Refer to Warranty Bulletin 2021-05 for claim submission procedures.

*The remedy procedures for SC206B (17-21MY Sportage w/EPB) and for SC206C (17-19MY Cadenza) are NOT available at this time. They will be published in this TSB as soon as they become available.

*** NOTICE**

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference **SC206 A/B/C** when accessing the WebDCS system.