



GROUP Safety Recall Campaign	MODEL 2021MY Forte (BDm), K5 (DL3a) and Telluride (ON)
NUMBER SC207	DATE March 2021

SAFETY RECALL CAMPAIGN

SUBJECT:

OCCUPANT DETECTION/CLASSIFICATION SYSTEM UNIT REPLACEMENT (SC207)

This service bulletin provides information to replace the Occupant Detection System (ODS) / Occupant Classification System (OCS) unit on certain vehicles listed in the table below. An ODS/OCS unit detects the presence of a child restraint system (CRS) in the front passenger seat. The ODS/OCS units on these vehicles were improperly calibrated at the supplier and as a result do not comply with Federal Motor Vehicle Safety Standard (FMVSS 208), "Occupant Crash Protection". If a CRS is placed in the front passenger seat, the front passenger airbag will not be suppressed and will deploy, thereby increasing the risk of injury to the child in a CRS in a crash. Before conducting the procedure, verify that the vehicle is included in the list of affected VINs.

***It is never recommended to allow children to ride in the front passenger seat. Never install a Child Restraint System on the front passenger seat.**

Model Year	Model	Production Date
2021	K5 (DL3a)	February 3 – March 4, 2021
	Telluride (ON)	February 16 – March 3, 2021
	Forte (BDm)	February 9, 2021

* NOTICE

There is no charge to the vehicle owner for this repair. Under applicable law, you may not sell or otherwise deliver any affected vehicle until it has been repaired pursuant to the procedures set forth in this bulletin.

* NOTICE

To assure complete customer satisfaction, always remember to refer to WebDCS Warranty Coverage (validation) Inquiry Screen (Service → Warranty Coverage → Warranty Coverage Inquiry) for a list of any additional campaigns that may need to be performed on the vehicle before returning it to the customer.

Printed TSB copy is for reference only; information may be updated at any time. Always refer to KGIS for the latest information.


Circulate To: General Manager Service Manager Parts Manager
 Service Advisors Technicians Body Shop Manager Fleet Repair

OCCUPANT DETECTION/CLASSIFICATION SYSTEM UNIT REPLACEMENT (SC207)

Replacement Procedure:


1. **All listed models:** Replace the ODS/OCS unit (A) by referring to the “Restraint→SRSCM→ Occupant Detection/Classification System (ODS/OCS) → Repair procedures” chapter in the applicable Shop Manual on KGIS.

Be sure to follow the steps on KGIS; Secure the seat retaining bolts to the torque specifications on KGIS after ODS/OCS unit replacement.

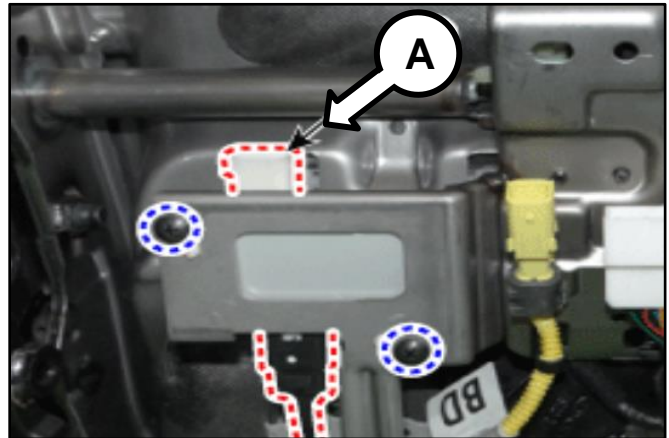

2. Install the KDS and reset the ODS/OCS system under ‘Software Management’ and selecting the:

KDS: S/W management → Systems → Occupant Detection/Classification Sensor → Body Sensor Reset

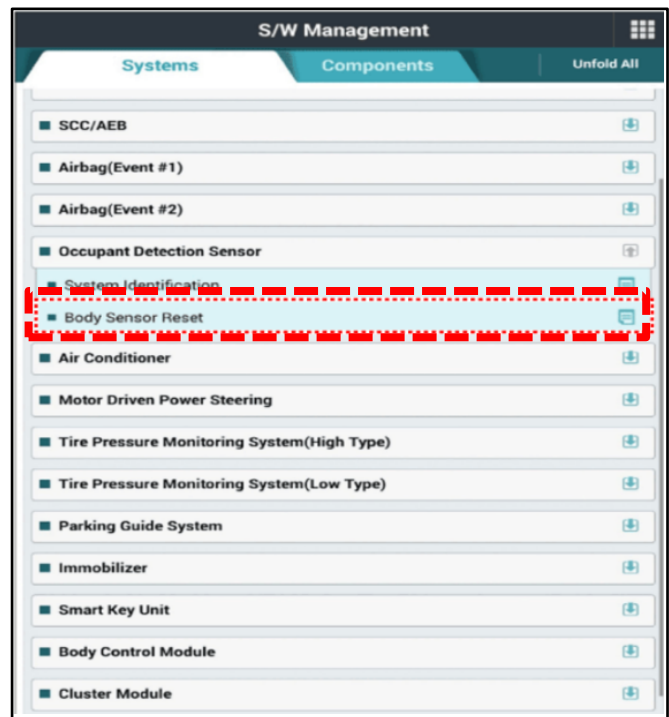

★ NOTICE

Be sure to initialize/reset the new ODS/OCS unit (body sensor) using KDS after replacement. Also, erase any stored DTC's. Follow instructions outlined in the shop manual found on KGIS.

★ IMPORTANT

All ODS/OCS units that have been replaced will be called back to the assembly plants for inspection to confirm part accountability. If the incorrect part is returned, the dealership will be contacted, and the vehicle will need to be re-inspected again.


SUBJECT:

OCCUPANT DETECTION/CLASSIFICATION SYSTEM UNIT REPLACEMENT (SC207)

AFFECTED VEHICLE RANGE:

Model	Production Date Range
K5 (DL3a)	February 3 – March 4, 2021
Telluride (ON)	February 16 – March 3, 2021
Forte (BDm)	February 9, 2021

REQUIRED PART:

Model	Part Description	Part Number	Figure	Qty.
Forte (BDm)	ODS/OCS Unit	80702 M6000*		1
K5 (DL3a)		80702 L2000*		
Telluride (ON)		80702 S9000*		

Note: Parts will be auto-shipped to dealers with in-stock inventory.

WARRANTY INFORMATION:

N Code: N99 C Code: C99

Model	Claim Type	Causal P/N	Qty.	Repair Description	Labor Op Code	Op Time	Replacement P/N	Qty.
BDm	R	80702 M6000	1	(SC207) ODS/OCS Replacement	210M01R0	0.5 M/H	N/A	0
DL3a		80702 L2000	1		211A09R0	0.5 M/H	N/A	
ON		80702 S9000	1		N/A			

Note: Refer to Warranty Bulletin 2021-04 for claim submission procedures.

* NOTICE

VIN inquiry data for this repair is provided for tracking purposes only. Kia retailers should reference **SC207** when accessing the WebDCS system.

