

RECALL 21V350. 2021-284 REMEDY INSTRUCTIONS



Make(s): SPIRIT TRAVEL TRAILERS
Model(s): MANY, SEE BELOW
Model Year(s): 2021

Concern:
The battery/house and the break-away wiring is incorrect on the battery disconnect.

Repair Code: RC-003-22-00-004058
Allotted Time: .50 HRS.
Inspection Code: N/A
Allotted Time: N/A
Photo(s) Required: NO
Prior Authorization Required: NO
Part(s) Kit Number: N/A
Part(s) Return: NO

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

MODELS AFFECTED: SBT1943RB, SBT2557RB, SBT2963BH AND SBT3379BH

- STEP 1: LOCATE AND REMOVE SCREWS HOLDING THE BATTERY DISCONNECT FROM THE FRAME (FIG. 1);
- STEP 2: LOOSEN THE BATTERY DISCONNECT AND PULL THE WIRES THROUGH THE FRAME HOLE (FIG. 2);
- STEP 3: LOCATE AND UNBOLT THE RED WIRES FROM THE SAME LUG ON THE BATTERY KILL SWITCH (FIG. 3);
- STEP 4: PLACE THE RED BATTERY HOT ON THE "CONNECT" SIDE AND PLACE THE BLACK WIRE WITH THE EYELET ONTO THE SAME LUG TOGETHER (THIS BLACK WIRE IS THE BREAK-AWAY SWITCH WIRE) (FIG. 4);
- STEP 5: PLACE THE RED WIRE FROM THE TRAILER SIDE TO THE OTHER POST OF THE SWITCH (FIG. 4);
- STEP 6: TIGHTEN LUGS DOWN;
- STEP 7: CLAIM REPAIR CODE.

FIG. 1



FIG. 2



FIG. 3



FIG. 4

