

RECALL 21V374. 2021-306 REMEDY INSTRUCTIONS



Make(s): COLUMBUS
Model(s): MANY, SEE BELOW
Model Year(s): 2021

Concern:
The breakaway switch may not be correctly wired to constant hot. This condition may lead to the failure of the brake-away switch to activate in an emergency.

Repair Code: RC-036-22-00-004063
Allotted Time: .5
Inspection Code: RC-036-05-00-004062
Allotted Time: .1
Photo(s) Required: No
Prior Authorization Required: No
Part(s) Kit Number: N/A
Part(s) Return: No

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.

MODELS AFFECTED: CMF298RLC, CMF329DV, CMF329DVC, CMF329DVW, CMF378MBC, CMF378MBCW, CMF382FB, CMF382FBW, CMF383FB, CMF383FBC, CMF383FBW, CMF388FK, CMF388FKC, CMF389FL, CMF390RL, CMF390RLW, CMF392MB AND CMF392MBW

STEP 1: LOCATE BATTERY CONSTANT POWER AUTO-RESET BREAKERS (FIG. 1);

STEP 2: LOCATE THE BREAKAWAY SWITCH WIRE HOOKED TO THE NON-CONSTANT POWER POST (FIG. 1);

STEP 3: REMOVE THE BREAKAWAY SWITCH WIRE FROM NON-CONSTANT POWER POST;

STEP 4: INSTALL BREAKAWAY SWITCH WIRE TO POST THAT IS CONSTANT POWER BY BATTERY (FIG. 1);

FIGURE 1

