



Service Bulletin

American Honda Motor Co., Inc.

Multiple Model: Rear Reflector #1

May 2021

SAFETY RECALL

MULTIPLE MODEL - REAR REFLECTOR

BACKGROUND

Honda is launching a **SAFETY RECALL** on **CERTAIN** motorcycles listed in the **AFFECTED UNITS** section of this bulletin to replace the rear reflector, which does not meet FMVSS reflectiveness requirements. A rear reflector that does not meet reflective requirements may reduce visibility from behind, increasing the risk of a rear collision and possible injury or death.

This Service Bulletin includes the reflector replacement procedure, parts information, and warranty template claim information.

Honda will notify customers with affected vehicles via letter in July 2021, advising them to make an appointment with an authorized Honda dealer to perform the recall repair by replacing the rear reflector with an updated part.

DEALER INVENTORY

As of May 24th, 2021, **YOU MUST NOT SELL** any affected **NEW OR USED** motorcycle listed in the **AFFECTED UNIT** section until it is repaired according to this Service Bulletin.

- To search for applicable recalls on a specific unit, you must use **Unit Information** on **iN**.
- To manage your affected inventory, refer to **eResponsibility Report** on **iN**.

PARTS INFORMATION

Parts are available through the normal parts ordering process.

DESCRIPTION	PART NUMBER	QTY.
*Reflector Set	06330-K76-305	1

*Kit includes: Rear Reflector, 5mm Locking Nut.

DEALER REPAIR RESPONSIBILITY

- Repairs must be performed by a qualified technician.
- Performing this repair exactly as shown in Repair Procedure instructions is critical for the remedy to be effective. Carefully follow all instructions.
- Service Management should inspect and confirm the repair.
- Dealer submission of a warranty claim affirms this repair was properly performed.

MTB 17730 (2105)

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your Honda. These procedures should not be attempted by any other individuals and you should not assume this bulletin applies to your Honda, or that your Honda has the condition described. To determine whether this information applies, contact an authorized Honda dealer.

Multiple Model: Rear Reflector #1
May 2021

AFFECTED UNITS

TEMPLATE	MODEL	YEAR	TYPE	VIN RANGE
KM3A	C125A	2020	AC	MLHJA4857L5101405 thru MLHJA4858L5102160
	C125A	2021	AC	MLHJA4855M5200001 thru MLHJA4854M5200720
	CRF250L	2020	AC	MLHMD4414L5300001 thru MLHMD4416L5302039
	CRF250LA	2020	AC	MLHMD4450L5300001 thru MLHMD4455L5300480
	CRF250LR	2020	AC	MLHMD4405L5300001 thru MLHMD440XL5300592
	CRF250LRA	2020	AC	MLHMD4441L5300001 thru MLHMD444XL5300255
	CRF300LR	2021	AC	MLHND1606M5000002 thru MLHND1602M5000241
	CRF300LRA	2021	AC	MLHND1642M5000002 thru MLHND1649M5000241
	CRF300L	2021	AC	MLHND1615M5000002 thru MLHND1618M5000057
	CRF300LA	2021	AC	MLHND1651M5000002 thru MLHND1653M5000485
	CBR650RA	2020	2AC	MLHRH0159L5100001 thru MLHRH0157L5100448
	CBR650RA	2020	AC	MLHRH0153M5200001 thru MLHRH0157M5200096
	CB650RA	2021	AC	MLHRH0257L5100321 thru MLHRH0257L5100576
	CBR650RA	2021	AC	MLHRH0255M5200001 thru MLHRH0254M5200202
	MONKEY125	2020	AC	MLHJB0219L5101031 thru MLHJB0219L5101952
	MONKEY125A	2020	AC	MLHJB0258L5100567 thru MLHJB025XL5100778
	MONKEY125	2021	AC	MLHJB0210M5200001 thru MLHJB0215M5203055
MONKEY125A	2021	AC	MLHJB0257M5200001 thru MLHJB0251M5200611	

CONTINUED...

AFFECTED UNITS

TEMPLATE	MODEL	YEAR	TYPE	VIN RANGE
KM3B	CBR300R	2020	5A	MLHNC5100L5600367 thru MLHNC5101L5600510
	CBR300R	2020	5AC	MLHNC5119L5600067 thru MLHNC5116L5600074
	CBR300RA	2020	5AC	MLHNC515XL5600145 thru MLHNC5157L5600152
	CBR300R	2021	5A	MLHNC5107M5700001 thru MLHNC5102M5700116
	CBR300R	2021	5AC	MLHNC5116M5700001 thru MLHNC5112M5700044
	CBR300RA	2021	5AC	MLHNC5152M5700001 thru MLHNC5150M5700112
	CMX300	2020	A	MLHNC5303L5300321 thru MLHNC530XL5300512
	CMX300	2020	AC	MLHNC5318L5300033 thru MLHNC53175300072
	CMX300A	2020	AC	MLHNC5354L5300193 thru MLHNC535XL5300568
	CMX300	2021	A	MLHNC5301M5400001 thru MLHNC5304M5400476
	CMX300	2021	AC	MLHNC5310M5400001 thru MLHNC5318M5400084
	CMX300A	2021	AC	MLHNC5357M5400001 thru MLHNC5357M5401584
	CMX500	2020	A	MLHPC560XL5300207 thru MLHPC5601L5300774
	CMX500	2020	AC	MLHPC5616L5300049 thru MLHPC5611L5300122
	CMX500A	2020	AC	MLHPC5652L5300259 thru MLHPC565X9L5301120
	CMX500	2021	A	MLHPC5606M5400001 thru MLHPC560XM5400390
	CMX500	2021	AC	MLHPC5614M5400001 thru MLHPC5618M5400056
	CMX500A	2021	AC	MLHPC5651M5400001 thru MLHPC5651M5400869
	CMX500A2	2021	AC	MLHPC5647M5000001 thru MLHPC5649M5000775
	CBR500R	2020	AC	MLHPC6213L5100287 thru MLHPC6210L5100604
	CBR500RA	2020	AC	MLHPC6253L5100163 thru MLHPC6255L5100357
	CBR500RA	2021	AC	MLHPC6254M5200001 thru MLHPC6255M5200928
	CB500FA	2021	AC	MLHPC6356M5200001 thru MLHPC6356M5200256
	CB500X	2020	AC	MLHPC6411L5100169 thru MLHPC6413L5100318
CB500XA	2020	AC	MLHPC6458L5100043 thru MLHPC6457L5100163	
CB500XA	2021	AC	MLHPC6458M5200001 thru MLHPC6453M5200570	

TEMPLATE	MODEL	YEAR	TYPE	VIN RANGE
KM3C	GROM125	2020	AC	MLHJC7517L5204711 thru MLHJC7518L5211960
	GROM125A	2020	AC	MLHJC7551L5200804 thru MLHJC7551L5201239

Multiple Model: Rear Reflector #1
May 2021

TEMPLATE CLAIM INFORMATION

After completing a recall repair, immediately submit one template claim per affected VIN using the appropriate template information from the **AFFECTED UNIT** section of this service bulletin.

TEMPLATE	FLAT RATE
KM3A	0.2
KM3B	0.3
KM3C	0.6

WARRANTY QUESTIONS

If you have any warranty administration questions relating to template claims and claim filing procedures, please contact:
 Powersports Warranty Online:
iN > Service > Warranty & HondaCare > Warranty Connect Filing

TECHNICAL QUESTIONS

If you have any technical questions relating to the repair procedure, please contact:
 Powersports TechLine Online:
iN > Service > TechLine > TechLine Connect


RECALL REPAIR IDENTIFICATION

Before you begin the repair procedure, verify that the unit has not already been repaired by searching *Unit Information* on **iN**.


RECALL REPAIR PROCEDURE

C125/A:

1. Remove the three Cap Nuts [1] from the Rear Fender Comp [2] and remove the License Plate Bracket.

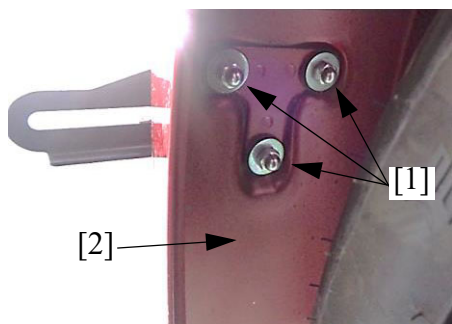

2. Remove the License Plate Bracket [1] from the Rear Fender Comp [2].

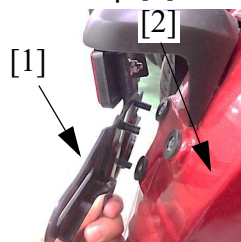

3. Remove the U-nut [1] from the License Plate Bracket and remove the defective Reflector.




4. Install the new Reflector by aligning the Reflector pin to the fixing hole. Tighten the new U-nut to 13 in-lbs (1.5 N.m). Re-install the parts in reverse order of removal.

GROM125/A:

1. Unlock the Seat with the key and remove the Double Seat Assembly.



2. Remove the four bolts [1] from the Frame Body.

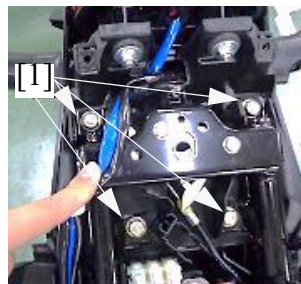


3. Remove the Rear Fender Assembly [2] from the Frame Body.




4. Remove the five screws [3] from the Rear Inner Fender.

NOTE: Support the rear Fender Assembly to prevent the Rear Fender Assembly from hanging by the wires.

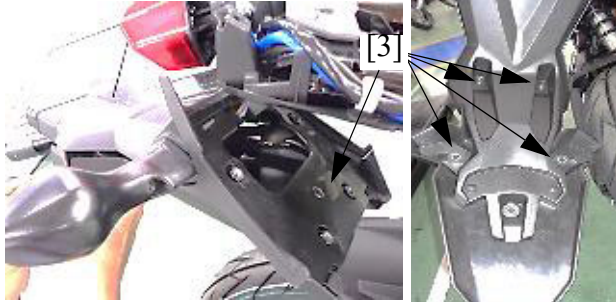


5. Remove the four screws [4] from Rear Fender A.

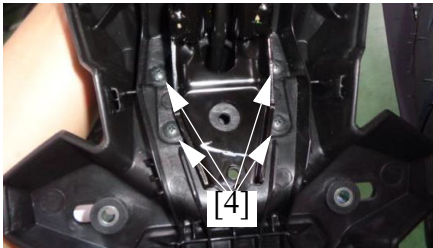


6. Remove the License Light Bracket from the Rear Fender A.



7. Remove the U-nut [6] from the License Light Bracket and remove the defective Reflector.

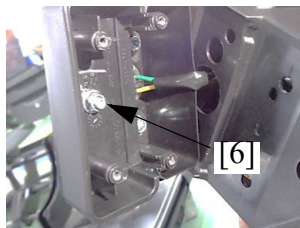

8. Install the new Reflector [8] by aligning the Reflector pin [9] with the fixing hole [10]. Tighten the new U-nut to 15 in-lbs (1.7 N.m). Re-Install the parts in the reverse order of removal.

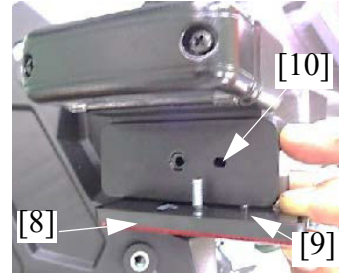


CBR650R/A, CB650R/A:

1. Remove the U-nut [1] from the rear fender.




2. Remove the defective Rear Reflector and install the new Reflector [2] by aligning the Reflector pin [3] with the fixing hole [4]. Tighten the new U-nut to 16 in-lbs (1.8 N.m).

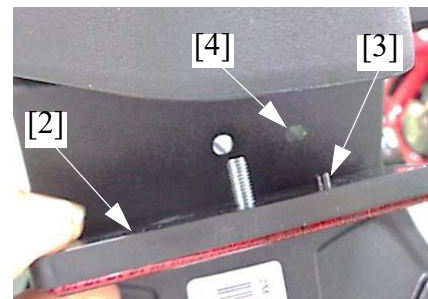

CB500X/A:


1. Remove the three socket bolts [1] from the Rear Fender Cover [2].

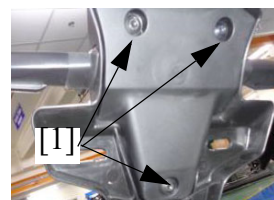


Multiple Model: Rear Reflector #1
May 2021

2. Remove the four screws [3] securing the License Light Bracket [4].

NOTE: It is not necessary to remove the license light from the cover.

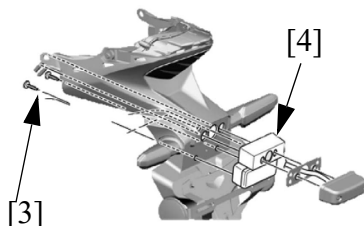

3. Remove the U-nut on the backside of the defective Rear Reflector and install the new Reflector [5] by aligning the Reflector pin [6] to the fixing hole [7]. Tighten the new U-nut to 13 in-lbs (1.5 N.m). Re-install the parts in the reverse order of removal.

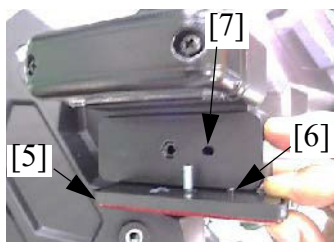


CBR500R/A, CB500F:


1. Remove the one screw [1] from the Rear Fender Cover.




2. Remove the five socket bolts [2] from the Rear Fender A.

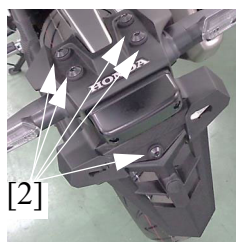

3. Release the Rear Fender Cover from the Rear Fender A and Rear Fender Stay. Remove the U-nut [3] from the Reflector.

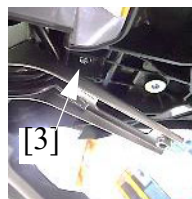


4. Remove the defective Reflector and install the new Reflector [4] by aligning the Reflector pin [5] to the fixing hole [6]. Tighten the new U-nut to 13 in-lbs (1.5 N.m). Re-install the parts in the reverse order for removal.

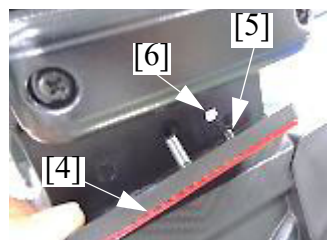

CMX300/A, CMX500/A:

1. Remove the two bolts [1] from the Rear Fender A.

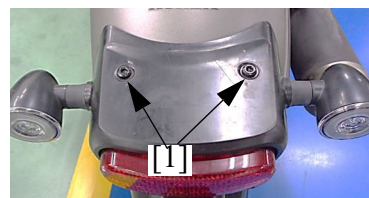

2. Remove the two bolts [2] from the Rear Fender Stay.



3. Remove the Rear Fender A [3] from the Tail Light Unit.



4. Remove the U-nut [4] from the Rear Fender A.




5. Remove the defective Reflector and install the new Reflector [5] by aligning the Reflector pin [6] to the fixing hole [7]. Tighten the new U-nut to 13 in-lbs (1.5 N.m). Re-install the parts in reverse order of removal.




CRF250L/A, CRF250LR/LRA, CRF300L/A, CRF300LR/LRA:

1. Remove the U-nut [1] from the License Plate Bracket.

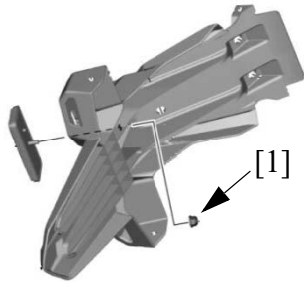


2. Remove the defective Reflector and install the new Reflector [2] by aligning the Reflector pin [3] to the fixing hole [4]. Tighten the new U-nut to 15 in-lbs (1.7 N.m).

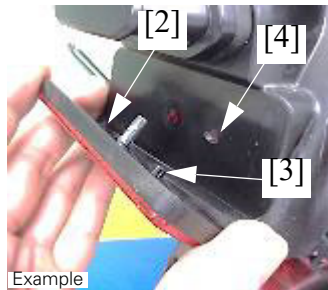


CBR300R/A:

1. Remove the three screws [1] to remove the License Light Bracket [2] from the Rear Fender.

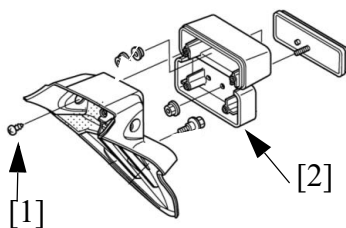

2. Remove the U-nut [3] and Reflector [4] from the License Light Bracket and install the new Reflector by aligning the Reflector pin to the fixing hole. Tighten the new U-nut to 13 in-lbs (1.5 N.m). Re-install the parts in the reverse order for removal.

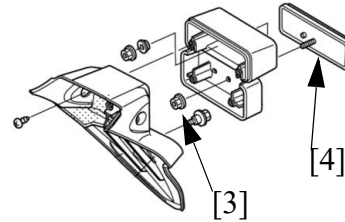


MONKEY125/A:

1. Remove the U-nut [1] from the Rear Fender.



2. Remove the defective Reflector and install the new Reflector [2] by aligning the Reflector pin to the fixing hole. Tighten the new U-nut to 13 in-lbs (1.5 N.m).

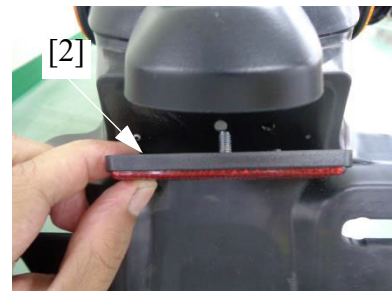

TEXT OF CUSTOMER LETTER

Customer letter forthcoming.