



WINNTEC Model #6020 LP REGULATOR

Bulletin Type:	RCL	Publication Date:	August 2021 Revised December 2021
Bulletin #(s):	21V-425 US 2021-367 Canadian	Make(s):	Jayco
Job Code(s):	9901567A - Inspection Only 9901567B - Inspection, Complete Replace, LP Leak Test	Model(s):	Various Models
Flat Rate(s):	9901567A - .10 hr 9901567B - .50 hr	Model Year(s):	2017-2021

Incident:	Regulators may supply elevated, Intermittent, or low propane pressure or flow to appliances.		
Affected Units:	2017-2018 DESIGNER FW	2017-2021 JAY FLIGHT SLX TT	
	2017-2021 EAGLE HT FW	2017-2021 JAY FLIGHT TT	
	2017-2020 EAGLE HT TT	2017-2021 NORTH POINT FW	
	2019-2020 EAGLE HTX FW	2017-2021 OCTANE SUPERLITE TT	
	2017-2021 EAGLE TT	2017-2019 OCTANE TT	
	2017-2021 JAY FEATHER TT	2017-2021 PINNACLE FW	
	2018-2021 JAY FLIGHT BUNGALOW T	2017-2021 WHITE HAWK TT	
Parts Kit Details:	Kit#: 21V-425		
	Contents:		
	- 1 ea.- 21V-425-Kit LP Regulator		
Misc. Tools & Supplies:	- Yellow Gas Line PTFE Thread Seal Tape		
	- Universal Screw Driver		
	- Vice Grips		
Parts Return Information:	- No Return Parts		



Highland
RIDGE RV



WINNTEC Model #6020 LP REGULATOR

Bulletin Type:	RCL
Bulletin #(s):	21V-430 US 2021-369 Canadian
Job Code(s):	9904567A – Inspection Only 9904567B – Inspection, Complete Replace, LP Leak Test
Flat Rate(s):	9904567A - .10 hr 9904567B - .50 hr

Publication Date:	August 2021 Revised December 2021
Make(s):	Highland Ridge
Model(s):	Various Models
Model Year(s):	2017-2021

Incident:	Regulators may supply elevated, Intermittent, or low propane pressure or flow to appliances.
Affected Units:	2020-2021 MESA RIDGE LIMITED FW 2020-2021 OPEN RANGE LIGHT TT 2020-2021 MESA RIDGE LIMITED TT 2019-2021 OPEN RANGE TT 2020-2021 MESA RIDGE LITE TT 2020-2021 OPEN RANGE ULTRA LITE TT 2019-2020 MESA RIDGE TT 2020 SILVERSTAR LIMITED FW 2020-2021 OPEN RANGE LIGHT FW 2020 SILVERSTAR LIMITED TT
Parts Kit Details:	Kit#: 21V-425
	Contents: - 1 ea.- 21V-425-Kit LP Regulator
Misc. Tools & Supplies:	- Yellow Gas Line PTFE Thread Seal Tape - Universal Screw Driver - Vice Grips
Parts Return Information:	- No Return Parts




WINNTEC Model #6020 LP REGULATOR

Bulletin Type:	RCL	Publication Date:	August 2021 Revised December 2021
Bulletin #(s):	21V-431 US 2021-368 Canadian	Make(s):	Starcraft
Job Code(s):	9902567A – Inspection Only 9902567B – Inspection, Complete Replace, LP Leak Test	Model(s):	Various Models
Flat Rate(s):	9902567A - .10 hr 9902567B - .50 hr	Model Year(s):	2017-2021

Incident:	Regulators may supply elevated, Intermittent, or low propane pressure or flow to appliances.		
Affected Units:	2017 AR-ONE MAXX TT	2019 MOSSY OAK LITE TT	
	2018-2021 AUTUMN RIDGE OUTFITTER TT	2019-2020 MOSSY OAK TT	
	2017 AUTUMN RIDGE SCS TT	2019-2020 MOSSY OAK ULTRA LITE TT	
	2017-2019 AUTUMN RIDGE TT	2018 SOLSTICS FW	
	2018-2019 AVALON TT	2017-2018 SOLSTICE SUPER LITE FW	
	2018-2019 GPS TT	2019-2021 SUPER LITE TT	
	2018-2019 LAUNCH OUTFITTER TT	2018-2020 TELLURIDE FW	
	2017-2019 LAUNCH ULTRA LITE TT	2017 TRAVEL STAR EXP TT	
Parts Kit Details:	Kit#: 21V-425		
	Contents:		
	- 1 ea.- 21V-425-Kit LP Regulator		
Misc. Tools & Supplies:	- Yellow Gas Line PTFE Thread Seal Tape		
	- Universal Screw Driver		
	- Vice Grips		
Parts Return Information:	- No Return Parts		

INSPECTION OF WINNTEC MODEL #6020 LP REGULATOR

1. Only the Winntec Model #6020 - Dual Stage Double Cylinder - Automatic Changeover Regulator with Pigtails is affected. Replace the regulator and pigtails if the manufacturing date code stamped into the regulator is 2018 or 2019. Example shown below.

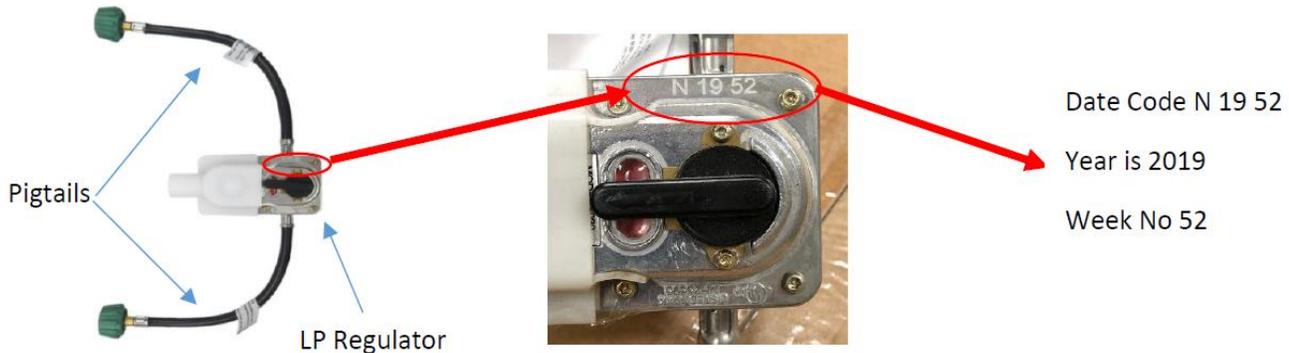

2. File a claim for inspection only if the unit does not have a Winntec model #6020 LP regulator or if the date code stamped into the regulator is not 18 XX, or 19 XX. Only replace regulators with date codes 18 XX and 19 XX.

REPLACING THE WINNTEC MODEL #6020 LP REGULATOR

1. Close the LP bottles and unscrew the pigtails from the LP bottles.
2. Remove the regulator from the unit.
3. Attach the new regulator to the unit.
4. Connect pigtails to LP bottles.
5. Check fittings, regulator, and connections using approved LP leak detection methods.
6. Proceed with a Drop Pressure Test:
 - a. Insert manometer into LP system.
 - b. Turn on both LP tanks.
 - c. Turn off both LP tanks.
 - d. Bleed system down to 8" water column.
 - e. System must hold 8" water column for a minimum of 3 minutes.
7. Ensure system operating pressure is at 11" (+-0.5) water column with 50% load and lockout pressure does not exceed 14" water column.

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law. Jan. 2019.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540