



WINNTEC Model #6020 LP REGULATOR

Bulletin Type:	RCL	Publication Date:	November 2021 Revised December 2021
Bulletin #(s):	21V-685 US 2021-562 Canadian	Make(s):	Jayco
Job Code(s):	9901570A - Inspection Only 9901570B - Inspection, Complete Replace, LP Leak Test	Model(s):	Various Models
Flat Rate(s):	9901570A - .10 hr 9901570B - .50 hr	Model Year(s):	2017-2022

Incident:	Regulators may supply elevated, Intermittent, or low propane pressure or flow to appliances.		
Affected Units:	2017-2021 Eagle FW 2021 Jay Feather TT 2021 Jay Flight Bungalow 2019-2022 Jay Flight SLX TT 2020-2021 North Point FW 2021 Pinnacle FW 2018-2021 Talon FW	2020 Eagle HT FW 2020-2021 Eagle HT TT 2020-2021 Jay Flight Octane TT 2021-2022 Jay Flight TT 2021 Octane Super lite TT 2017-2021 Seismic FW 2020-2021 White Hawk TT	
Parts Kit Details:	Kit#: 21V-425		
	Contents: - 1 ea.- 21V-425-Kit LP Regulator		
Misc. Tools & Supplies:	<ul style="list-style-type: none"> - Yellow Gas Line PTFE Thread Seal Tape - Universal Screw Driver - Vice Grips 		
Parts Return Information:	- No Return Parts		



Highland
RIDGE RV



WINNTEC Model #6020 LP REGULATOR

Bulletin Type:	RCL
Bulletin #(s):	21V-686 US 2021-564 Canadian
Job Code(s):	9904570A – Inspection Only 9904570B – Inspection, Complete Replace, LP Leak Test
Flat Rate(s):	9904570A - .10 hr 9904570B - .50 hr

Publication Date:	November 2021 Revised December 2021
Make(s):	Highland Ridge
Model(s):	Various Models
Model Year(s):	2020-2022

Incident:	Regulators may supply elevated, Intermittent, or low propane pressure or flow to appliances.	
Affected Units:	2021 MESA RIDGE LIMITED FW 2021 MESA RIDGE LIMITED TT 2021 MESA RIDGE LITE TT 2021-2022 OLYMPIA TT TT 2021 OPEN RANGE LIGHT FW	2020-2021 OPEN RANGE LIGHT TT 2021-2022 OPEN RANGE TT 2021 OPEN RANGE ULTRA LITE TT 2021 SILVERSTAR LIMITED TT 2021 SILVERSTAR LITE TT
Parts Kit Details:	Kit#: 21V-425	
	Contents: - 1 ea.- 21V-425-Kit LP Regulator	
Misc. Tools & Supplies:	- Yellow Gas Line PTFE Thread Seal Tape - Universal Screw Driver - Vice Grips	
Parts Return Information:	- No Return Parts	




WINNTEC Model #6020 LP REGULATOR

Bulletin Type:	RCL	Publication Date:	November 2021 Revised December 2021
Bulletin #(s):	21V-687 US 2021-563 Canadian	Make(s):	Starcraft
Job Code(s):	9902570A – Inspection Only 9902570B – Inspection, Complete Replace, LP Leak Test	Model(s):	Various Models
Flat Rate(s):	9902570A - .10 hr 9902570B - .50 hr	Model Year(s):	2021-2022

Incident:	Regulators may supply elevated, Intermittent, or low propane pressure or flow to appliances.
Affected Units:	2021-2022 AUTUMN RIDGE OUTFITTER TT 2021 SUPER LITE TT 2021 TELLURIDE FW
Parts Kit Details:	Kit#: 21V-425
	Contents: <ul style="list-style-type: none"> - 1 ea.- 21V-425-Kit LP Regulator
Misc. Tools & Supplies:	<ul style="list-style-type: none"> - Yellow Gas Line PTFE Thread Seal Tape - Universal Screw Driver - Vice Grips
Parts Return Information:	<ul style="list-style-type: none"> - No Return Parts

INSPECTION OF WINNTEC MODEL #6020 LP REGULATOR

1. Only the Winntec Model #6020 - Dual Stage Double Cylinder - Automatic Changeover Regulator with Pigtails is affected. Replace the regulator and pigtails if the manufacturing date code stamped into the regulator is 18 XX, 19 XX or 20 XX. Example shown below.

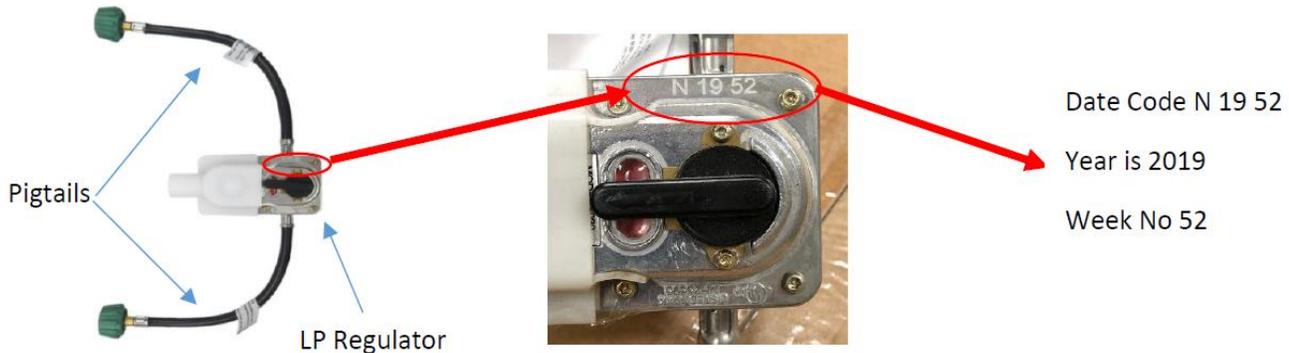

2. File a claim for inspection only if the unit does not have a Winntec model #6020 LP regulator or if the date code stamped into the regulator is not 18 XX, 19 XX or 20 XX. Only replace regulators with date codes 18 XX, 19 XX and 20 XX.

REPLACING THE WINNTEC MODEL #6020 LP REGULATOR

1. Close the LP bottles and unscrew the pigtails from the LP bottles.
2. Remove the regulator from the unit.
3. Attach the new regulator to the unit.
4. Connect pigtails to LP bottles.
5. Check fittings, regulator, and connections using approved LP leak detection methods.
6. Proceed with a Drop Pressure Test:
 - a. Insert manometer into LP system.
 - b. Turn on both LP tanks.
 - c. Turn off both LP tanks.
 - d. Bleed system down to 8" water column.
 - e. System must hold 8" water column for a minimum of 3 minutes.
7. Ensure system operating pressure is at 11" (+-0.5) water column with 50% load and lockout pressure does not exceed 14" water column.

Jayco's sole obligation under our limited warranty is to repair or replace defective materials and/or workmanship deemed our responsibility as determined by Jayco in our sole discretion. Jayco reserves the right to use new and/or remanufactured parts or materials of similar quality to complete any work, and to make parts and/or design changes as appropriate without notice to anyone. Jayco designs and/or materials changes are done without obligation to incorporate such changes in previously manufactured product. Jayco makes every reasonable effort to ensure field remedies will not adversely affect performance and/or safety of the unit. This field remedy is not intended to extend to future performance of this RV, or any of its materials, components or parts beyond the standard warranty period. The RV owner's obligation to notify Jayco, or one of its independent, authorized dealers, of a claimed defect does not modify any obligation placed on the RV owner to contact Jayco directly when attempting to pursue remedies under state or federal law. Jan. 2019.

903 South Main Street • P.O. Box 460 • Middlebury, IN 46540