RECALL 21V988, 2021-773 REMEDY INSTRUCTIONS



Make(s): CARDINAL FIFTH-WHEEL Model(s): CAF390FBX & CAF390FBX-W

Model Year(s): 2020 - 2022

Concern:

The generator compartment may not be sealed from the interior of the vehicle, which may allow carbon monoxide to enter the vehicle.

Repair Code: RC-004-19-00-004128

Allotted Time: .25 HRS.

Inspection Code: RC-004-05-00-004127

Allotted Time: .10 HRS.

Photo(s) Required: YES

Prior Authorization Required: YES

Part(s) Kit Number: N/A Part(s) Return: NO

Disconnect the vehicles' battery Positive and Negative, disconnect any House battery(s) Positive and Negative, if equipped with a generator ensure it is off and lastly, ensure the vehicle is disconnected from shore power. Block any tires/wheels to prevent the vehicle from rolling. Failure to do so may result in electrocution, fire or other personal injury, property damage and/or death.


STEP 1: OPEN AND SECURE THE FRONT LOWER BAGGAGE DOOR TO ACCESS THE GENERATOR COMPARTMENT;

INSPECTION:

STEP 1: INSPECT THE FLANGES OF THE GENERATOR COMPARTMENT BOX FOR FOAM TAPE; INSPECT THE MECHANICAL SEAMS TO ENSURE THEY ARE SEALED WITH SILICONE; FIGURE 1 BELOW INDICATE A SEALED BOX;

IF THE GENERATOR BOX IS SEALED PER FIGURES 1, TAKE PHOTOS & CLAIM THE INSPECTION CODE.

FIGURE 1

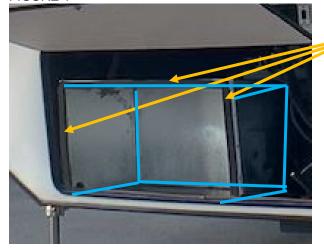


EXAMPLE OF A SEALED GENERATOR BOX

- FOAM TAPE ON THE FLANGES THAT SEAL TO THE BAGGAGE DOOR.
- SILICONE ALONG ALL SEAMS INSIDE THE COMPARTMENT BOX (BLUE LINES)

REMEDY:

STEP 1: IF THE GENERATOR BOX DOES NOT HAVE FOAM TAPE OR ANY SEALANT (COMBINATION OF BOTH OR MISSING ANY FOAM TAPE AND/OR SEALANT), REFER TO FIGURE 2;

FIGURE 2:

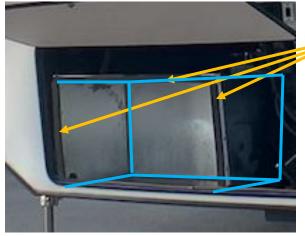

SEAL THE GENERATOR BOX

- FOAM TAPE ON THE FLANGES THAT SEAL TO THE BAGGAGE DOOR.
- SILICONE ALONG ALL SEAMS INSIDE THE COMPARTMENT BOX (BLUE LINES)