


**CONDITION OF CONCERN**

On certain subject vehicles, the wheel and tire assembly may be equipped with a tire air valve having damage to the air valve sealing surface. If the affected tire air valve is installed, it is possible that an inflated tire may result in either a slow or sudden loss of air. A sudden air leak from the tire air valve may cause a loss of vehicle control while driving, increasing the risk of a crash.

A warning lamp and warning messages in the Multi-Information Display may notify the driver of a reduction in tire pressure if this defect occurs.

**Causal factor:**

Certain previously-installed and removed tire air valves might be mixed with new parts at the supplier due to improper isolation procedure. The previously-installed and removed tire air valve may have a damage on the sealing surface.

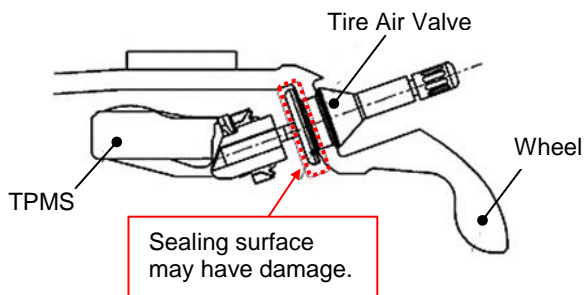

**OUTLINE OF REPAIR**

The tire air valves on all four wheel and tire assemblies will be replaced with new ones.

Please refer to the Repair Procedure document on MGSS for further details.

**SUBJECT VEHICLES**

Model	Subject VIN range	Subject production date range
CX-30 built at MMVO	3MVDM**** MM 217514 – 229817	From September 25, 2020 through November 9, 2020
Mazda3 built at MMVO	3MZBP**** MM 207935 – 207975	From October 22, 2020 and October 23, 2020

The asterisk symbol "\*" can be any letter or number.

**OWNER NOTIFICATION**

Mazda will notify U.S. owners by first class mail no later than XXXX xx, 2021.

**PARTS INFORMATION**

Description	Part Number	Quantity	Note
Wheel Sensor (Tire air valve with TPMS)	BDGF-37-140	4	
Campaign Label	9999-95-065A-06	1=50 labels	Obtain in Mazda e-Store (no charge)

**WARRANTY CLAIM PROCESSING INFORMATION**

	Replacement of Tire Air Valves
Process Number	AM009A
Symptom Code	99
Damage Code	99
Causal Part Number	BDGF-37-140
Quantity	4 pcs.
Labor Operation	XXT23XRX
Labor Hours	1.3 hrs.

Note: If the replacement of tire air valves is outsourced, please submit the actual cost incurred with the Sublet code "Z9".

**RENTAL CAR INFORMATION**

Mazda recommends the usage of the MCVP loaner vehicle when available. If all MCVP loaner vehicles are in use and unavailable, and the customer needs a rental car, then use your local rental facility and offer a rental car. Be sure that every effort is made to repair the car within one business day or less, so the next customer can receive the same experience.

**Rental Car Warranty Claim Information**

	MCVP Vehicle Preferred	Rental Agency Vehicle
Warranty Type Code	N/A  MCVP does not require claim submission	A
Symptom Code		99
Damage Code		99
Part Number Main Cause		5555-47-21BR
Part Quantity		0
Labor Operation Code		MM024XRX
Labor Hours		0
Sublet – Rental Car		
Sublet Invoice Number		Number from Rental Invoice or Dealer Purchase Order
Sublet Type Code		Enter "Z9" (other)
Sublet Amount		Up to \$30.00 per day for the number of days customer had rental car
Sublet Text		Number of days rental car was supplied to customer

Rental expenses exceeding the two-day limit will require prior Warranty Department Authorization, as outlined in the Mazda Rental Car Reimbursement Program policy.