

- 6/1/2021 -Received incident report regarding outside stove on LP connection leaking.
- 6/2/2021 –A Flat rate analysis of other claims in the system showed there was one other claim in the system for the same possible issue.
- 6/4/2021- Pictures were provided from the original incident report from 6/1/2021 that showed what looked to be the same issue as the second report.
- 6/7/2021 – 6/9/2021 –The plants that used this cooktop and the new griddle version of this cooktop were inspected for proper installation.
- 6/10/2021 –Several plants are using a 90 degree swivel fitting before they install the LP hose. Spoke with Sam about eliminating this fitting and just connecting the LP directly to the back of the cooktop/griddle to eliminate a possible point of leaking going forward.
- 6/10/2021 –New installation instructions are being written to address proper installation of LP lines and the addition of a rubberized P-clamp to ensure there is no kinking of the LP line once installed.
- 6/10/2021 –All plants are installing the LP connection correctly except for plants 21 & 501.
- 6/10/2021 – One incident report is for a unit built out of plant 7a and the other two are from units built in 21.
- Based on the information on when the 7a started using the cooktop (7/20) we included all units from 7a in the unit population for possible recall.
- Safety committee met on 6/15/2021 and voted for a recall.