Updated September 19, 2022 – to simplify and break out related parts not part of the actual recall.

Also, any additional parts not listed below will require pre-authorization approval prior to repairing the vehicle.

CONDITION OF CONCERN

On the affected vehicles, the impeller in the low-pressure fuel pump may become deformed causing fuel pump failure. Fuel pump failure may result in engine no start and/or stall, increasing the risk of a crash. Drivers may notice this defect by a check engine light, and/or rough engine operation.

OUTLINE OF REPAIR

Improved low pressure fuel pump will be installed on the subject vehicles.

Please refer to the Repair Procedure document on MGSS for further details.

SUBJECT VEHICLES

Model	Subject VIN range	Subject production date range
2018-2019MY	JM3KF**** J* 387268 – 476254	From April 3, 2018, through
CX-5	JM3KF**** K* 500024 – 514334	October 27, 2018
2018MY	JM1GL**** J1 313085 – 329168	From April 6, 2018, through
Mazda6	JMTGL JT 313085 - 329188	October 24, 2018
2018-2019MY	JM3TC**** J0 229736 – 237357	From April 16, 2018, through
CX-9	JM3TC**** K0 300008 – 308082	October 17, 2018
2019MY	JM1DK**** K* 403654 – 428073	From April 10, 2018, through
CX-3	JMTDK K 403034 - 428073	November 6, 2018
2018-2019MY	JM1ND**** J0 205791 – 206202	From April 5, 2018, through
MX-5	JM1ND**** K0 300011 – 303267	October 29, 2018
2018MY	JM1BN**** J1 191050 – 198901	From May 7, 2018, through
Mazda3	JMTBIN JT 191030 - 198901	October 1, 2018
2019-2020MY	3MDDJ**** KM 309487 – 316139	From November 1, 2018, through
Mazda2	3MDDJ**** LM 400466 – 401990	January 13, 2020

The asterisk symbol "*" can be any letter or number.

OWNER NOTIFICATION

Mazda will notify U.S. owners by first class mail no later than January 8, 2021.

PARTS INFORMATION

If a FUEL TANK is needed, please fill out Dealer Recall Help with photos and fuel tank part numbers you need. We will advise next steps after reviewing.

Description	Part Number	Quantity	Applicable Model	Note	Scrap
	PEY1-13-350		Mazda3 (BN)		
	PEY3-13-350		CX-5 (KF), Mazda6 (GL), CX-3 (DK), MX-5 (ND) 2.0 or 2.5 Non-Turbo engine		
Fuel Pump Kit	PYY1-13-350	1	CX-5 (KF), Mazda6 (GL) CX-9 (TC)FWD 2.5 Turbo		Yes
	PYY2-13-350		CX-5 (KF) AWD 2.5 Turbo CX-9 (TC) AWD 2.5 Turbo		
	P5Y1-13-350		Mazda2 (DJ)		
	292135-0021 (20CM)		CX-5		
FDM Harness Part Number & Qty 1 (one harness per model	292135-0321 (17.5 CM)	1	CX-3 (2WD), Mazda6, CX-9, Mazda3*, Mazda2*	*Mexico, Canada, or US Territory	No
only. Lengths in Red) REPLACE ONLY IF	292135-1074 (25 CM)		MX-5	vehicles	
<u>NEEDED</u>	292135-0181 (22.5 CM)		CX-3 (AWD Only)	,	
Fuel Tank Screws	9983-30-408		All except CX-3 and Mazda2	N/A	Yes
Gasket	BBM2-42-166A	1	CX-5 (KF), Mazda6 (GL), CX-9 (TC), MX-5 (ND), Mazda3 (BN)		Yes
	DA8A-42-166		CX-3 (DK), Mazda2 (DJ)		
Campaign Label	9999-95-065A-	1=50		Obtain in	
	06	labels		Mazda e-	
Vehicle Emission Recall Proof of Correction Certificate *	9999-95-ERPC- 99	1=50 certificates		Store (no charge)	N/A

Note: Please refer to the subject VIN list for applicable part number for each VIN.

The second second	C of the late	Identification Numbe	TIT
Corres Number	Make	Ther Model	Bach Type
	scie has been repaired.	modified and/or apppped with new California enterent context tawa adu	annuales control devices to meet specify your state of communication
Dealer's Harter	Address. City D	tank and Zip	

* California Department of Motor Vehicles and the Commonwealth of Massachusetts, in conjunction with the California Air Resources Board and the Environmental Protection Agency for the State of Massachusetts, have implemented the Registration Renewal/Recall Tie-In Program, which requires the completion of Emission Recalls prior to registration renewal. Mazda dealers must provide customers a Vehicle Emission Recall – Proof of Correction Certificate (p/n 9999-95-ERPC-99) upon completion of the recall.

WARRANTY CLAIM PROCESSING INFORMATION – USE ONLY WHEN RUSTED/SHEARED SCREWS ARE REPLACED WITH A FUEL PUMP.

WARRANTY CLAIM PROCESSING INFORMATION – NO ADDITIONAL PARTS REPLACED

Any additional parts require pre-authorization prior to repairing the vehicle.

NOTE: All repair times below (which are equal to warranty time) include draining fuel if needed for repair when the fuel level is 3/4 to full.

If a FUEL TANK is needed, please send to Dealer Recall Help with photos and fuel tank part numbers you need. We will advise next steps after reviewing.

If a FUEL PUMP & GAUGE UNIT is needed, please send to Dealer Recall Help with photos and fuel tank part numbers you need. We will advise next steps after reviewing.

For CX-5 (KF)	Replacement of fuel pump	
Process Number	AM039A	
Symptom Code	99	
Damage Code	99	
Causal Part No. & Quantity	PEY3-13-350 Without Turbo Engine FWD, AWD PYY2-13-350 AWD Turbo Engine. & 1	
Related Part No. & Quantity	BBM2-42-166A & 1 pc	
Labor Operation Number & Hours	XXT83XRX	
Labor Hours	0.9 Hours	
<u>If oth</u>	ner parts are required	
Related Part No. & Quantity	292135-0021 (20CM) FDM Harness - <u>ONLY IF NEEDED</u>	
Related Part No. & Quantity	9999-0408 (8 max) Tank Screws - <u>ONLY IF NEEDED</u>	
Harness Labor Operation Number & Hours <u>ONLY IF NEEDED *</u>	XXW1NXRX & up to 0.4 max	
Screws Labor Operation Number & Hours ONLY IF NEEDED	XXW1NXRX & up to 0.5 max (Up to 0.9 hours total if both repairs are needed)	
Sublet H9 - (when using locally sourced screws only)	Sublet type code: H9 Sublet amount: Actual cost of screws (*1) Attachment ID – D14 - Invoice from vendor	

* There must be 2 separate punch times when Harness labor operation is used, and this can only be for temporary vehicle storage

(*1) If locally sourced screws are used for replacement, submit the actual cost of screws with sublet code "H9".

Any actual Time must comply with all Mazda Warranty Policies and Procedures

For MAZDA6 (GL)	Replacement of fuel pump	
Process Number	AM039A	
Symptom Code	99	
Damage Code	99	
Causal Part No. & Quantity	PYY1-13-350 Turbo PEY3-13-350 Non-Turbo & 1	
Related Part No.& Quantity	BBM2-42-166A & 1	
Labor Operation Number	XXT83ARX	
Labor Hours	0.8 Hours	
If other parts are required		
Related Part No. & Quantity	292135-0321 (17.5CM) FDM Harness - <u>ONLY IF NEEDED</u>	
Related Part No. & Quantity	9999-0408 (8 max) Tank Screws - <u>ONLY IF NEEDED</u>	
Harness Labor Operation Number & Hours <u>ONLY IF NEEDED *</u>	XXW1NXRX & up to 0.4 max	
Screws Labor Operation Number & Hours	XXW1NXRX & up to 0.5 max	
ONLY IF NEEDED *	(Up to 0.9 hours total if both repairs are needed)	
Sublet H9 - (when using locally sourced screws only)	Sublet type code: H9 Sublet amount: Actual cost of screws (*1) Attachment ID – D14 - Invoice from vendor	

* There must be 2 separate punch times when Harness labor operation is used, and this can only be for temporary vehicle storage

(*1) If locally sourced screws are used for replacement, submit the actual cost of screws with sublet code "H9". NOTE: Factory screws are now in stock as of September 19, 2022

Any actual Time must comply with all Mazda Warranty Policies and Procedures

For CX-9 (TC)	Replacement of fuel pump (2WD)	Replacement of fuel pump (4WD)	
Process Number	AM039A		
Symptom Code	99		
Damage Code	99		
Causal Part No. & Quantity	PYY1-13-350 FWD & 1	PYY2-13-350 AWD & 1	
Related Part No. & Quantity	BBM2-42	-166A & 1	
Labor Operation Number	XXT83ERX	XXT83HRX	
Labor Hours	1.0 Hour	1.2 Hours	
Related Part No.& Quantity	292135-0321 (17.5CM) FDM Harness - <u>ONLY IF NEEDED</u>		
Related Part No. & Quantity	9999-0408 (8 max) Tank Screws - <u>ONLY IF NEEDED</u>		
If other parts are required			
Harness Labor Operation Number & Hours <u>ONLY IF</u> <u>NEEDED *</u>	XXW1NXRX &	up to 0.4 max	
Screws Labor Operation Number & Hours <u>ONLY IF</u> <u>NEEDED *</u>	XXW1NXRX & up to 0.5 max (Up to 0.9 hours total if both repairs are needed)		
Sublet H9 - (when using locally sourced screws only)	Sublet type code: H9 Sublet amount: Actual cost of screws (*1) Attachment ID – D14 - Invoice from vendor		

* There must be 2 separate punch times when Harness labor operation is used, and this can only be for temporary vehicle storage

(*1) If locally sourced screws are used for replacement, submit the actual cost of screws with sublet code "H9".

Any actual Time must comply with all Mazda Warranty Policies and Procedures

For CX-3 (DK)	Replacement of fuel pump	
Process Number	AM039A	
Symptom Code	99	
Damage Code	99	
Causal Part No. & Quantity	PEY3-13-350 & 1	
Related Part No.& Quantity	DA8A-42-166 & 1	
Labor Operation Number	XXT83ARX	
Labor Hours	0.8 Hours	
<u>If other</u>	r parts are required	
Related Part No. & Quantity	292135-0321 (17.5CM) – 2WD 292135-0181 (22.5 CM) - AWD FDM Harness - <u>ONLY IF NEEDED</u>	
Harness Labor Operation Number & Hours <u>ONLY IF NEEDED *</u>	XXW1NXRX & up to 0.4 max	

* There must be 2 separate punch times when Harness labor operation is used, and this can only be for temporary vehicle storage. Any actual Time must comply with all Mazda Warranty Policies and Procedures

For MX-5 (ND)	Convertible top	Retractable top	
Process Number	AM039A		
Symptom Code	99		
Damage Code	99		
Causal Part No. & Quantity	PEY3-13-350 & 1		
Related Part No. & Quantity	BBM2-4	2-166A & 1	
Labor Operation Number	XXT83ARX	XXT83XRX	
Labor Hours	1.5 Hours	1.7 Hours	
If other parts are required			
Related Part No. & Quantity	292135-1074 (25 CM) - FDM Harness - ONLY IF NEEDED		
Related Part No. & Quantity	9999-0408 (8 max) - Tank Screws - ONLY IF NEEDED		
Harness Labor Operation Number & Hours <u>ONLY IF</u> <u>NEEDED *</u>	XXW1NXRX & up to 0.4 max		
Screws Labor Operation Number & Hours <u>ONLY IF</u> <u>NEEDED *</u>	XXW1NXRX & up to 0.5 max (Up to 0.9 hours total if both repairs are needed)		
Sublet H9 - (when using locally sourced screws only)	Sublet type code: H9 Sublet amount: Actual cost of screws (*1) Attachment ID – D14 - Invoice from vendor		

* There must be 2 separate punch times when Harness labor operation is used, and this can only be for temporary vehicle storage. Any actual Time must comply with all Mazda Warranty Policies and Procedures.

(*1) If locally sourced screws are used for replacement, submit the actual cost of screws with sublet code "H9".

For all Mazda3 and Mazda2 vehicles please contact DAG as they will need to obtain the part from the original distributor, Mexico, Canada, or US Territories.

For MAZDA3 (BN)	Replacement of fuel pump	
Process Number	AM039A	
Symptom Code	99	
Damage Code	99	
Causal Part No. & Quantity	PEY1-13-350 & 1	
Related Part No.& Quantity	BBM2-42-166A & 1	
Labor Operation Number	XXT83ARX	
Labor Hours	0.8 Hours	
If other parts are required		
Related Part No.& Quantity	292135-0321 (17.5CM) FDM Harness - <u>ONLY IF NEEDED</u>	
Harness Labor Operation Number & Hours <u>ONLY IF NEEDED *</u>	XXW1NXRX & Up to 0.4 max	

* There must be 2 separate punch times when Harness labor operation is used, and this can only be for temporary vehicle storage.

Any actual Time must comply with all Mazda Warranty Policies and Procedures.

For Mazda2 (DJ)	Replacement of fuel pump	
Process Number	AM039A	
Symptom Code	99	
Damage Code	99	
Causal Part No. & Quantity	P5Y1-13-350 & 1	
Related Part No.& Quantity	DA8A-42-166 & 1	
Labor Operation Number	XXT83ARX	
Labor Hours	0.8 Hours	
If other parts are required		
Related Part No.& Quantity	292135-0321 (17.5CM) FDM Harness - <u>ONLY IF NEEDED</u>	
Harness Labor Operation Number & Hours <u>ONLY IF NEEDED *</u>	XXW1NXRX & Up to 0.4 max	

* There must be 2 separate punch times when Harness labor operation is used, and this can only be for temporary vehicle storage.

Any actual Time must comply with all Mazda Warranty Policies and Procedures.

RENTAL CAR INFORMATION

Rental expenses exceeding the two-day limit will require prior Warranty Department Authorization, regardless of the reason, as outlined in the Mazda Rental Car Reimbursement Program policy. In addition, any parts need to be on CEO order and if an ETA is 5 days or more, contact the Warranty Department or Dealer Recall Help with estimated time of arrival for parts.

Mazda recommends the usage of the MCVP loaner vehicle when available. If all MCVP loaner vehicles are in use and unavailable, and the customer needs a rental car, then use your local rental facility and offer a rental car. Be sure that every effort is made to repair the car within one business day or less, so the next customer can receive the same experience.

	MCVP Vehicle Preferred	Rental Agency Vehicle
Warranty Type Code		А
Symptom Code		99
Damage Code		99
Part Number Main Cause		5555-53-21KR
Part Quantity		0
Labor Operation Code		MM024XRX
Labor Hours	N/A	0
Sublet – Rental Car	,	
Sublet Invoice	MCVP does not require claim	Number from Rental Invoice
Number	submission	or Dealer Purchase Order
Sublet Type Code		Enter "Z9" (other)
Sublet Amount		Up to \$30.00 per day for
		the number of days
		customer had rental car
Sublet Text		Number of days rental car
		was supplied to customer

Rental Car Warranty Claim Information