Part 573 Safety Recall Report

Manufacturer Name :Custom Wheel House LLCSubmission Date :MAR 23, 2022NHTSA Recall No. :22E-020Manufacturer Recall No. :NR

Manufacturer Information :

Manufacturer Name : Custom Wheel House LLC Address : 15500 Cornet St Santa Fe Springs CA 90670 Company phone : 8667798604

Population :

Number of potentially involved : 116 Estimated percentage with defect : 50 %

🖈 🛝 📩 😡

NATIONAL HIGHWAY TRAFFIC SAFETY ADMINISTRATION

22E-020

Equipment Information :

| Brand / Trade 1: | Method Race Wheels |
|---------------------------|---|
| Model : | MR316 |
| Part No. : | MR31678060525 |
| Size : | 17x8, +25 Offset, 6x5.5(139.7) |
| Function : | Wheel Rim |
| Descriptive Information : | The recall population includes MR31678060525 wheels received and sold between 11/01/2021 to 02/01/2022 with casting lot markings of "20C" and "13B". The quantity of wheels that may contain those casting lots is 389. The quantity of wheels sold in that time is 116. The recall population was determined based on factory work record and product quality control markings identifying casting date and casting lot number on the wheels. |
| Production Dates : | OCT 14, 2021 - NOV 18, 2021 |

Description of Defect :

| Description of the Defect : | Custom Wheel House LLC observed during a routine audit test that subject wheels exhibited cracking in the spokes when subject to the cornering fatigue test, conducted pursuant to SAE J2530. The wheel may experience cracking under extreme loads, i.e. vehicles with axle weights at or near the marked maximum load rating and using the maximum recommended tire diameter of 37 inches. |
|----------------------------------|---|
| FMVSS 1 : | NR |
| FMVSS 2 : | NR |
| Description of the Safety Risk : | The safety risk is of the wheel cracking under extreme loads and maximum ratings, as described. While precise safety-related-risk cannot be quantified with certainty there is risk of causing a vehicle crash, Custom Wheel House will conduct a recall out of abundance of caution. |
| | |
| | |

Part 573 Safety Recall Report

22E-020

Description of the Cause : Factory labor error and mold cooling issue resulted in inferior material mechanical properties.

Identification of Any Warning NR that can Occur :

Involved Components :

| Component Name : | Wheel Rim |
|-------------------------|--|
| Component Description : | MR316, 17x8, +25mm offset, 6x5.5(139.7), Matte Black |
| Component Part Number : | MR31678060525 |

Supplier Identification :

Component Manufacturer

Name : Shandong Jinma Automotive Equipment

Address : 206 National Road, Luozhuang District Linyi City Foreign States

Country: China

Chronology :

December 2021: pre-production sample part fails laboratory cornering fatigue test, which was informed to manufacturing partner to begin investigation, and the factory identified that a likely cause was the casting process not being optimized on pre-production parts.

January 2022: Production is halted, factory inventory quarantined, no shipments approved to leave factory, and the factory notified that some parts from the first production order failed laboratory cornering fatigue testing.

01/30/2022-02/08/2022: Factory shutdown for Chinese New Year

February 2022: Based on review of US laboratory failures and factory work record, the failures are observed to only occur on wheels with 20C and 13B casting lots. Failures do not occur on wheels with any other casting lot identifications.

March 2022: Custom Wheel House notifies dealers of wheels with possible issue to begin gathering customer information.

Page 3

Description of Remedy :

| Description of Remedy Program : | At no cost to the customer, replace subject wheels and service to replace them. If remedy was handled prior to recall owners can mail invoice to Custom Wheel House or call 866-779-8604 for reimbursement. |
|------------------------------------|---|
| | Remedy components will have manufacture dates and casting lot numbers that do not match the affected product. The replacement wheels will not experience cracking of the spokes under the extreme loads described previously. |
| | This was an isolated incident that involved an issue with a mold cooling system and worker not following work instructions. Internal corrective actions, including quarantining all affected inventory parts, have been made at the manufacturing site to prevent re-occurrence. |
| | |
| Recall Schedule : | |
| Planned Dealer Notification Date : | |
| Planned Owner Notification Date : | MAR 24, 2022 - NR |

Purchaser Information :

The following manufacturers purchased this defective/noncompliant equipment for possible use or installation in new motor vehicles or new items of motor vehicle equipment:

Name : NR Address : NR NR Country : NR Company Phone : NR

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573