Part 573 Safety Recall Report

Manufacturer Name : Seagrave Fire Apparatus, LLC Submission Date : FEB 01, 2022 NHTSA Recall No.: 22V-047 Manufacturer Recall No.: NR

Manufacturer Information :

Manufacturer Name : Seagrave Fire Apparatus, LLC Address: 105 East 12th Street Clintonville WI 54929 Company phone: 715-823-2141

Vehicle Information :

	2021-2021 Seagr BUSES, MEDIUM	-			
Power Train :	NR				
Descriptive Information :	NR REV Group, Inc. reported to Meritor that four of its OEMs (Ferrara Fire Apparatus, Inc.,Kovatch Mobile Equipment Corp, E-One Incorporated, Spartan Fire, LLC) had filed 573 Safety Defect Reports for fractured 180 series "Pinion broke off and damaged the spring brake air supply line." The REV Group indicated to Meritor that in two occurrences the fractured pinion hit a drop hose and resulted in unintentional application of the parking brake. Meritor is investigating the root cause as well as the impact to other customers, including those customers impacted by product sold in the replacement market. Although Meritor is still investigating the root cause, Meritor believes that if the defect is present the failure would manifest early in the service life of the pinion. Based on this assumption Meritor worked with REV Group to identify the recalled population as those pinions manufactured between January 1, 2021 and April 20, 2021. The recalled population does not differ from products built prior to January 1, 2021, however Meritor believes that products built prior to that date would have already failed if they had the defect. Pinions manufactured after April 20, 2021 are subject to 100% Ultrasonic Testing and Meritor is unaware of any field failure on pinions manufactured after that date.				
Production Dates :	JAN 01, 2021 - AP	PR 20, 2021			
VIN Range 1: I	Begin :	NR	End :	NR	Not sequential
Description of Defect :					
Description of the Defe		ive Pinion frac	tured ir	1 the spline	
FMVSS					
FMVSS	2: NR				

Description of the Safety Risk : A fracture of the pinion may hit the brake drop hose which may

The information contained in this report was submitted pursuant to 49 CFR §573



22V-047

Population :

Number of potentially involved : 7 Estimated percentage with defect : 10 %

Part 573 Safety Recall Report

Page 2

Description of the Safety Risk :	unintentionally apply parking brake without detection or brake lights coming on, possibly resulting in a crash.
Description of the Cause :	Meritor is still investigating the root cause. At this time Meritor believes the
	180 series pinion and yoke spline interaction during the assembly process may
	result in a overstress condition that could lead to fracture.
Identification of Any Warning	If the pinion fractures, in some cases the driver may hear an audible noise and
that can Occur :	feel the vehicle slowing down due to loss of propulsion from the drive axle.

Involved Components :

Component Name 1 : Rear Axle Carrier Component Description : Pinion Component Part Number : 180 Series

Supplier Identification :

Component Manufacturer

Name : Meritor, Inc Address : 2135 West Maple Road Troy Michigan 48084 Country : United States

Chronology:

December 30, 2021 - NHTSA notified Seagrave Fire Apparatus that Meritor named us as being supplied potential defective axles. December 31, 2021- Seagrave reached out to Meritor for serial numbers of suspect axles and information on

the defect.

January 28, 2022 - Meritor provided valid serial numbers to Seagrave Fire Apparatus.

January 31, 2022 - Based upon the results of the investigation, the Seagrave Product Safety Committee decided to conduct a safety campaign to address this condition. To date, there have been no reports of a crash caused by this condition.

The information contained in this report was submitted pursuant to 49 CFR §573

Description of Remedy :

Description of Remedy Program :	Meritor will support recalls submitted by Seagrave and conduct ultrasonic test inspection and/or carrier replacement for the affected population. Defective units will be replaced at no cost to customer.
How Remedy Component Differs from Recalled Component :	The remedied component will pass ultrasonic test inspection.
	100% Ultrasonic Testing was put in place April 20, 2021 at the Meritor production facility. 2301 parts have been inspected using ultrasonic testing. Two parts with defects have been found in-house since the ultrasonic testing has been in implemented.
Recall Schedule : Description of Recall Schedule :	Seagrave expects to notify affected Dealers and Owners no later than March 02, 2022.

	Mai Cii UL, LULL.
Planned Dealer Notification Date :	FEB 25, 2022 - MAR 02, 2022
Planned Owner Notification Date :	FEB 25, 2022 - MAR 02, 2022

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR \$573