

Part 573 Safety Recall Report

22V-062

Manufacturer Name : Triumph Motorcycles America, Ltd.**Submission Date :** FEB 14, 2022**NHTSA Recall No. :** 22V-062**Manufacturer Recall No. :** SRAN 593**Manufacturer Information :**

Manufacturer Name : Triumph Motorcycles America, Ltd.

Address : 100 Hartsfield Centre Parkway
Suite 200 Atlanta GA 30354

Company phone : 678-854-2010

Population :

Number of potentially involved : 314

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2022-2022 Triumph Trident

Vehicle Type : MOTORCYCLES

Body Style : OTHER

Power Train : GAS

Descriptive Information : The recall population was based upon a review of factory records.

Production Dates : FEB 07, 2021 - MAY 15, 2021

VIN Range 1 : Begin : SMTL10UL0NTAF8694 End : SMTL10UL7NTAT4932 ☐ Not sequential**Description of Defect :**

Description of the Defect : Side stand leg may bend over time and use, causing an affected motorcycle, when parked, to lean beyond its designed angle of lean.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : The motorcycle could become unstable possibly causing the motorcycle to fall when parked on the side stand, increasing the risk of an injury.

Description of the Cause : Incorrect raw material specification.

Identification of Any Warning : An affected motorcycle's angle of lean will gradually increase over time and use that can Occur : of the side stand on affected motorcycles.

Involved Components :

Component Name 1 : Sidestand

Component Description : Sidestand

Component Part Number : T2086607

Supplier Identification :

Component Manufacturer

Name : FUJIN CORPORATION PVT LTD

Address : KHATONI NO. 1629-1648

DABUA PALI ROAD FAIRDABAD Foreign States

Country : India

Chronology :

Mar21: Warranty Dept. identifies the symptom in service and commences initial information gathering.

Apr21: Quality Dept. commence investigation. Warranty to continue to monitor in-service performance of part.

Jan22: Warranty department identifies: 4 x Warranty claims; 1 x Field Report; No Deaths or Injuries.

Quality Dept. discussion with Claims Management Dept. on in-service campaign options. Triumph arrive at safety defect determination decision.

Description of Remedy :

Description of Remedy Program : Dealers will replace the Sidestand leg on all the affected models.

Pursuant to 49 CFR §577.11(e), Triumph requests that it be exempt from providing notification of a reimbursement plan. Any pre-notification product failure would have been addressed under the manufacturer's limited warranty. Accordingly, no person would be eligible for reimbursement pursuant to §573.13.

How Remedy Component Differs from Recalled Component : The remedy component is manufactured to correct material specification.

Identify How/When Recall Condition was Corrected in Production : The recall condition was corrected in production on May 2021.

Recall Schedule :

Description of Recall Schedule : The planned notification dates are an estimate and may be revised.

Planned Dealer Notification Date : FEB 21, 2022 - FEB 21, 2022

Planned Owner Notification Date : FEB 24, 2022 - FEB 24, 2022

* NR - Not Reported