

Part 573 Safety Recall Report

22V-069

Manufacturer Name : Hyundai Motor America

Submission Date : MAR 04, 2022

NHTSA Recall No. : 22V-069

Manufacturer Recall No. : 219



Manufacturer Information :

Manufacturer Name : Hyundai Motor America

Address : 10550 Talbert Avenue

Fountain Valley CA 92708

Company phone : 800-633-5151

Population :

Number of potentially involved : 354

Estimated percentage with defect : 1 %

Vehicle Information :

Vehicle 1 : 2020-2021 Hyundai Accent

Vehicle Type : LIGHT VEHICLES

Body Style : 4-DOOR

Power Train : GAS

Descriptive Information : 354 model year 2020-2021 Accent vehicles produced on March 25, 2020 through July 28, 2020 by Kia Motors Mexico ("KMM") for sale in the U.S. market.

Production Dates : MAR 25, 2020 - JUL 28, 2020

VIN Range 1 : Begin :

NR

End : NR

Not sequential

Description of Defect :

Description of the Defect : The front driver-side and/or passenger-side seat belt pretensioners in the subject vehicles were installed from a suspect production lot containing pyrotechnic-type pretensioners that may deploy abnormally during a crash. At the time of this filing, the cause of the abnormal deployment is unknown. Hyundai is recalling vehicles equipped with pretensioners produced within the same production lot to conduct a detailed part return analysis. The part inspections and investigation will actively continue to determine if a specific root cause and defect trend exists.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : An abnormal pyrotechnic pretensioner deployment could cause metal fragments to enter the vehicle occupant compartment, which may result in injury to vehicle occupants.

Description of the Cause : Hyundai is actively investigating root cause.

Identification of Any Warning that can Occur : None.

Involved Components :

Component Name 1 : S/BELT ASSY-FR P/TENSR 3PT LH/RH

Component Description : Seat belt assembly w/ pretensioner for driver's side & Passenger' side

Component Part Number : 88810J0600

Supplier Identification :**Component Manufacturer**

Name : Samsung

Address : Jungdong St, 62-30

Seongsan-gu Changwon, Gyeongnam Foreign States 51553

Country : Korea, Republic of

Chronology :

See Attachment A for the requested chronology of events.

Description of Remedy :

Description of Remedy Program : Hyundai Motor America plans to notify owners of affected vehicles by first class mail with instructions to bring their vehicles to a Hyundai dealer to have the seat belt pretensioner(s) replacement remedy performed. This remedy will be offered at no cost to owners for all affected vehicles, regardless of whether the affected vehicles are still covered under Hyundai's New Vehicle Limited Warranty. Additionally, Hyundai will provide owners of affected vehicles reimbursement for out-of-pocket expenses incurred to obtain a remedy for the recall condition in accordance with the reimbursement plan submitted to NHTSA on February 24, 2022.

How Remedy Component Differs from Recalled Component : N/A

Identify How/When Recall Condition was Corrected in Production : N/A

Recall Schedule :

Description of Recall Schedule : Dealers and owners will be notified in accordance with the remedy schedule of Recall 211.

Planned Dealer Notification Date : FEB 25, 2022 - FEB 25, 2022

Planned Owner Notification Date : FEB 25, 2022 - FEB 25, 2022

* NR - Not Reported