

Part 573 Safety Recall Report

22V-097

Manufacturer Name : Lance Camper Manufacturing, Corp.**Submission Date :** APR 19, 2022**NHTSA Recall No. :** 22V-097**Manufacturer Recall No. :** NR**Manufacturer Information :****Population :**

Manufacturer Name : Lance Camper Manufacturing, Corp.

Number of potentially involved : 120

Address : 43120 Venture Street

Estimated percentage with defect : 100 %

Lancaster CA 93535

Company phone : 661-949-3322

Vehicle Information :

Vehicle 1 : 2022-2022 Lance 1685,1985

Vehicle Type : TRAILERS

Body Style :

Power Train : NR

Descriptive Information : -New year model build to date of discovery

- Concern was corrected on the production line, these two models were only built.

-120

Production Dates : DEC 28, 2021 - FEB 02, 2022

VIN Range 1 : Begin :

NR

End : NR

☐ Not sequential**Description of Defect :**

Description of the Defect : L.P. hose not secured to the frame, allowing the hose to droop down and could allow the leaf spring shackle to make contact with the L.P. hose.

FMVSS 1 : NR

FMVSS 2 : NR

Description of the Safety Risk : L.P. hose damage and fire

Description of the Cause : Suspension leaf spring could make contact to L.P. hose causing damage to hose and possible L.P. leak.

Identification of Any Warning that can Occur : NR

Involved Components :

Component Name 1 : NR

Component Description : NR

Component Part Number : NR

Supplier Identification :

Component Manufacturer

Name : NR

Address : NR

NR

Country : NR

Chronology :

Notified by Lance dealer on 02/02/2022 of concern, investigated on the production line found that there is potential that the Leaf spring travel could allow the leaf spring shackle to contact the L.P. hose.

Description of Remedy :

Description of Remedy Program : L.P. hose not secured to frame allowing the L.P. hose to droop down so the leaf spring travel come in contact with the L.P. hose, the dealer will secure the L.P. hose out of the line of travel of the leaf spring to the frame with an insulated clamp and screw. Service center will process a claim with Lance and be reimbursed for labor and parts. Lance is allowing 1/2 hour of labor time.

NOTE: Customers who have had this remedy completed before this recall are eligible for reimbursement, contact Lance customer service (661) 949-3322

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : The L.P. line is secured to the frame and out of the line of leaf spring travel.

Recall Schedule :

Description of Recall Schedule : Will send out Owner letters in the month of April

Planned Dealer Notification Date : APR 14, 2022 - APR 19, 2022

Planned Owner Notification Date : APR 14, 2022 - APR 19, 2022

* NR - Not Reported